



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2006625
INV Date 24/09/2020
Reference CC4/LPC20000594/Aka3s2
Code LPC2



PROFESSIONAL SERVICE FEE

Vehicle No. SJK 6685H
Insured Veh. GBE 4947S
Claim No. 19/20/20/VC05/022879
Policy No. Z19VC05004089
Accident Date 06/01/2020
Inspection Date 09/01/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD	Ref : CC4/LPC20000594/Aka3s2
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555	Date : 24-09-2020
	Code : LPC2



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBE 4947S	Veh. Inspected	SJK 6685H
Policy No.	Z19VC05004089	Coverage (\$)	0.00
Claim No.	19/20/20/VC05/022879	Excess (\$)	0.00
Assign From	GERALD POH	Assign Date	08/01/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA CIVIC	c.c	1799
Engine No.	HIDDEN	Year of Reg.	2008
Chassis No.	FD11202360	Colour	BLUE
Odometer	150199	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	DUNLOP	6 mm
L/H Front Tyre	205/55 R16	DUNLOP	6 mm
R/H Rear Tyre	205/55 R16	DUNLOP	6 mm
L/H Rear Tyre	205/55 R16	DUNLOP	6 mm

4. Description of Damages

	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--	--

5. General Information

Accident Date	06/01/2020	Inspection Date	09/01/2020
Survey held at	8 KAKI BUKIT AVE 4 #08-46 SINGAPORE 415875		
Repairer	SK AUTOMOBILE PTE LTD		

5a. Remarks

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

5b. Estimate Days of Repair

	ESTIMATED NORMAL PERIOD FOR REPAIR:	12 Working Days
--	-------------------------------------	------------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJK 6685H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	DISTORTED	798.00	798.00
2	BOOTLID REFLECTOR @ \$222.20	CRACKED	444.40	444.40
2	BOOTLID INNER STOPPER @ \$32.20	NOT NECESSARY	64.40	-
2	BOOTLID HINGE @ \$98.60	BENT	197.20	197.20
2	BOOTLID HINGE COVER @\$56.00	NOT NECESSARY	112.00	-
1	BOOTLID TOP LOCK	DAMAGED	194.50	194.50
1	BOOTLID LOWER LOCK	NOT NECESSARY	35.00	-
1	BOOTLID LOGO	NECESSARY	45.70	45.70
1	BOOTLID WEATHERSTRIP	CUT	139.70	139.70
2	REAR NUMBER PLATE LAMP @ \$44.00		88.00	-
1	REAR NUMBER PLATE LAMP GARNISH	CRACKED	110.00	110.00
2	REAR FENDER @ \$741.50	N/S BUCKLED	1,483.00	741.50
2	REAR FENDER COWLING @ \$79.80	N/S MISSING	159.60	79.80
2	REAR FENDER MUDFLAP @ \$79.90	NOT NECESSARY	159.80	-
1	REAR FENDER AIR VENT	NOT NECESSARY	69.80	-
2	REAR FENDER INNER TRIM @ \$198.90	DEFORMED	397.80	397.80
1	REAR WINDSCREEN MOULDING	NECESSARY	136.00	136.00
1	REAR WINDSCREEN	NOT NECESSARY	1,145.00	-
2	REAR DOOR INNER LOCK @ \$211.60	NOT NECESSARY	423.20	-
1	REAR BUMPER	DISTORTED	678.60	678.60
2	REAR BUMPER SIDE RETAINER @ \$42.10	NECESSARY	84.20	84.20
1	REAR BUMPER EXHAUST GARNISH	DEFORMED	67.90	67.90
2	REAR BUMPER BRACKET @ \$32.80	NOT NECESSARY	65.60	-
2	TAILLAMP @ \$369.70	CRACKED	739.40	739.40
2	TAILLAMP PANEL @ \$256.10	N/S DENTED	512.20	256.10
2	TAILLAMP LOWER BRACKET @ \$39.10	BENT	78.20	78.20
1	REAR END PANEL	DISTORTED	397.40	397.40
1	REAR END PANEL TOP GARNISH	DEFORMED	142.40	142.40
1	REAR FLOOR PANEL	BUCKLED	992.20	992.20
1	REAR FLOOR PANEL TOP BOARD	DEFORMED	316.00	316.00
1	REAR FLOOR PANEL UNDER COVER	DEFORMED	284.00	284.00

Report Ref No. CC4/LPC20000594/Aka3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR CHASSIS FRAME EXTENSION	TO REPAIR SEE LABOUR	583.50	-
1	REAR SPARE TYRE BOLT	NOT NECESSARY	29.20	-
1	REAR EXHAUST PIPE	NOT NECESSARY	635.40	-
1	REAR EXHAUST PIPE INSULATION	NOT NECESSARY	221.00	-
2	REAR EXHAUST MOUNTING @ \$16.00	NOT NECESSARY	32.00	-
	LESS 20% DISCOUNT		-2,412.46	-1,464.20
			9,649.84	5,856.80
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	REAR LED LIGHT (SN)	DAMAGED	100.00	50.00
10	REAR BUMPER CLIP @ \$6.50 (SN)	NECESSARY	65.00	30.00
4	TAIL LAMP CLIP @ \$8.00 (SN)	NECESSARY	32.00	20.00
2	TAILLAMP PANEL SEALANT @ \$40.00 (SN)	NOT NECESSARY	80.00	-
1	BOOTLID SEALANT (SN)	NOT NECESSARY	60.00	-
12	REAR FENDER COWLING CLIP @ \$6.50 (SN)	NECESSARY	78.00	20.00
18	REAR FENDER INNER TRIM CLIPS @ \$6.50 (SN)	NECESSARY	117.00	60.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)		60.00	40.00
4	REAR END PANEL TOP GARNISH CLIPS @ \$10.00 (SN)	NECESSARY	40.00	10.00
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	120.00	60.00
1	REAR FLOOR PANEL INSULATION SEAL (SN)	NECESSARY	150.00	150.00
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
1	REVERSE CAMERA (SN)	DAMAGED	400.00	350.00
			1,652.00	1,030.00
	<u>LABOUR</u>			
	PANEL BEATING, REMOVAL AND REPLACING PARTS. INCLUSIVE OF THE REPAIR OF REAR CHASSIS FRAME EXTENSION.		2,200.00	1,600.00
	TO SPRAY PAINT AFFECTED AREA.		1,800.00	1,400.00
	TUFF COAT.		250.00	120.00
	WIRING CHECK.		60.00	30.00
	REMOVE AND REFIX CUSHION SEAT / UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR.		180.00	150.00

Report Ref No. CC4/LPC20000594/Aka3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REAR CHASSIS ALIGNMENT	NOT NECESSARY	250.00	-
	TRANSFER BOOTLID MECHANISM.		80.00	60.00
	REMOVE AND REFIX REAR WINDSCREEN.		120.00	120.00
	REMOVE AND REFIX AUDIO SPEAKER.	NOT NECESSARY	80.00	-
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	80.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE.	NOT NECESSARY	180.00	-
			5,360.00	3,530.00
	GRAND TOTAL		16,661.84	10,416.80
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,300.00

Report Ref No. CC4/LPC20000594/Aka3s2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJK 6685H

INSPECTION

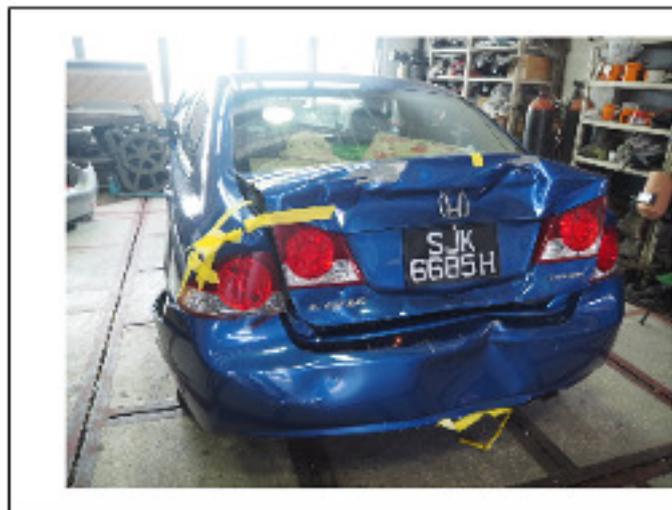




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

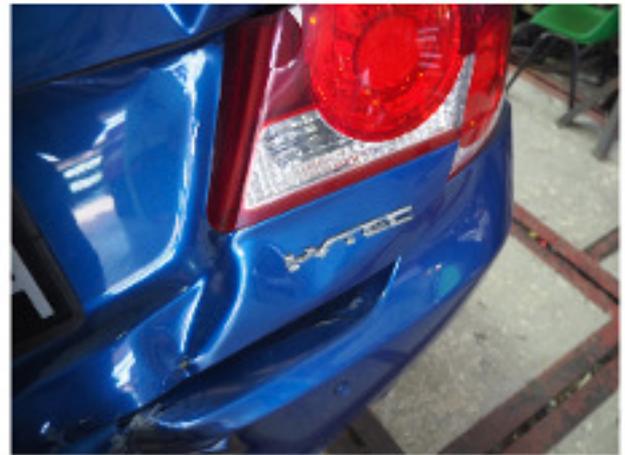




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

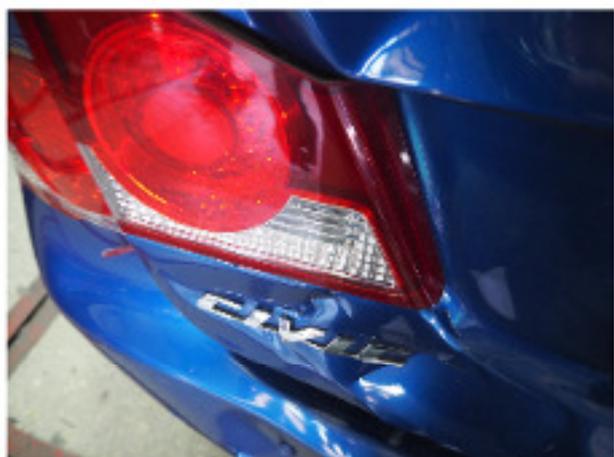








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

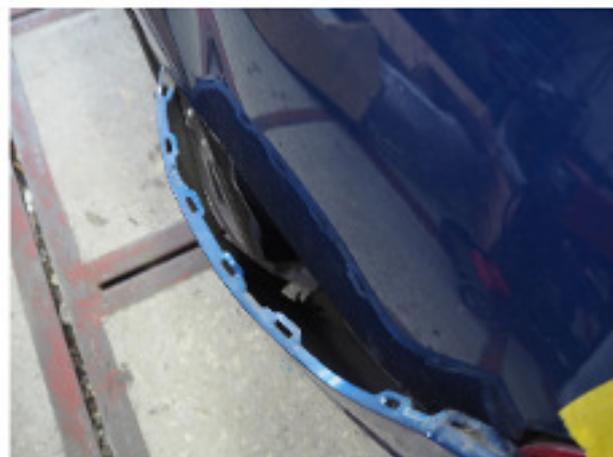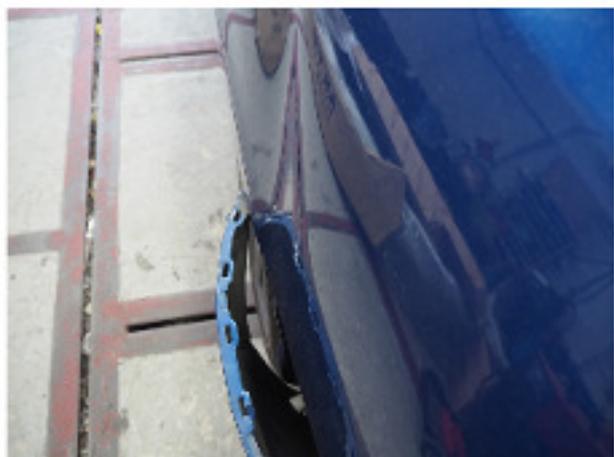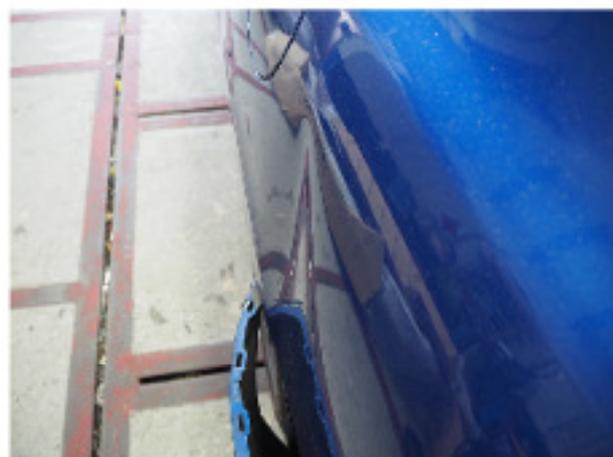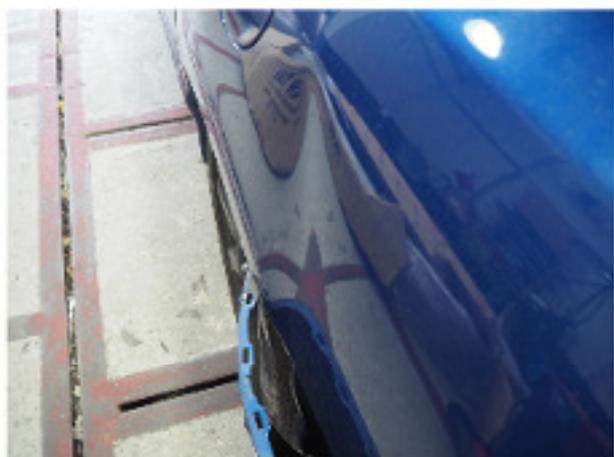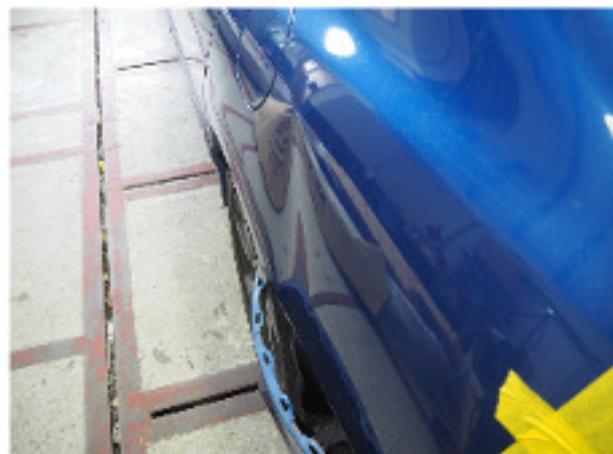



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

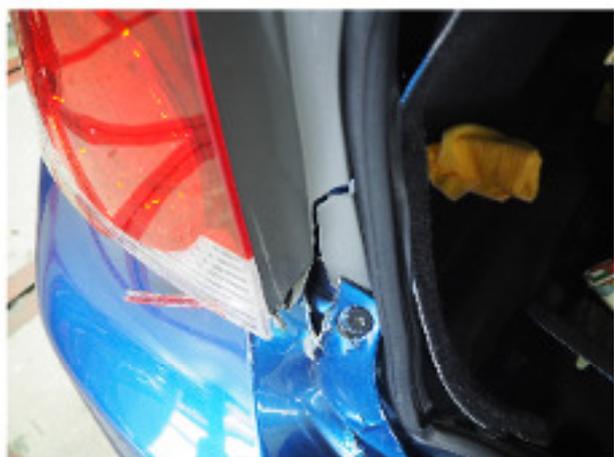



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

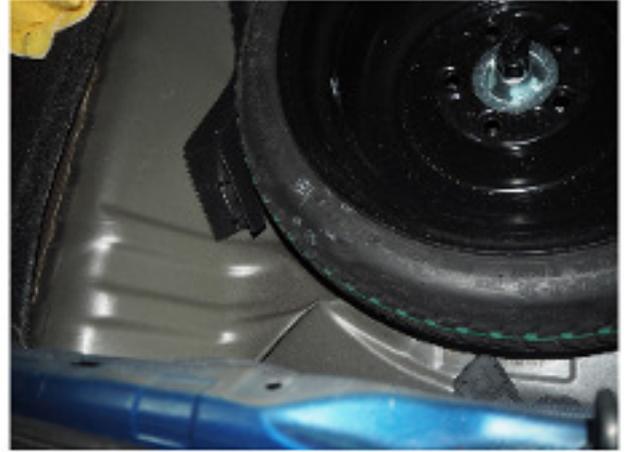



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJK 6685H

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

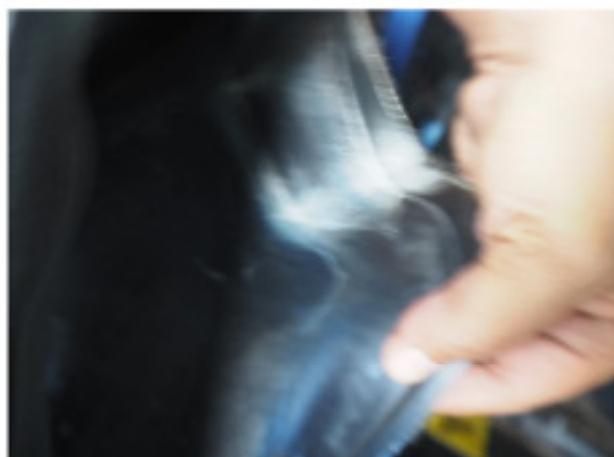




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

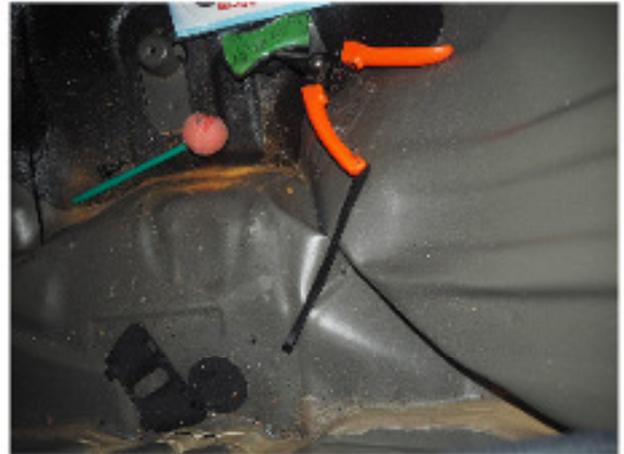



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

