



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102730

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV Date 19/04/2021  
Reference CC4/FCI20001080/Ega3q2  
Code FCI2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 36D  
Insured Veh. SHC 8238T  
Claim No. D20000318MFSH  
Policy No. D-20094922MFSH  
Accident Date 10/01/2020  
Inspection Date 20/01/2020

Description	Total
Third Party Express Settlement	600.00
<b>Subtotal</b>	<b>600.00</b>
<b>GST (7%)</b>	<b>42.00</b>
<b>Grand Total</b>	<b>642.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI20001080/Ega3q2 Date: 19/04/2021 Code: FCI2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
<b>Insured Veh.</b>	SHC 8238T	<b>Veh. Inspected</b>	SMQ 36D
<b>Policy No.</b>	D-20094922MFSH	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	D20000318MFSH	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	RACHEL WU	<b>Assign Date</b>	15/01/2020
<b>2. Vehicle Particulars &amp; Condition</b>			
<b>Make &amp; Model</b>	BENTLEY BENTAYGA	<b>c.c</b>	3996
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2019
<b>Chassis No.</b>	SJAAL14V1LC028000	<b>Colour</b>	BLACK
<b>Odometer</b>	4017 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		
<b>3. Conditions of Tyres</b>			
	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	285/40Z R22	PIRELLI	6 mm
<b>L/H Front Tyre</b>	285/40Z R22	PIRELLI	6 mm
<b>R/H Rear Tyre</b>	285/40Z R22	PIRELLI	6 mm
<b>L/H Rear Tyre</b>	285/40Z R22	PIRELLI	6 mm
<b>4. Description of Damages</b>			
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.		
<b>5. General Information</b>			
<b>Accident Date</b>	10/01/2020	<b>Inspection Date</b>	20/01/2020
<b>Survey held at</b>	45 LENG KEE ROAD		
<b>Repairer</b>	WEARNES AUTOMOTIVE PTE LTD		
<b>5a. Remarks</b>			
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.		
<b>5b. Estimate Days of Repair</b>			
	ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 36D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	BUMPER COVER PRIMED (SN)	DENTED	12,984.70	12,984.70
1	SPOILER PRIMED (SN)	CRUSHED	3,882.70	3,882.70
1	MOUNTING PLATE (SN)	NECESSARY	176.00	176.00
1	MOUNTING PLATE (SN)	NECESSARY	176.00	176.00
1	MOUNTING (SN)	NECESSARY	179.50	179.50
1	MOUNTING (SN)	NECESSARY	179.50	179.50
1	RETAINER FOR ULTRASO (SN)	NECESSARY	114.10	114.10
1	RETAINER FOR ULTRASO (SN)	NECESSARY	114.10	114.10
1	RETAINER FOR ULTRASO (SN)	NECESSARY	114.10	114.10
1	RETAINER FOR ULTRASO (SN)	NECESSARY	114.10	114.10
1	COVER FOR TOWING EYE (SN)	NOT NECESSARY	285.10	-
1	COVER FOR TOWING EYE (SN)	NOT NECESSARY	279.60	-
1	GUIDE PROFILE (SN)	BROKEN	607.90	607.90
1	GUIDE PROFILE (SN)	NOT NECESSARY	607.90	-
1	GUIDE PROFILE (SN)	BROKEN	191.70	191.70
1	GUIDE PROFILE (SN)	NOT NECESSARY	191.70	-
1	BUMPER CARRIER (SN)	NOT NECESSARY	2,079.60	-
1	HOLDING STRAP (SN)	NOT NECESSARY	243.70	-
1	GUIDE SECTION (SN)	NOT NECESSARY	607.90	-
1	BUMPER CARRIER (SN)	NOT NECESSARY	2,079.60	-
1	REAR DIFFUSER (SN)	BROKEN	13,167.80	13,167.80
1	TRIM FOR EXHAUST TAI (LH)(SN)	CUT	2,506.00	2,506.00
1	TRIM FOR EXHAUST TAI(SN)	NOT NECESSARY	2,506.00	-
4	SENSOR PRIMED (SN)	NOT NECESSARY	1,730.40	-
1	BODY PANEL SEALANT (SN)	NOT NECESSARY	900.90	-
1	ADHESIVE SEALER FL2 (SN)	NOT NECESSARY	682.50	-
1	TRIM FOR BUMPER LH (SN)	CUT	457.00	457.00
1	TRIM FOR BUMPER RH B (SN)	NOT NECESSARY	457.00	-
1	TRIM FOR BUMPER (SN)	BROKEN	425.40	425.40
1	B36A353817AGRU/TRIM (SN)	NOT NECESSARY	2,350.10	-

Report Ref No. CC4/FCI20001080/Ega3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
8	GROMMET (SN)	NOT NECESSARY	42.40	-
			50,435.00	35,390.60
	<b>LABOUR</b>			
	TO INSTALL PROTECTOR FILM ON BUMPER ,REAR LOWER SPOILER ,ETC. (ADDITIONAL)		2,200.00	2,200.00
	TO REPLACE REAR BUMPER ,REAR BRACKET ,REAR SENSOR REAR DIFFUSER, REAR LH TRIM ETC .		7,000.00	2,100.00
	TO PUTTY SPRAY PAINT ON REAR BUMPER ,REAR LH TRIM ,ETC .		4,400.00	3,000.00
	TO CHECK WIRING INCLUDE RESETTING OF ALL ELECTRICAL MODULES.		1,820.00	1,820.00
			15,420.00	9,120.00
	<b>GRAND TOTAL</b>		<b>65,855.00</b>	<b>44,510.60</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>44,510.60</b>

Report Ref No. CC4/FCI20001080/Ega3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMQ 36D

## INSPECTION

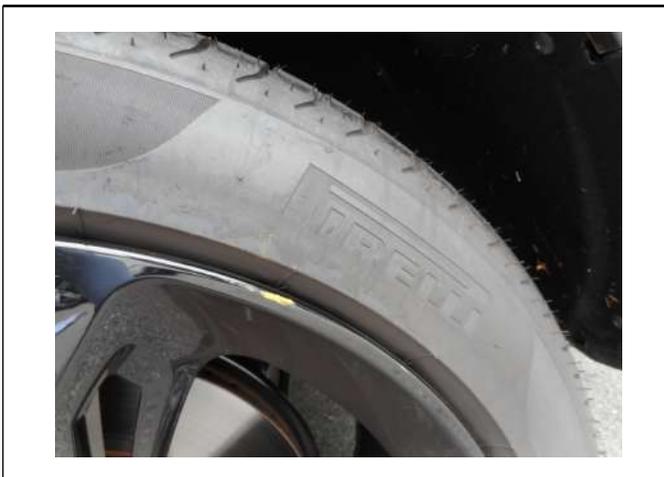



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

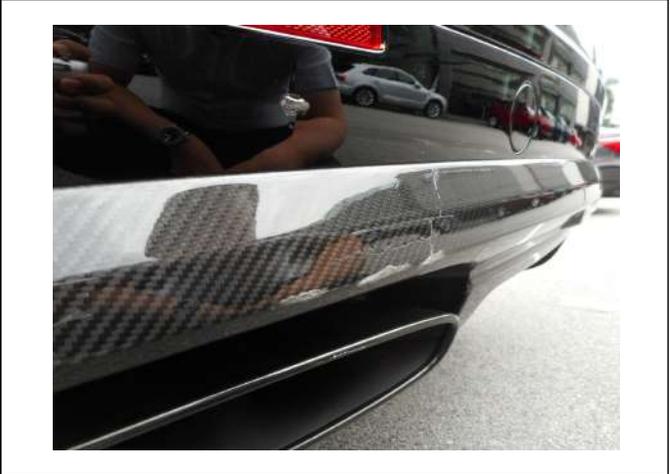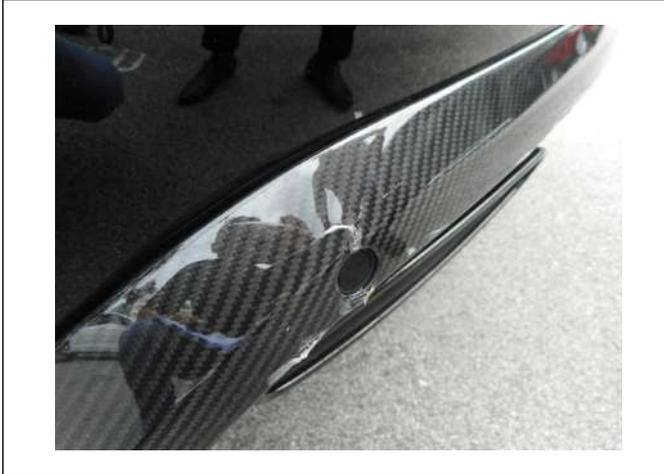



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

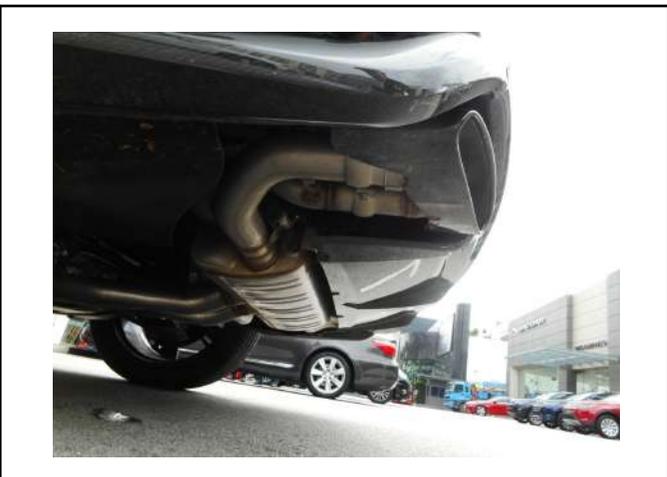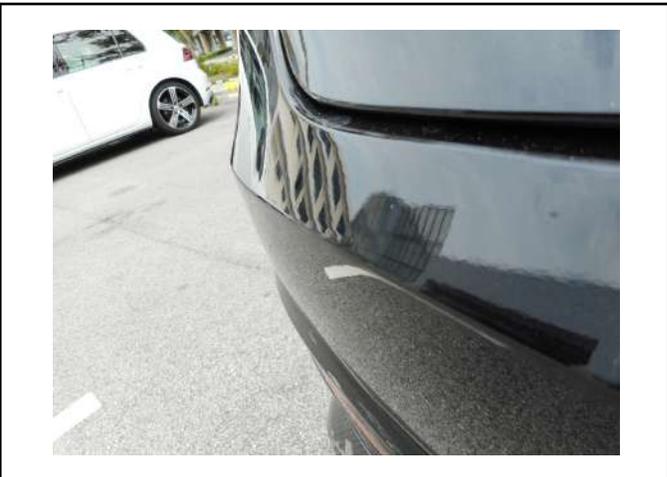



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMQ 36D

## RE-INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

