



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD  
36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2006213  
INV Date 10/09/2020  
Reference CC6/FCI20001133/Aea3q2  
Code FCI2



#### PROFESSIONAL SERVICE FEE

Vehicle No. SJW 3563H  
Insured Veh. SHB 4228D  
Claim No. D20000526MFSH  
Policy No. D-18088936MFSH  
Accident Date 15/01/2020  
Inspection Date 17/01/2020

Description	Total
Third Party Express Settlement	600.00
<b>Subtotal</b>	<b>600.00</b>
<b>GST (7%)</b>	<b>42.00</b>
<b>Grand Total</b>	<b>642.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC6/FCI20001133/Aea3q2

36 ROBINSON ROAD  
#16-01 CITY HOUSESINGAPORE 068877

Date : 10-09-2020



Code : FCI2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SHB 4228D	<b>Veh. Inspected</b>	SJW 3563H
<b>Policy No.</b>	D-18088936MFSH	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	D20000526MFSH	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	RACHEL WU	<b>Assign Date</b>	17/01/2020

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA WISH	<b>c.c</b>	1987
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2010
<b>Chassis No.</b>	JTDGJ20W905002456	<b>Colour</b>	BRONZE
<b>Odometer</b>	204263	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	225/45 R17	MICHELIN	6 mm
<b>L/H Front Tyre</b>	225/45 R17	MICHELIN	6 mm
<b>R/H Rear Tyre</b>	225/45 R17	MICHELIN	6 mm
<b>L/H Rear Tyre</b>	225/45 R17	MICHELIN	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY AND UNDERCARRIAGE.  
DAMAGES SEE DETAILS

### 5. General Information

<b>Accident Date</b>	15/01/2020	<b>Inspection Date</b>	17/01/2020
<b>Survey held at</b>	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJW 3563H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	BONNET	NOT NECESSARY	820.00	-
1	FRONT BUMPER	DEFORMED	653.80	653.80
2	FRONT BUMPER SIDE RETAINER @\$62.40	O/S NECESSARY	124.80	62.40
1	FRONT BUMPER FOGLAMP	NOT NECESSARY	320.00	-
1	FRONT BUMPER FOGLAMP HOUSING	NOT NECESSARY	130.20	-
2	HEADLAMP @\$444.60	O/S CRACKED	889.20	444.60
1	FRONT FENDER RH	DISTORTED	865.00	865.00
1	FRONT FENDER INNER COWLING RH	DEFORMED	254.00	254.00
1	FRONT FENDER SIGNAL LAMP RH	NOT NECESSARY	70.00	-
1	FRONT FENDER WT-I RH	NECESSARY	80.00	65.00
1	WASHER TANK	DEFORMED	250.00	250.00
1	WASHER TANK MOTOR	NOT NECESSARY	320.00	-
1	FRONT SIDE SKIRT RH	DEFORMED	830.00	830.00
1	FRONT DOOR RH	DENTED	1,288.90	1,288.90
2	FRONT DOOR HINGE @\$80.00	BENT	160.00	160.00
1	FRONT DOOR CHECKER RH	NOT NECESSARY	155.20	-
1	FRONT DOOR LOCK	NOT NECESSARY	380.00	-
1	REAR DOOR RH	DENTED	1,368.00	1,368.00
2	REAR DOOR HINGE @\$80.00	NOT NECESSARY	160.00	-
1	REAR DOOR CHECKER RH	NOT NECESSARY	155.20	-
1	FRONT KNUCKLE ARM RH	DAMAGED	489.60	489.60
1	FRONT KNUCKLE BEARING RH	NECESSARY	198.90	198.90
1	FRONT WHEEL HUP RH	DAMAGED	314.80	314.80
1	FRONT SHOCK ABSORBER RH	BENT	478.10	478.10
1	FRONT LOWER ARM RH	BENT	561.70	561.70
1	FRONT ANTI ROLL BAR LINKAGE RH	BENT	194.30	194.30
1	FRONT ABS SENSOR	NOT NECESSARY	260.00	-
1	STEERING RACK AND PINION	NOT NECESSARY	1,855.30	-
1	FRONT DRIVESHAFT	NOT NECESSARY	1,258.70	-



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-3,721.43	-2,119.78
			11,164.27	6,359.32
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	20.00	20.00
1	FRONT FENDER SEALANT RH (SN)	NOT NECESSARY	80.00	-
1	SET FRONT FENDER COWLING RH CLIP (SN)	NECESSARY	20.00	20.00
1	SET SIDE SKIRT CLIPS (SN)	NECESSARY	20.00	20.00
1	FRONT WHEEL TYRE RH (SN)	PUNCTURE	350.00	200.00
1	FRONT WHEEL SPORT RIM RH (SN)	CUT	850.00	400.00
			1,340.00	660.00
	<b><u>LABOUR</u></b>			
	PANEL BEATING ,REMOVING AND REPLACING PARTS.		1,800.00	800.00
	SPRAY PAINTING TO AFFECTED AREA.		1,800.00	1,000.00
	WIRING AND BULB CHECK .		120.00	30.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIX FRONT UNDERCARRIAGE.		350.00	220.00
	FOUR WHEEL ALIGNMENT.		120.00	80.00
	TO REMOVE AND REFIX FRONT DOOR MECHANISM.		450.00	80.00
	TO REMOVE AND REFIX REAR DOOR MECHANISM.		450.00	80.00
			5,270.00	2,290.00
<b>GRAND TOTAL</b>			<b>17,774.27</b>	<b>9,309.32</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>7,400.00</b>

Report Ref No. CC6/FCI20001133/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJW 3553H

INSPECTION





**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

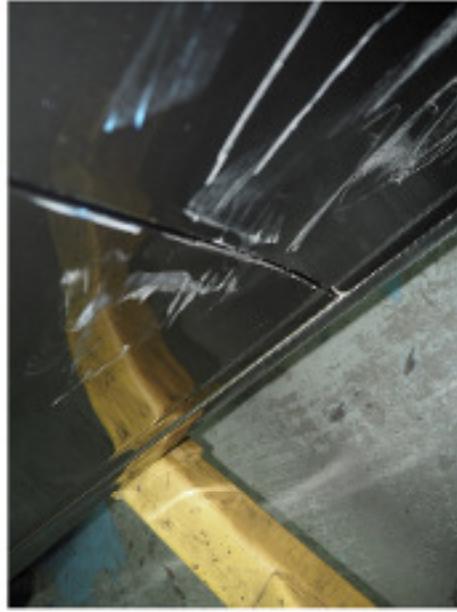




**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

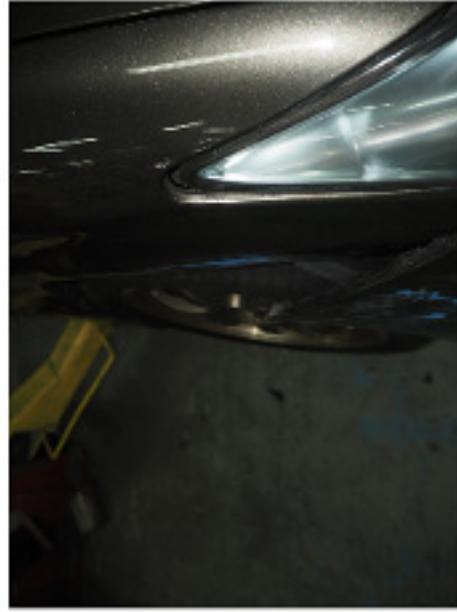




**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

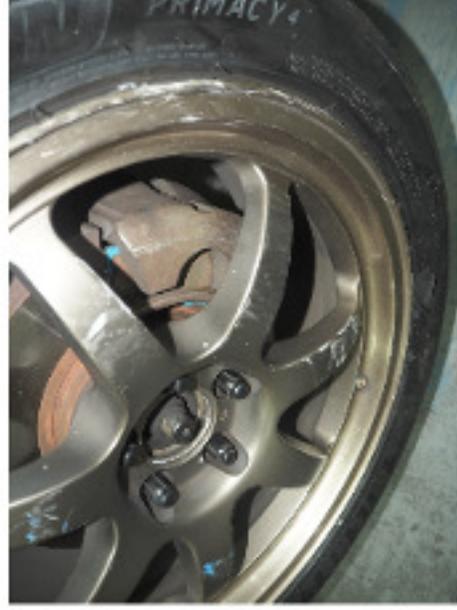




**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

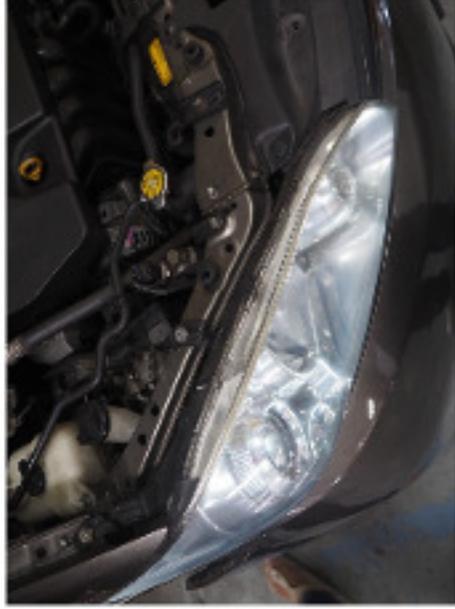



## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJW 3563H

RE-INSPECTION

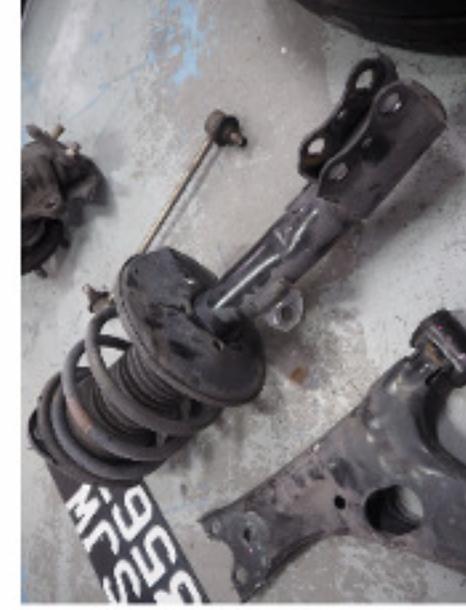




**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

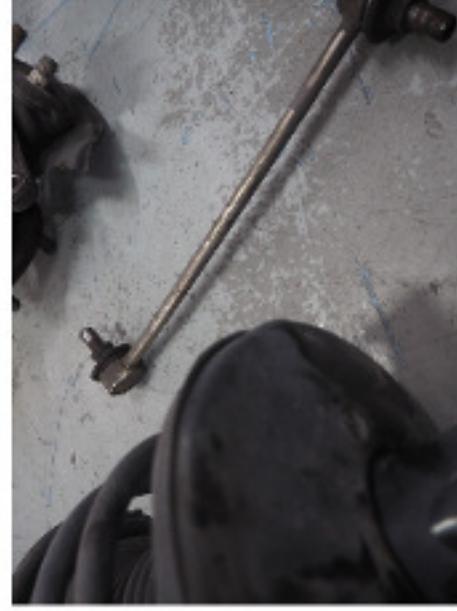



**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

