

A S AUTO SERVICE

1 KAKI BUKIT AVE 6
#01-106, AUTOBAY @ KAKI BUKIT
SINGAPORE 417883

6 November 2019

Vehicle No. : SDR 828 L
Make/Model : Toyota Mark
Year of Manufacture : 2007
Chassis No. : GRX1203037046

Name : Hong Hui Linghui Ling
Address : C/o 1 Kaki Bukit Ave 6
#01-106, Autobay @ Kaki Bukit
Singapore 417883

QTY	ITEM / PARTICULARS	\$
-----	--------------------	----

Third Party Accident Claim for vehicle no. SDR 828 L
Date of Accident : 15 February 2019

Costs of Repairs

\$14,000.00

=====

SINGAPORE DOLLARS: FOURTEEN THOUSAND ONLY

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

INVOICE

To: Hong Hui Ling
c/o 1 Kaki Bukit Ave 6
#01-106 Autobay@Kaki Bukit
Singapore 417883

Date : 21/03/2019

Invoice No : IV19-03047/CAS

Particulars	Amount
Fee For Services Rendered In Respect Of: Surveying, Adjusting, and Re-inspection Of Accident Damaged Vehicle SDR 828L (Inclusive Of Photographs And Transport Charges) Our reference : CAS/19-03/047	\$1,057.00
Total	\$1,057.00

E. & O.E

Constant Appraiser Services



Cheque Should Be Crossed And Made Payment To 'Constant Appraiser Services'

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Hong Hui Ling
c/o 1 Kaki Bukit Ave 6
#01-106 Autobay@Kaki Bukit
Singapore 417883

Date : 21/03/2019
Reference No : CAS/19-03/047

General Information

Registration No. : SDR 828L
Accident Date : 15/02/2019

Particulars of Damaged Vehicle

Colour	: Silver	Make & Model	: Toyota Mark X 2.5 A
Engine Capacity	: 2499 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 98153	Engine No.	: 4GR0345387
Chassis No.	: GRX1203037046	Steering	: Affected
Registration Date	: 30/06/2007	Brake	: In Order

Tyre Condition

	Size	Make	Balance
R/H Front Tyre	215/55R17	MICHELIN	90%
L/H Front Tyre	215/55R17	MICHELIN	90%
R/H Rear Tyre	215/55R17	MICHELIN	90%
L/H Rear Tyre	215/55R17	MICHELIN	90%

Inspection

Repairer : A S Auto Service
1 Kaki Bukit Ave 6, #01-106 Autobay@Kaki Bukit, Singapore 417883

Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$19,827.15
Revised Amount : \$14,000.00
Less Excess : -
Nett Total : \$14,000.00

Remarks

- (A) Survey was done on 19/02/2019
- (B) Re-survey was done on 20/02/2019 & 22/02/2019
- (C) Re-survey after repair was done on 12/03/2019
- (D) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (E) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>PARTS REPLACEMENT – LIST ITEMS</u>			
1	1pc	Front headlamp assy RH	Grazed/Broken	1,523.35	1,523.35
2	1pc	Front bumper	Grazed/Torn	1,588.62	1,588.62
3	1pc	Front bumper side grille RH	Serviceable	89.92	-
4	1pc	Front bumper side retainer RH	Broken	81.65	81.65
5	1pc	Front fender RH	Buckled/Twisted	1,085.50	1,085.50
6	1pc	Front fender top seal RH	Necessary	110.25	110.25
7	1pc	Front fender inner shield RH	Deformed/Torn	260.45	260.45
8	1pc	Front fender wheel housing RH	Repair	1,150.00	-
9	1pc	Front door RH	Dented/Warped	1,429.10	1,429.10
10	1pc	Front door checker RH	Bent	180.70	180.70
11	2pcs	Front door hinge (top & lower) RH @ \$80.50	Bent	161.00	161.00
12	1pc	Front door inner black frame sticker 'horizontal' RH	Necessary	45.70	45.70
13	1pc	Front door inner black frame sticker 'vertical' front RH	Necessary	20.80	20.80
14	1pc	Front door inner black frame sticker 'vertical' rear RH	Necessary	25.00	25.00
15	1pc	Front door inner trim board RH	Deformed/Broken	1,210.10	1,210.10
16	1pc	Front door mechanism lock RH	Serviceable	577.10	-
17	1pc	Front door power window channel RH	Necessary	160.40	160.40
18	1pc	Front door power window channel weatherstrip RH	Necessary	333.30	333.30
19	1pc	Front door power window motor RH	Damaged	947.80	947.80
20	1pc	Front door power window regulator RH	Bent	262.30	262.30
21	2pcs	Front door rubber guide stopper RH @ \$15.00	Necessary	30.00	30.00
22	1pc	Front door weatherstrip RH	Necessary	218.20	218.20
23	1pc	Front shock absorber RH	Bent	499.50	499.50
24	1pc	Front shock absorber top mounting RH	Twisted	236.30	236.30
25	1pc	Front lower arm RH	Bent	766.60	766.60
26	1pc	Front knuckle arm RH	Bent	833.70	833.70
27	1pc	Front knuckle arm bearing RH	Necessary	536.90	536.90
28	1pc	Front stabilizer bar	Serviceable	266.90	-
29	1pc	Front stabilizer bar link RH	Serviceable	85.20	-
30	1pc	Front top arm RH	Bent	855.36	855.36
31	1pc	Steering rack & pinion	Bent/Jammed	4,682.50	4,682.50

Constant Appraiser Services

Vehicle No : SDR 828L

Our ref : CAS/19-03/047

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>PARTS REPLACEMENT – LIST ITEMS (CONT'D)</u>			
		Less 25%		20,254.20 (5,063.55)	18,085.08 (4,521.27)
			Sub total	15,190.65	13,563.81
		<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>			
1	1set	Front fender inner shield clip RH	Necessary	45.00	45.00
2	1set	Front bumper clip	Necessary	55.00	55.00
3	1pc	Front sport rim RH	Dented/Grazed	850.00	850.00
4	1pc	Front tyre RH	Cut (90%)	360.00	324.00
5	7pcs	Front door seal rivet @ \$9.50	Necessary	66.50	66.50
			Sub total	16,567.15	14,904.31
		<u>LABOUR & MISC. CHARGES</u>			
1		To check front electrical wiring & refocus headlamp		40.00	20.00
2		To respray undercoating		80.00	60.00
3		To diagnose & erase fault memory after repair		300.00	220.00
4		To remove, refix front undercarriage		320.00	280.00
5		To check wheel alignment		120.00	100.00
6		To respray painting & etc		1,200.00	1,000.00
7		Panel beating, remove & replacing above parts		1,200.00	900.00
			Grand total	19,827.15	17,484.31
Recommended cost of lump sum repair (To its pre-accident condition)					14,000.00


Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$14,000.00** on a contractual basis. Under normal circumstances, the repair period would be about **6 (Six)** working days.

Yours faithfully,

Constant Appraiser Services

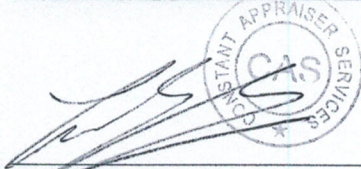

Lim Yong Tian (Sebastian)

Licensed Appraiser

Adv. Dip. In Mechanical Engineering (AUS)

MSAAA