



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101362

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/03/2021
Reference CC3/FCI20001686/Kba3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 202T
Insured Veh. SHD 4866B
Claim No. D20000694MFSH
Policy No. D-18088936MFSH
Accident Date 25/01/2020
Inspection Date 30/01/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC3/FCI20001686/Kba3q2	
			Date: 05/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHD 4866B	Veh. Inspected	SHD 202T
	Policy No.	D-18088936MFSH	Coverage (\$)	0.00
	Claim No.	D20000694MFSH	Excess (\$)	0.00
	Assign From	CHRIS	Assign Date	30/01/2020
2. Vehicle Particulars & Condition				
	Make & Model	RENAULT LATITUDE (A)	c.c	1995
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	VF1ABL15AUC282365	Colour	METALLIC WHITE / RED
	Odometer	567620 KM	Steering	JAMMED
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	SAILUN	9 mm
	L/H Front Tyre	215/60 R16	SAILUN	9 mm
	R/H Rear Tyre	215/60 R16	SAILUN	7 mm
	L/H Rear Tyre	215/60 R16	SAILUN	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	25/01/2020	Inspection Date	30/01/2020
	Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		21 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 10

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 202T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	MISSING	747.20	747.20
1	BUMPER SPOILER FRT	MISSING	344.70	344.70
1	BUMPER ABSORBER FRT	MISSING	394.68	394.68
1	BUMPER RETAINER FRT LH	CRACKED	101.40	101.40
1	BUMPER SUPPORT FRT	MISSING	10.70	10.70
1	BUMPER RETAINER FRT RH	CRACKED	101.40	101.40
1	BUMPER SUPPORT FRT	MISSING	10.70	10.70
1	BUMPER UNDERTRAY FRT	MISSING	292.50	292.50
1	BUMPER GRILLE LOWER FRT	MISSING	147.00	147.00
1	BUMPER FOG LAMP GRILLE LH	MISSING	207.21	207.21
1	BUMPER FOG LAMP GRILLE RH	MISSING	207.21	207.21
1	BUMPER BEAM FRT	BENT	663.70	663.70
2	BUMPER BEAM PAD FRT	NO SUCH PARTS	24.50	-
1	TOW COVER FRT	MISSING	60.90	60.90
1	RADIATOR GRILLE	MISSING	969.90	969.90
1	RADIATOR GRILLE BADGE "RENAULT"	MISSING	225.36	225.36
1	RADIATOR GRILLE FRAME	CRACKED	686.00	686.00
1	FRAME FULL SUPPORT PANEL	CRACKED	592.70	592.70
1	FRAME FULL SUPPORT BRACKET	BENT	41.60	41.60
1	FRONT BRACE PANEL	BENT	177.22	177.22
1	HORN	SERVICEABLE	449.90	-
1	HORN BRACKET	TO REPAIR SEE LABOUR	21.90	-
1	HEADLAMP LH	BROKEN	743.60	743.60
1	HEADLAMP RH	BROKEN	743.60	743.60
1	HEADLAMP PANEL FRT LH	BENT	127.70	127.70
1	HEADLAMP PANEL FRT RH	BENT	128.30	128.30
1	HEADLAMP HARNESS	NOT NECESSARY	556.10	-
2	HEADLAMP ADJUST MOTOR	NOT NECESSARY	313.90	-
1	BONNET	BENT	1,312.70	1,312.70
1	BONNET INSULATOR	SERVICEABLE	294.30	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET STRUT LH	SERVICEABLE	53.30	-
1	BONNET STRUT RH	SERVICEABLE	53.30	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	236.50	-
1	BONNET HINGE RH	TO REPAIR SEE LABOUR	237.40	-
1	BONNET LOCK	DISTORTED	152.80	152.80
1	BONNET CABLE	SERVICEABLE	55.20	-
1	BONNET CABLE COVER	SERVICEABLE	80.60	-
1	BONNET SEAL OUTER	SERVICEABLE	83.20	-
1	BONNET SEAL INNER	SERVICEABLE	70.10	-
2	BONNET BUFFER	SERVICEABLE	26.80	-
1	FENDER PANEL FRT LH	BENT	414.40	414.40
1	WHEELARCH FRT LH	CRACKED	112.30	112.30
1	FENDER BRACKET LOWER LH	BENT	11.80	11.80
1	FENDER INSULATOR LH	SERVICEABLE	65.50	-
1	FENDER BRACKET FRT LH	BENT	38.90	38.90
1	FENDER PANEL FRT RH	BENT	414.40	414.40
1	WHEELARCH FRT RH	CRACKED	191.40	191.40
1	FENDER BRACKET LOWER RH	BENT	21.40	21.40
1	FENDER INSULATOR RH	SERVICEABLE	66.30	-
1	FENDER BRACKET FRT RH	TO REPAIR SEE LABOUR	106.40	-
1	WIPER RESERVOIR	DENTED	179.60	179.60
1	WIPER RESERVOIR NECK	DENTED	29.30	29.30
1	WIPER RESERVOIR MOTOR	NOT NECESSARY	82.60	-
1	AIR CLEANER LOWER	NOT NECESSARY	271.26	-
1	AIR CLEANER HOSE	SERVICEABLE	76.14	-
1	BASE BATTERY TRAY	CRACKED	363.40	363.40
1	AIR CLEANER BOX	NOT NECESSARY	464.20	-
1	TURBO DUCT	NOT NECESSARY	1,027.80	-
1	A/C HEATER VALVE	NOT NECESSARY	484.50	-
1	SUBFRAME OUTER FRT	NOT NECESSARY	1,094.20	-
1	SUBFRAME BRACKET OUTER LH	NOT NECESSARY	49.00	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SUBFRAME BRACKET OUTER RH	SERVICEABLE	49.00	-
1	ENGINE UNDERTRAY	SERVICEABLE	583.10	-
1	A/C CONDENSER	BENT / PUNCTURE	1,537.80	1,537.80
1	A/C CONDENSER GARNISH LH UPPER	MISSING	57.30	57.30
1	A/C CONDENSER GARNISH RH UPPER	MISSING	56.70	56.70
1	A/C CONDENSER GARNISH LH	MISSING	67.90	67.90
1	A/C CONDENSER GARNISH RH	MISSING	67.70	67.70
1	A/C PIPE CONDENSER TO COMPRESSOR	SERVICEABLE	187.20	-
1	A/C PIPE CONDENSER TO EXPENSION VALVE	SERVICEABLE	380.20	-
1	A/C PIPE COMPRESSOR	SERVICEABLE	222.70	-
1	A/C PIPE	SERVICEABLE	486.50	-
1	A/C COMPRESSOR	SERVICEABLE	2,142.30	-
1	AIR COOLER	NOT NECESSARY	598.90	-
1	AIR INTERCOOLER HOSE (LONG)	NOT NECESSARY	1,014.13	-
1	AIR INTERCOOLER HOSE (SHORT)	NOT NECESSARY	375.14	-
1	TRANSMISSION COOLER	NOT NECESSARY	1,219.30	-
1	TRANSMISSION COOLER PAD	NOT NECESSARY	9.50	-
1	RADIATOR	PUNCTURE	871.20	871.20
2	RADIATOR STUD UPPER	SERVICEABLE	11.10	-
2	RADIATOR BUSH UPPER	SERVICEABLE	11.10	-
2	RADIATOR MTG LOWER	SERVICEABLE	30.10	-
1	RADIATOR FAN COWLING	SERVICEABLE	417.00	-
1	RADIATOR FAN MOTOR LH	NOT NECESSARY	826.70	-
1	RADIATOR FAN MOTOR RH	SERVICEABLE	821.20	-
1	RADIATOR TANK	NOT NECESSARY	174.80	-
1	RADIATOR HOSE UPPER	NOT NECESSARY	97.50	-
1	RADIATOR HOSE LOWER	NOT NECESSARY	254.10	-
1	RADIATOR TANK HOSE	SERVICEABLE	56.20	-
1	AUTO COMPUTER	CRACKED	1,287.30	1,287.30
1	INJECTION COMPUTER	NOT NECESSARY	2,706.30	-
1	STEERING PINION RACK L70Y	NOT NECESSARY	3,765.30	-
1	STEERING PUMP ELECTRIC L70Y	NOT NECESSARY	2,026.70	-
1	STEERING HOSE LOW PRESSURE LONG	SERVICEABLE	397.40	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STEERING HOSE LOW PRESSURE	SERVICEABLE	221.90	-
1	FUSE BOX	SERVICEABLE	987.39	-
1	ENGINE MOUNTING RH	NOT NECESSARY	153.50	-
1	ENGINE MOUNTING LOWER	NOT NECESSARY	149.20	-
1	ENGINE MOUNTING UPPER	NOT NECESSARY	592.02	-
1	ENGINE HARNESS L70Y	NOT NECESSARY	1,501.60	-
1	SUPPORT ENGINE UPPER	NOT NECESSARY	610.37	-
1	ALTERNATOR	NOT NECESSARY	1,442.30	-
1	BATTERY COVER	SERVICEABLE	363.40	-
1	OIL PAN ASSEMBLY	SERVICEABLE	2,283.91	-
1	ENGINE OIL SUMP	SERVICEABLE	97.70	-
1	LOWER ARM LH L70Y	BENT	192.70	192.70
1	KNUCKLE ARM LH L70Y	BENT	481.50	481.50
1	ABSORBER FRT LH L70Y	BENT	274.10	274.10
1	DRIVESHAFT LH	BENT	1,355.70	1,355.70
1	STABILIZER BAR FRT	DISTORTED	427.90	427.90
2	STABILIZER LINK FRT	NOT NECESSARY	69.50	-
1	LOWER ARM RH L70Y	BENT	192.70	192.70
1	KNUCKLE ARM RH L70Y	BENT	481.50	481.50
1	ABSORBER FRT RH L70Y	BENT	274.10	274.10
1	DRIVESHAFT RH	NOT NECESSARY	1,355.70	-
1	KNUCKLE HUB + BEARING LH	BENT	272.30	272.30
1	KNUCKLE HUB + BEARING RH	BENT	272.30	272.30
1	ABSORBER MOUNTING KIT LH	NOT NECESSARY	212.30	-
1	ABSORBER DUCT COVER LH	NOT NECESSARY	76.30	-
1	ABSORBER MOUNTING KIT RH	NOT NECESSARY	212.30	-
1	ABSORBER DUST COVER RH	NOT NECESSARY	76.30	-
1	BRAKE DISC FRT LH	NOT NECESSARY	158.80	-
1	BRAKE DISC FRT RH	NOT NECESSARY	158.80	-
1	SUBFRAME INNER FRT	NOT NECESSARY	746.00	-
1	SUBFRAME SUPPORT INNER	NOT NECESSARY	69.50	-
1	SUBFRAME BRACKET INNER FRT LH	NOT NECESSARY	101.00	-
1	SUBFRAME BRACKET INNER FRT RH	SERVICEABLE	101.00	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE TOP COVER 2.0	SERVICEABLE	139.80	-
1	BRAKE HOSE FRT LH	SERVICEABLE	80.70	-
1	BRAKE HOSE FRT RH	SERVICEABLE	80.70	-
1	ABS SENSOR FRT LH	SERVICEABLE	152.50	-
1	ABS SENSOR FRT RH	SERVICEABLE	152.50	-
1	BRAKE CALIPER FRT RH	SERVICEABLE	536.10	-
1	BRAKE CALIPER FRT LH	SERVICEABLE	536.10	-
1	BRAKE PAD FRT	SERVICEABLE	146.20	-
1	BRAKE CALIPER BRACKET FRT LH	SERVICEABLE	384.00	-
1	BRAKE CALIPER BRACKET FRT RH	SERVICEABLE	384.00	-
1	WHEEL HOUSING PANEL FRT RH L70Y	BENT	2,698.60	2,698.60
1	WHEEL HOUSING PANEL FRT LH L70Y	TO REPAIR SEE LABOUR	2,621.60	-
1	FENDER PANEL INNER FRT LH L70Y	TO REPAIR SEE LABOUR	858.30	-
1	FENDER PANEL INNER FRT RH	TO REPAIR SEE LABOUR	838.40	-
1	FENDER PANEL SUPPORT FRT RH	NOT NECESSARY	432.00	-
1	FENDER PANEL REINFORCEMENT FRT LH L70Y	NOT NECESSARY	642.40	-
1	CHASSIS PANEL FRT RH	TO REPAIR SEE LABOUR	592.90	-
1	CHASSIS PANEL FRT LH L70Y	TO REPAIR SEE LABOUR	655.80	-
1	CHASSIS PANEL SUPPORT FRT RH L70Y	NOT NECESSARY	431.70	-
1	CHASSIS PANEL REINFORCEMENT FRT LH L70Y	NOT NECESSARY	283.90	-
1	WINDSCREEN FRT L70Y	CRACKED	817.20	817.20
1	RAIN SENSOR L70Y	NOT NECESSARY	296.90	-
1	WINDSCREEN LOW GRILLE COVER	SERVICEABLE	310.60	-
1	SHELF ASSY (WINDSCREEN UNDER PANEL)	NOT NECESSARY	443.76	-
1	WINDSCREEN INNER GARNISH RH	NOT NECESSARY	257.40	-
1	WINDSCREEN INNER GARNISH LH	NOT NECESSARY	257.40	-
1	SEATBELT LH L70Y	JAMMED	1,488.70	1,488.70
1	SEATBELT RH L70Y	JAMMED	1,553.10	1,553.10
1	SEATBELT BUCKLE LH L70Y	NOT NECESSARY	498.70	-
1	SEATBELT BUCKLE RH L70Y	NOT NECESSARY	498.70	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PASSENGER AIRBAG L70Y	BURST	2,093.60	2,093.60
1	STEERING AIRBAG L70Y	BURST	1,592.90	1,592.90
1	AIRBAG COMPUTER L70Y	NECESSARY	1,213.90	1,213.90
1	AIRBAG SENSOR L70Y	NECESSARY	502.90	502.90
1	AIRBAG SENSOR L70Y	NECESSARY	172.90	172.90
1	ROTARY SWITCH L70Y	NECESSARY	812.90	812.90
1	DASHBOARD	TORN	3,102.00	3,102.00
1	GLOVE BOX	SERVICEABLE	526.90	-
1	GLOVE BOX FLAP	SERVICEABLE	648.10	-
1	FACE CONSOLE	SERVICEABLE	949.60	-
1	DIESEL FILTER	SERVICEABLE	839.78	-
1	COVER HYDR DISTRIBUTOR	SERVICEABLE	493.35	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR HINGE UPPER LH L70Y	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER L70Y	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRT LH	SERVICEABLE	90.90	-
1	DOOR WEATHERSTRIP FRONT LH	SERVICEABLE	316.00	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	1,483.40	-
1	DOOR SEAL FRONT LH	SERVICEABLE	69.60	-
1	DOOR SEAL LOWER FRONT LH	SERVICEABLE	93.90	-
1	DOOR FINISHER FRT LH	SERVICEABLE	258.90	-
1	DOOR MOULDING FRT LH	SERVICEABLE	100.50	-
1	DOOR GLASS RUNNER SEAL FRONT LH	SERVICEABLE	332.00	-
1	DOOR HARNESS WIRE LH	SERVICEABLE	2,670.00	-
1	ROCKER PANEL INNER GARNISH LH	SERVICEABLE	466.51	-
1	ROCKER PANEL INNER LH	TO REPAIR SEE LABOUR	1,024.79	-
1	ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	1,184.99	-
1	ROCKER PANEL CENTER LH	TO REPAIR SEE LABOUR	990.25	-
	LESS 10% DISCOUNT		-10,060.85	-3,518.71

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
			90,547.63	31,668.37
1	BATTERY (50%)(SN)	DENTED	350.00	175.00
	LESS 10% DISCOUNT		-35.00	-
			315.00	175.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NECESSARY	52.00	52.00
1	SET BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	SET RADIATOR GRILLE SCREW (SN)	SERVICEABLE	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	WINDSCREEN MOULDING (SN)	NECESSARY	120.00	120.00
1	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	253.20	40.00
1	FRONT WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	30.00
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	MISSING	80.00	45.00
1	SET WHEELARCH CLIP FRT LH (SN)	NECESSARY	30.50	30.50
1	SET WHEELARCH CLIP FRT RH (SN)	NECESSARY	30.50	30.50
1	FRONT LEFT TYRE (90%)(SN)	PUNCTURE	330.00	297.00
1	FRONT LEFT TYRE RIM (SN)	BENT	380.00	380.00
1	FRONT RIGHT TYRE (SN)	NOT NECESSARY	330.00	-
1	FRONT RIGHT TYRE RIM (SN)	BENT	380.00	380.00
6	BONNET INSULATOR CLIP L70Y (SN)	NOT NECESSARY	7.30	-
2	BONNET CABLE CLIP L70Y (SN)	NOT NECESSARY	6.31	-
2	BONNET CABLE COVER SCREW L70Y (SN)	NOT NECESSARY	10.85	-
1	FRONT LH DOOR STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	FRONT LH DOOR STICKER "CLASSIC" (SN)	NOT NECESSARY	80.00	-
1	DOOR CHECK BOLT (SN)	NOT NECESSARY	22.69	-
1	DOOR GUIDE SCREW (SN)	NOT NECESSARY	10.85	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:8 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR HINGE BOLT (SN)	NOT NECESSARY	10.85	-
1	DOOR HINGE NUT LH (SN)	NOT NECESSARY	14.60	-
1	DOOR CHECK BOLT (SN)	NOT NECESSARY	22.69	-
1	DOOR CHECK NUT (SN)	NOT NECESSARY	3.75	-
1	DOOR LOCK SCREW L70Y (SN)	NOT NECESSARY	6.12	-
1	DOOR CATCH SCREW L70Y (SN)	NOT NECESSARY	10.06	-
1	DOOR CHECK BOLT (SN)	NOT NECESSARY	22.69	-
4	CAN RADIATOR COOLANT (SN)	NECESSARY	90.00	30.00
1	BUMPER BRACKET CLIP FRT RH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
			2,800.96	1,501.00
	LABOUR			
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME. }		9,900.00	1,500.00
	INCLUSIVE OF THE REPAIR OF HORN BRACKET,BONNET HINGE LH,BONNET HINGE RH,FENDER BRACKET FRT RH,WHEEL HOUSING PANEL FRT LH L70Y,FENDER PANEL INNER FRT LH L70Y,FENDER PANEL INNER FRT RH,CHASSIS PANEL FRT RH,CHASSIS PANEL FRT LH L70Y,DOOR PANEL FRT LH,DOOR HINGE UPPER LH L70Y,DOOR HINGE LOWER L70Y,ROCKER PANEL INNER LH,ROCKER PANEL OUTER LH AND ROCKER PANEL CENTER LH. }		-	-
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET VEHICLE WARNING INDICATORS.		480.00	250.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR CONDENSER.		380.00	100.00
	TO TRANSFER OF FRONT BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR.		380.00	250.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	150.00

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:9 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.		170.00	40.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		9,900.00	1,760.00
	TO REPLACE,REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
	TO VACUUM,REPLACE,REFIX AND RECHARGE AIR INTERCOOLER.		380.00	50.00
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.		440.00	280.00
	TO TRANSFER OF TAILGATE FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	350.00	-
	TO TRANSFER OF FRONT WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR.		200.00	120.00
	TO TRANSFER OF BONNET FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO DISMANTLE AND REFIT FRONT END SUSPENSION,UNDERCARRIAGE PARTS,FINAL CHECKING AND TESTING.		380.00	280.00
	TO REPLACE AND REFILL POWER STEERING FLUID.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO REMOVE AND RENEW POWER STEERING PUMP,OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO CHECK ABS AND BRAKE EFFICIENCY,FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF FRONT DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	350.00	-
	TOWING FEES.		170.00	50.00
	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT,VACUUM AND CHARGE-IN-GAS.	REPEATED	380.00	-
	TO DISMANTLE AND REFIT ENGINE CROSS-MEMBER AND ENGINE MOUNTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW ENGINE AND GEAR BOX MOUNTING.	NOT NECESSARY	380.00	-
	TO CONDUCT AND PERFORM A COMPREHENSIVE ENGINE DIAGNOSTIC CHECK.	NOT NECESSARY	380.00	-

Report Ref No. CC3/FCI20001686/Kba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:10 of 10

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
			28,030.00	4,960.00
GRAND TOTAL			121,693.59	38,304.37
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				30,650.00

Report Ref No. CC3/FCI20001686/Kba3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 202T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

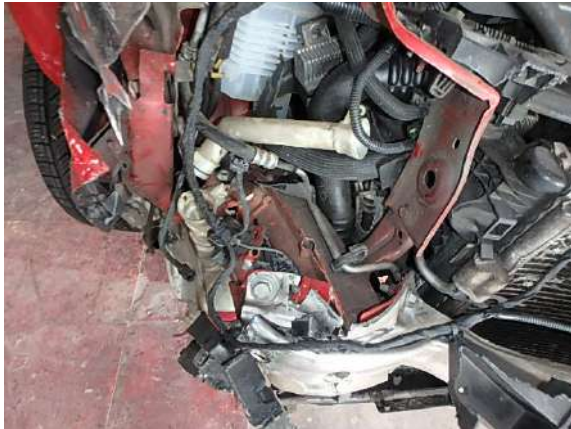



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

