

AUTO SPEC APPRAISER

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Tel : 68427801 Fax : 68468023

Vehicle Survey Report

Reg No	: AS2552	Date	: 17-06-2014
Our Reference No.	: SBA359L02042014	Date Of Survey	: 02-04-2014
Claim Type	: Third Party	Date Of Accident	: 01-04-2014
Assignment Given By	: Mohd Ridwan Abdullah @ Tan Hock Hye	Survey Conduct At	: Multilateral Services
		Address	: Blk 19 Sin Ming Ind Estate
			: #01-07 Singapore 575677

Particulars of vehicle

Vehicle Reg. No.	: SBA359L	Engine Number	: Hidden
Date Of Registration	: 19-04-2007	Chassis Number	: JSAJTE54V00200277
Make	: Suzuki	Transmission Type	: Automatic
Model	: Vitara 2WD	Vehicle Colour	: Grey
		Mileage Reading	: 79462

Visual and static test on vehicle during survey

Hand brake condition	: Serviceable	Body Condition	: Fair
Foot brake condition	: Serviceable	Paint Work condition	: Fair
Steering condition	: Affected	Remarks	: None
Modification	: None		

Condition of vehicle tyre

	Size	Make / Right Tread	Make / Left Tread
Front Tyre	: 225/70R16	Bridgestone / 6MM	Bridgestone / 6MM
Rear Tyre	: 225/70R16	Bridgestone / 6MM	Bridgestone / 6MM


Description on vehicle's point of impact and

Front & rear portion of the vehicle
(For more detail of the damages, please refer photographs attached)

Remarks

In accordance to your instruction, we have **NOT** authorised any repairs.
Estimated duration of repairs 18 days.
This survey was conducted entirely on a "**WITHOUT PREJUDICE**" basis.

Point Of Impact

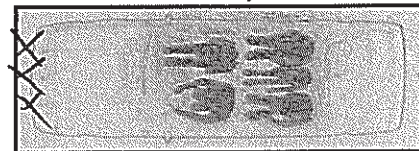

AUTO SPEC APPRAISER

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Tel : 68427801 Fax : 68468023

Adjustment on Spare Parts & Repair Cost

S/No	Qty	Vehicle Parts Description	Condition	Original Quotation (\$S)	Recommendation (\$S)
1	1	Front windscreen glass	Chip	988.50	988.50
2	1	Front windscreen glass moulding	Necessary	99.80	99.80
3	1	Front door RH	Repair	766.51	0.00
4	1	Rear door RH	Repair	876.50	0.00
5	1	Bonnet	Buckled	1,029.20	1,029.20
6	1	Bonnet damper	Bent	240.00	240.00
7	1	Bonnet insulator	Necessary	347.10	347.10
8	2	Bonnet hinge	Bent	105.20	105.20
9	1	Front bumper	Torn	388.00	388.00
10	1	Front bumper reinforcement	Bent	358.70	358.70
11	2	Front bumper bracket	Bent	97.20	97.20
12	1	Front bumper beam	Bent	61.70	61.70
13	1	Front bumper sponge	Crack	108.50	108.50
14	2	Front bumper retainer	Bent	97.20	97.20
15	1	Front bumper fog lamp RH	Smash	675.80	675.80
16	1	Steering rack & pinion	Crack	1,978.50	1,978.50
17	1	Front shock absorber RH	Bent	350.70	350.70
18	1	Front knuckle arm RH	Dent	465.25	465.25
19	1	Front lower arm RH	Dent	435.60	435.60
20	1	Fuse box big	Crack	854.00	854.00
21	1	Fuse box small	Crack	564.00	564.00
22	1	Front engine centre cross member	Dent	801.00	801.00
23	1	Front engine rear cross member	Dent	1689.40	1689.40
24	1	Air-con compressor	Jam	667.70	667.70
25	1	Alternator belt	Cut	54.00	54.00
25	1	Propeller shaft mounting	Crack	335.50	335.50
26	1	Propeller shaft	Dent	1,854.00	1,854.00
27	1	Aircon discharge hose	Bent	325.80	325.80
28	1	Front wheel bearing RH	Necessary	152.70	152.70
29	1	Front stabilizer bar linkage RH	Bent	178.50	178.50
30	1	Front fender RH	Bent	1,320.00	1,320.00
31	1	Front chassis frame LH	Repair	859.00	0.00
32	1	Front chassis frame RH	Dent	859.00	859.00
33	1	Front fender inner panel RH	Bent	667.20	667.20
34	2	Front fender inner cowl	Torn	134.90	134.90
35	1	Front fender signal lamp RH	Crack	38.50	38.50
36	1	Front grille	Crack	654.50	654.50
37	1	Front grille logo	Necessary	38.50	38.50
38	1	Front brace panel	Bent	53.70	53.70
39	2	Horn	Dent	192.80	192.80
40	1	Front support panel	Buckled	819.50	819.50
41	2	Headlamp	Crack	1,960.00	1,960.00
42	1	Aircon condenser	Bent	1,077.00	1,077.00
43	1	Aircon liquid pipe	Bent	264.50	264.50
44	1	Aircon fan blade	Cut	157.50	157.50
45	1	Aircon fan motor	Jam	443.20	443.20
46	1	Aircon fan cowl	Crack	190.50	190.50
47	1	Radiator	Bent	1,689.35	1,689.35
48	1	Radiator fan motor	Jam	443.15	443.15
49	1	Radiator fan cowl	Crack	190.50	190.50
50	1	Bonnet lock	Bent	112.00	112.00
51	1	Aircon suction hose	Bent	388.95	388.95
52	1	Wiper tank	Crack	96.45	96.45

AUTO SPEC APPRAISER

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Tel : 68427801 Fax : 68468023

Adjustment on Spare Parts & Repair Cost

S/No	Qty	Vehicle Parts Description	Condition	Original Quotation (S\$)	Recommendation (S\$)
53	1	Radiator spare tank	Crack	136.80	136.80
54	1	Radiator hose	Cut	39.50	39.50
55	1	Exhaust oxygen sensor	Cut	366.70	366.70
56	1	Exhaust manifold cover	Dent	148.20	148.20
57	1	Exhaust manifold	Dent	2,029.30	2,029.30
58	2	Engine under cover	Deform	269.80	269.80
59	1	Air cleaner box	Crack	518.50	518.50
60	1	Steering air bag	Necessary	2,067.60	2,067.60
61	1	Steering air bag cable	Necessary	435.60	435.60
62	1	Passenger air bag	Necessary	2,786.20	2,786.20
63	2	Front seat belt	Necessary	1,437.40	1,437.40
64	1	Airbag sensor control unit	Necessary	1,379.71	1,379.71
65	2	Engine mounting	Crack	596.00	596.00
66	1	Engine top mounting RH	Crack	168.00	168.00
67	1	Wiper panel garnish RH	Cut	158.00	158.00
TOTAL :				42,134.57	39,632.56
<i>Less market discount 10%</i>				0.00	3963.26
				42134.57	35669.30
1	1	Front windscreen sealant	Necessary	140.00	140.00
2	1	Front sport rim RH	Dent	320.00	320.00
3	1	Front tyre RH	Cut	320.00	250.00
4	1	No plate w/holder	Crack	120.00	120.00
5	1	Battery	Cut	180.00	180.00
6	1	ERP bracket	Necessary	26.00	26.00
TOTAL :				1106.00	1036.00
1		Labour charges.		2800.00	2600.00
2		Spray painting.		2450.00	2200.00
3		Remove and refit front undercarriage.		280.00	280.00
4		Remove and refit front windscreen glass.		200.00	180.00
5		Remove and refit engine and gearbox assy .		360.00	360.00
6		Transfer doors fitting.		180.00	180.00
7		Check wheel alignment.		120.00	120.00
8		Conduct chassis alignment.		280.00	280.00
9		Remove and refit SRS airbag system.		250.00	250.00
10		Towing.		480.00	480.00
11		Remove and refit dashboard.		280.00	280.00
12		Check wiring.		120.00	120.00
13		To apply anti rust.		280.00	250.00
TOTAL :				8080.00	7580.00
TOTAL PARTS AND LABOUR				51,320.57	44,285.30

RECOMMENDED COST OF PART-BY-PART REPAIR

44,285.30

Vehicle Surveyed By:


Ng Ching Chye

For Auto Spec Appraiser

Information in this report is confidential and may be legally privileged. It is intended solely for the person to whom it is addressed. If you are not the intended recipient, any disclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.