



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2004286
INV Date 03/06/2020
Reference CC6/CTI20002816/Ada3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SMS 6668E
Insured Veh. SKU 6082H
Claim No. SNM20D200719
Policy No.
Accident Date 08/02/2020
Inspection Date 17/02/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20002816/Ada3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 03-06-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKU 6082H	Veh. Inspected	SMS 6668E
Policy No.		Coverage (\$)	0.00
Claim No.	SNM20D200719	Excess (\$)	0.00
Assign From		Assign Date	17/02/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA SIENTA	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	NSP1707042379	Colour	WHITE
Odometer	135677	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/60 R15	BRIDGESTONE	6 mm
L/H Front Tyre	185/60 R15	BRIDGESTONE	6 mm
R/H Rear Tyre	185/60 R15	BRIDGESTONE	6 mm
L/H Rear Tyre	185/60 R15	BRIDGESTONE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	08/02/2020	Inspection Date	17/02/2020
Survey held at	YAP LEE MOTOR BLK 1 KAKI BUKIT AVE 6 #01-26 AUTOBAY@KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMS 6668E

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR WINDSCREEN MOULDING	NECESSARY	120.70	120.70
1	REAR TAILGATE	DENTED	1,602.41	1,180.00
2	REAR TAILGATE DAMPERS	NOT NECESSARY	482.58	-
1	REAR TAILGATE INNER TRIM BOARD	NOT NECESSARY	481.94	-
2	REAR TAILGATE LAMPS	NOT NECESSARY	770.40	-
1	REAR TAILGATE LOCK	DAMAGED	489.67	372.00
1	REAR TAILGATE LOGO	NECESSARY	58.50	58.50
1	REAR TAILGATE RUBBER	CUT	291.61	291.61
1	REAR TAILGATE OUTER GARNISH	NOT NECESSARY	257.30	-
2	REAR TAILLAMPS	NOT NECESSARY	874.40	-
1	REAR END PANEL	DENTED	820.65	609.00
1	REAR END PANEL INNER GARNISH	DEFORMED	221.50	221.50
1	REAR SMART KEYLESS SENSOR	CRACKED	189.50	189.50
1	REAR BUMPER	DEFORMED	788.70	788.70
2	REAR BUMPER BRACKETS	NOT NECESSARY	197.00	-
1	REAR BUMPER CENTRE PAD	CUT	225.00	225.00
2	REAR BUMPER REFLECTORS	CRACKED	190.00	190.00
2	REAR BUMPER REFLECTOR OUTER GARNISHES	NOT NECESSARY	361.00	-
2	REAR BUMPER SIDE OUTER GARNISHES	DEFORMED	255.00	255.00
2	REAR BUMPER SIDE RETAINERS	NECESSARY	128.80	128.80
1	REAR BUMPER TOW HOOK COVER	NOT NECESSARY	55.20	-
	LESS 25% DISCOUNT		-2,215.47	-1,157.58
			6,646.39	3,472.73
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	50.00	30.00
1	REAR BUMPER CARBON STICKER (SN)	CUT	180.00	120.00
1	SET REAR REVERSE SENSOR (SN)	DAMAGED	350.00	200.00
1	REAR REVERSE CAMERA (SN)	NOT NECESSARY	480.00	-
			1,140.00	410.00

Report Ref No. CC6/CTI20002816/Ada3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE,REPLACED DAMAGED LAMPS AND CHECK UP REAR WIRING.		80.00	30.00
	+			
	+			
	TO REMOVE AND REFIT INNER GARNISHES .		150.00	60.00
	TO REMOVE AND REFIT REAR REVERSE SENSOR AND REVERSE CAMERA.		150.00	100.00
	TO TRANSFER REAR TAILGATE MECHANISM AND WIRING ASSEMBLY.		120.00	80.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS .		180.00	120.00
	TO APPLY UNDERCOATING.		200.00	60.00
	PANEL BEATING.		1,500.00	900.00
	TO RE-SPRAY PAINTING ON THE AFFECTED AREAS.		1,400.00	900.00
			3,780.00	2,250.00
GRAND TOTAL			11,566.39	6,132.73

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,900.00
---	--	--	-----------------

Report Ref No. CC6/CTI20002816/Ada3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMS 6668E

INSPECTION

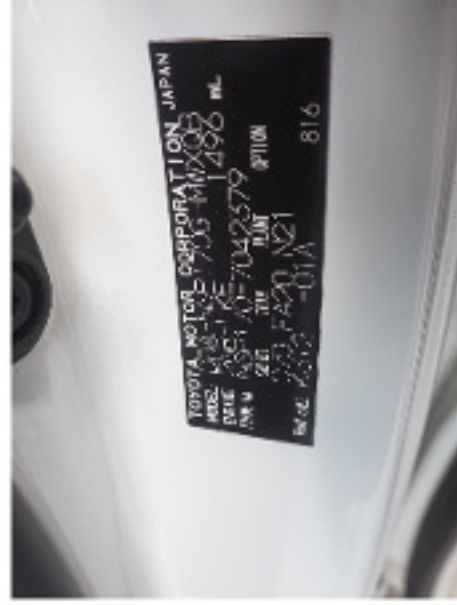



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMS 6668E

RE-INSPECTION

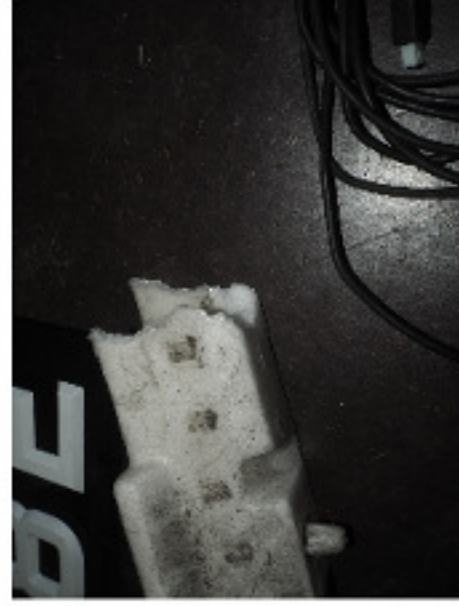



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

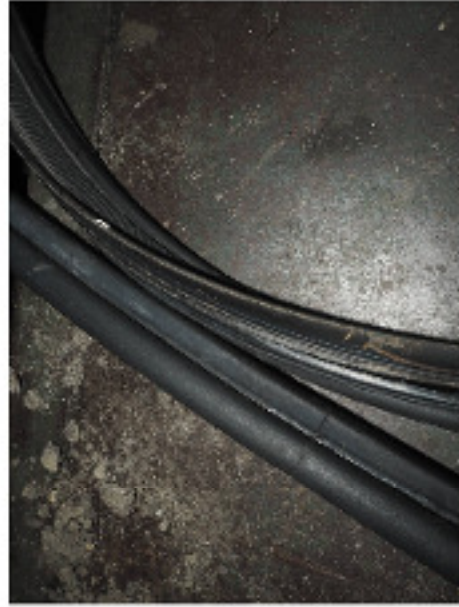



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMS 6668E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

