



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2003624
INV Date 04/05/2020
Reference CC6/EQI20002856/Aga3q2
Code EQI



PROFESSIONAL SERVICE FEE

Vehicle No. GBE 152U
Insured Veh. SMP 1812D
Claim No. DM20HO00375-JG
Policy No.
Accident Date 13/02/2020
Inspection Date 17/02/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD		Ref : CC6/EQI20002856/Aga3q2		
5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Date : 04-05-2020		
		Code : EQI		
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMP 1812D	Veh. Inspected	GBE 152U
	Policy No.		Coverage (\$)	0.00
	Claim No.	DM20HO00375-JG	Excess (\$)	0.00
	Assign From		Assign Date	17/02/2020
2. Vehicle Particulars & Condition				
	Make & Model	NISSAN NV200	c.c	1461
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	VSKYBAM20Z0099837	Colour	BLACK
	Odometer	96601	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	185/65 R14	PRIMEWELL	6 mm
	L/H Front Tyre	185/65 R14	PRIMEWELL	6 mm
	R/H Rear Tyre	185/65 R14	PRIMEWELL	6 mm
	L/H Rear Tyre	185/65 R14	PRIMEWELL	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	13/02/2020	Inspection Date	17/02/2020
	Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 152U

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DEFORMED	765.00	765.00
2	FRONT BUMPER SIDE RETAINER @\$58.40	O/S NECESSARY	116.80	58.40
1	FRONT BUMPER CENTRE GRILLE ASSY	NOT NECESSARY	469.00	-
1	HEADLAMP RH	CRACKED	564.00	564.00
1	HEADLAMP PANEL ,RH	TORN	231.90	231.90
1	FRONT FENDER RH	DENTED	684.60	684.60
1	FRONT FENDER SIGNAL LAMP RH	NOT NECESSARY	90.00	-
1	FRONT FENDER INNER COWLING RH	DEFORMED	285.00	285.00
1	FRONT WHEEL HOUSE PANEL RH	TO REPAIR SEE LABOUR	642.00	-
1	FRONT LOWER ARM	BENT	364.00	364.00
1	FRONT KNUCKLE RH	BENT	64.50	64.50
1	DRIVE SHAFT	NOT NECESSARY	967.10	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	775.50	-
1	FRONT AXLE	NOT NECESSARY	2,328.70	-
1	FRONT QUARTER GLASS MOULDING W GLASS	NOT NECESSARY	368.50	-
	LESS 10% DISCOUNT		-871.66	-301.74
			7,844.94	2,715.66
<u>NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (N)	NECESSARY	20.00	20.00
1	SET HEADLAMP CLIPS (N)	NECESSARY	20.00	20.00
1	FRONT QUARTER GLASS SEALANT (N)	NECESSARY	40.00	30.00
1	SET FRONT FENDER INNER COWLING CLIPS (N)	NECESSARY	20.00	20.00
1	STEERING RACK AND PINION (N)	BROKEN	1,870.80	1,870.80
1	FRONT SHOCK ABSORBER (N)	BENT	386.00	386.00
1	FRONT WHEEL HUB WITH BEARING (N)	DAMAGED	448.00	448.00
1	FRONT KNUCKLE ARM (N)	DAMAGED	480.00	480.00
1	DRIVE SHAFT (N)	NOT NECESSARY	967.10	-
2	WHEEL RIM @\$650.00 (N)	FRONT O/S CUT	1,300.00	180.00
2	WHEEL TYRE @\$320.00 (N)	NOT NECESSARY	640.00	-

Report Ref No. CC6/EQI20002856/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-	-345.48
			6,191.90	3,109.32
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT WHEEL HOUSE PANEL RH .		2,000.00	400.00
	TO SPRAY PAINT AFFECTED AREA.		2,000.00	500.00
	TUFF COAT.		150.00	30.00
	WIRING CHECK .		150.00	30.00
	REMOVE AND REFIX FRONT DASHBOARD .	NOT NECESSARY	250.00	-
	REMOVE AND REFIX FRONT QUARTER GLASS .		100.00	40.00
	TO REMOVE AND REFIX ALL AIRBAG INCLUDING RESETTING.	NOT NECESSARY	350.00	-
	TO REMOVE AND REFIX FRONT UNDERCARRIAGE.		280.00	250.00
	WHEEL ALIGNMENT.		100.00	80.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	200.00	-
			5,580.00	1,330.00
	GRAND TOTAL		19,616.84	7,154.98
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,700.00

Report Ref No. CC6/EQI20002856/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 152U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 152U

RE-INSPECTION

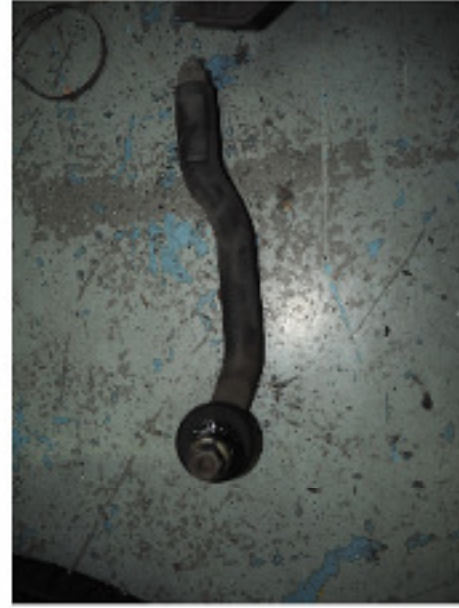



LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

