



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

SOMPO INSURANCE SINGAPORE PL  
50 RAFFLES PLACE  
#05-01/06  
SINGAPORE LAND TOWER  
SINGAPORE 048623

INV No. AC2003391  
INV Date 23/04/2020  
Reference CS/SMO20003127/T1td3n2  
Code SMO



### PROFESSIONAL SERVICE FEE

Vehicle No. SLT 9700G  
Insured Veh. SJJ 2435U  
Claim No. CMTD2000841/RE  
Policy No.  
Accident Date 23/02/2020  
Inspection Date 25/02/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>450.00</b>
<b>GST (7%)</b>	<b>31.50</b>
<b>Grand Total</b>	<b>481.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
SOMPO INSURANCE SINGAPORE PL		Ref : CS/SMO20003127/T1td3n2		
50 RAFFLES PLACE #05-01/06 SINGAPORE LAND TOWERSINGAPORE 048623		Date : 23-04-2020		
		Code : SMO		
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SJJ 2435U	Veh. Inspected	SLT 9700G	
Policy No.		Coverage (\$)	0.00	
Claim No.	CMTD2000841/RE	Excess (\$)	0.00	
Assign From	HENRY IRENE JAMES	Assign Date	25/02/2020	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	TOYOTA HARRIER PREMIUM	c.c	1986	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	ZSU600083968	Colour	BLACK	
Odometer	45900	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	235/55 R18	BRIDGESTONE	6 mm	
L/H Front Tyre	235/55 R18	BRIDGESTONE	6 mm	
R/H Rear Tyre	235/55 R18	BRIDGESTONE	6 mm	
L/H Rear Tyre	235/55 R18	BRIDGESTONE	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	23/02/2020	Inspection Date	25/02/2020	
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>		



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 9700G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	TAILGATE	BENT	1,749.27	1,224.80
2	TAILGATE HINGE	TO REPAIR SEE LABOUR	279.22	-
2	TAILGATE ABSORBER	NOT NECESSARY	862.86	-
1	TAILGATE INNER TRIM	CRACKED	860.32	568.50
1	TAILGATE OUTER GARNISH	NOT NECESSARY	402.26	-
1	TAILGATE LOGO	NECESSARY	96.12	87.00
1	TAILGATE GLASS MOULDING	NECESSARY	231.50	191.20
2	TAILGATE LAMP	N/S CRACKED / O/S NOT NECESSARY	1,035.92	422.80
1	TAILGATE LOCK	BENT	681.20	385.90
1	TAILGATE LOCK STIKER	TO REPAIR SEE LABOUR	121.50	-
1	REAR BUMPER	DEFORMED	1,304.33	1,304.33
2	REAR BUMPER RETAINER	NOT NECESSARY	200.80	-
1	REAR BUMPER BRACKET	NOT NECESSARY	76.48	-
1	REAR BUMPER LOWER GARNISH	CUT	457.68	396.10
2	REAR BUMPER REFLECTOR	NOT NECESSARY	171.60	-
1	END PANEL	TO REPAIR SEE LABOUR	860.76	-
1	END PANEL TOP GARNISH	NOT NECESSARY	443.28	-
2	TAILLAMP	N/S CRACKED / O/S NOT NECESSARY	1,343.90	480.60
1	SPARE TYRE TOP BOARD	NOT NECESSARY	587.77	-
1	SPARE TYRE COVER	NOT NECESSARY	438.61	-
1	FLOOR PANEL	NOT NECESSARY	915.86	-
1	EXHAUST SILENCER	NOT NECESSARY	690.35	-
2	EXHAUST MOUNTING	NOT NECESSARY	85.68	-
1	REAR BUMPER SPONGE (ADDITIONAL)	CRACKED	381.02	245.90
	LESS 25% DISCOUNT		-3,569.57	-1,326.78
			10,708.72	3,980.35

Report Ref No. CS/SMO20003127/T1td3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	80.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	40.00	30.00
1	SET TAILGATE INNER TRIM CLIP (SN)	NECESSARY	60.00	20.00
1	SET END PANEL INNER TRIM CLIP (SN)	NOT NECESSARY	60.00	-
1	REAR SAFETY BAR (AFTER MARKET)(SN)	NOT NECESSARY	1,200.00	-
1	SET REVERSE SENSOR (SN)	NOT WORKING	800.00	200.00
			2,240.00	250.00
	<b><u>LABOUR</u></b>			
	CHECK WIRING AND LIGHTING SYSTEM.		60.00	30.00
	REMOVE AND REFIT REAR WINDSCREEN.		150.00	120.00
	REMOVE AND RENEW REAR REVERSE SENSOR.		200.00	30.00
	REMOVE,REFIT REAR LINING,TRIM AND GARNISH.		200.00	60.00
	REMOVE AND RENEW REAR EXHAUST ASSY.	NOT NECESSARY	200.00	-
	REMOVE AND REFIT FUEL TANK.	NOT NECESSARY	150.00	-
	TRANSFER PARTS,ATTACHMENT FROM OLD TAILGATE TO NEW.		200.00	60.00
	PANEL BEATING ON AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF TAILGATE HINGE,TAILGATE LOCK STIKER AND END PANEL.		1,600.00	700.00
	SPRAY PAINTING ON AFFECTED AREAS.		1,600.00	700.00
	APPLY ANTI RUST ON AFFECTED AREAS.		150.00	30.00
			4,510.00	1,730.00
<b>GRAND TOTAL</b>			<b>17,458.72</b>	<b>5,960.35</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>4,750.00</b>

Report Ref No. CS/SMO20003127/T1td3n2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 9700G

INSPECTION







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

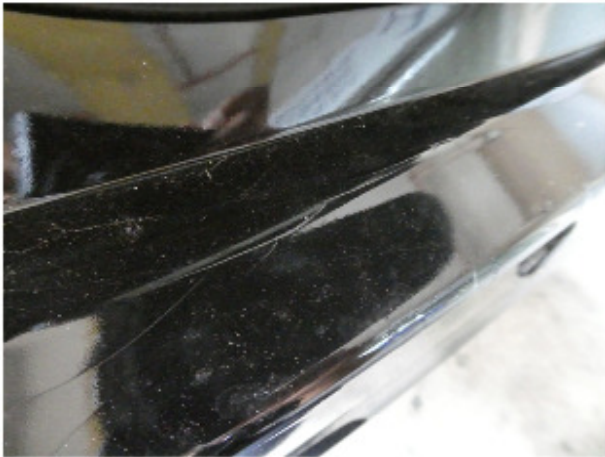





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 9700G

RE-INSPECTION









## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

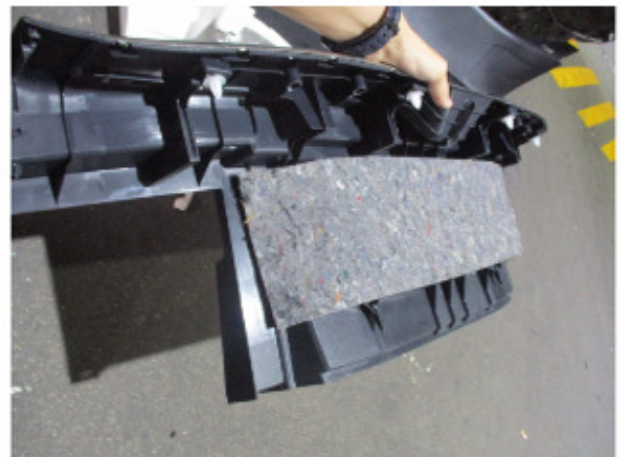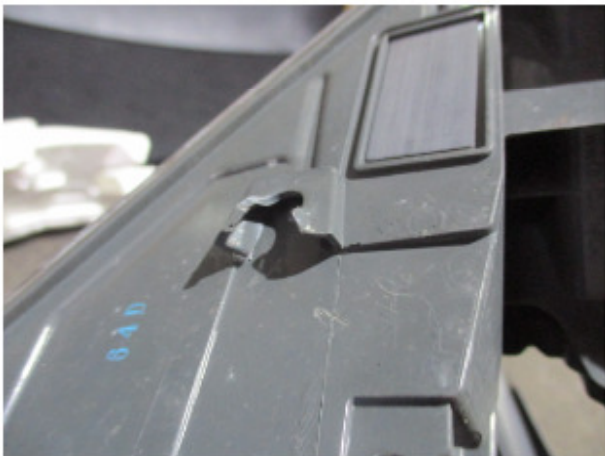



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

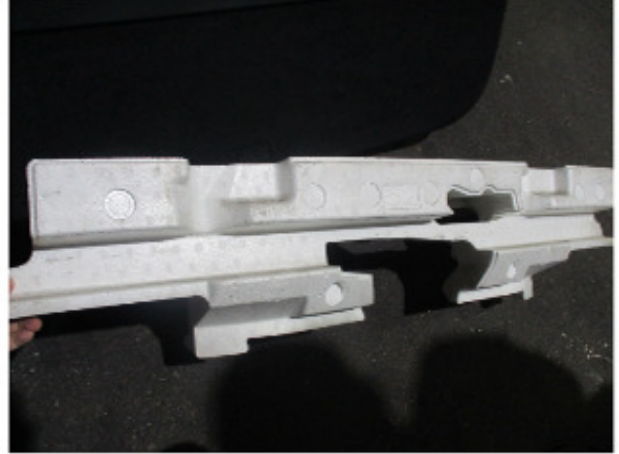



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SLT 9700G**

**RE-INSPECTION**

