



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2105173
3 ANSON ROAD #16-00	INV Date	26/07/2021
SPRINGLEAF TOWER	Reference	CC3/CTI20003161/Kea3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SHD 719U
Insured Veh.	SGQ 4532H
Claim No.	SNM20D201078
Policy No.	
Accident Date	20/02/2020
Inspection Date	21/02/2020

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>350.00</b>
<b>GST (7%)</b>	<b>24.50</b>
<b>Grand Total</b>	<b>374.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC3/CTI20003161/Kea3q2 Date: 26/07/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SGQ 4532H	Veh. Inspected	SHD 719U
Policy No.		Coverage (\$)	0.00
Claim No.	SNM20D201078	Excess (\$)	0.00
Assign From		Assign Date	21/02/2020
2. Vehicle Particulars & Condition			
Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	VF1ABL15AUC283213	Colour	METALLIC WHITE / RED
Odometer	226609 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	9 mm
L/H Front Tyre	215/60 R16	SAILUN	9 mm
R/H Rear Tyre	215/60 R16	SAILUN	8 mm
L/H Rear Tyre	215/60 R16	SAILUN	8 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	20/02/2020	Inspection Date	21/02/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 719U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	FENDER PANEL REAR LH	BENT	1,933.20	1,933.20
1	FENDER PANEL INNER TRIM REAR LH	TO REPAIR SEE LABOUR	671.45	-
1	WHEELARCH REAR LH	SERVICEABLE	181.60	-
1	BUMPER COVER REAR	BENT	561.70	561.70
1	BUMPER LOWER REAR	SERVICEABLE	411.90	-
1	BUMPER BRACKET CTR REAR	SERVICEABLE	98.10	-
1	BUMPER BRACKET SIDE LH REAR	DISTORTED	82.10	82.10
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	BUMPER REFLECTOR LH	SERVICEABLE	16.60	-
1	BUMPER BEAM REAR	TO REPAIR SEE LABOUR	547.80	-
1	BUMPER BEAM BRACKET LH REAR	TO REPAIR SEE LABOUR	114.50	-
1	TAILLAMP LH	SERVICEABLE	401.40	-
1	TAILLAMP PANEL LH	TO REPAIR SEE LABOUR	401.40	-
1	AIR VENT	SERVICEABLE	59.40	-
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	277.70	-
1	WHEEL HUB NUT	SERVICEABLE	41.80	-
1	WHEEL HUB CAP	SERVICEABLE	30.50	-
1	KNUCKLE HUB + BEARING LH	SERVICEABLE	272.30	-
1	REAR AXLE	SERVICEABLE	3,469.00	-
1	AXLE ARM LH	SERVICEABLE	69.50	-
1	REAR AXLE SPACER	SERVICEABLE	49.00	-
1	REAR AXLE ARM ROD	SERVICEABLE	69.50	-
1	LOWER ARM REAR LH	SERVICEABLE	543.50	-
1	AXLE SPRING ARM LH	SERVICEABLE	220.60	-
1	ABSORBER REAR	SERVICEABLE	217.30	-
1	ABSORBER DUST COVER REAR	SERVICEABLE	47.10	-
1	ABSORBER MOUNTING REAR	SERVICEABLE	49.40	-
1	STABILIZER BAR REAR	SERVICEABLE	427.90	-

Report Ref No. CC3/CTI20003161/Kea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STABILIZER LINK REAR	SERVICEABLE	55.20	-
1	BRAKE CALIPER REAR LH	SERVICEABLE	659.10	-
1	BRAKE HOSE REAR LH	SERVICEABLE	79.50	-
1	SUBFRAME ARM REAR	SERVICEABLE	198.33	-
1	RODE-LONG REAR	SERVICEABLE	120.16	-
1	KNUCKLE ARM REAR LH L70Y	SERVICEABLE	472.10	-
1	BRAKE DISC REAR LH L70Y	SERVICEABLE	266.50	-
1	ABS SENSOR REAR LH L70Y	SERVICEABLE	190.50	-
1	DOOR PANEL REAR LH	TO REPAIR SEE LABOUR	758.70	-
1	ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	1,184.99	-
1	FENDER INNER BOARD LH	SERVICEABLE	561.40	-
1	FENDER PANEL INNER REAR LH	TO REPAIR SEE LABOUR	1,241.60	-
	LESS 10% DISCOUNT		-1,710.85	-257.70
			15,397.68	2,319.30
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP LH (SN)	NOT NECESSARY	5.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN)	NOT NECESSARY	35.00	-
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	120.00	40.00
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	160.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	30.00
1	REAR LEFT TYRE (SN)	SERVICEABLE	300.00	-
1	REAR LEFT TYRE RIM (SN)	DENTED	380.00	380.00
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NECESSARY	33.00	33.00
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NOT NECESSARY	66.00	-
1	REAR BUMPER PROTECTOR (SN)	NOT NECESSARY	100.00	-

Report Ref No. CC3/CTI20003161/Kea3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR LICENCE PLATE WITH HOLDER (SN)	NOT NECESSARY	80.00	-
1	REAR DOOR STICKER '6555-3333' (SN)	NOT NECESSARY	100.00	-
			2,325.00	549.00
	<b>LABOUR</b>			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF FENDER PANEL INNER TRIM REAR LH, BUMPER BEAM REAR, BUMPER BEAM BRACKET LH REAR, TAILLAMP PANEL LH, DOOR PANEL REAR LH, ROCKER PANEL OUTER LH AND FENDER PANEL INNER REAR LH.		7,500.00	600.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.		380.00	100.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO TRANSFER OF REAR WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR.		170.00	120.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR BUMPER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.		170.00	20.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		7,500.00	440.00
	TO DISMANTLE AND REFIT REAR UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT REAR AXLE ASSY, REMOVE AND RENEWAL OF PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
			18,480.00	1,450.00
<b>GRAND TOTAL</b>			<b>36,202.68</b>	<b>4,318.30</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>4,318.30</b>

Report Ref No. CC3/CTI20003161/Kea3q2

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SHD 719U

## INSPECTION

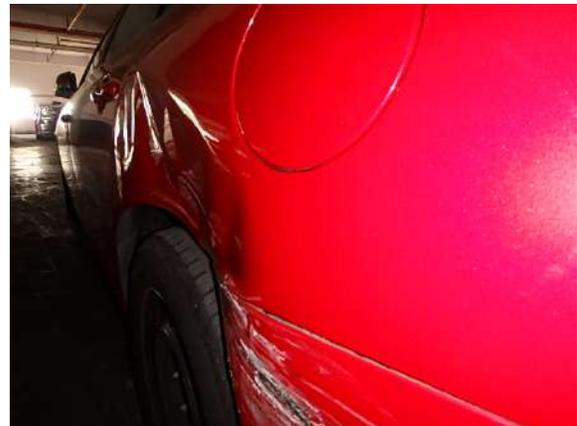



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



