



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100318

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 14/01/2021
Reference CC4/FCI20003357/Aba3s2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLW 4061J
Insured Veh. SHC 8906Z
Claim No. D20001211MFSH
Policy No. D-20094922MFSH
Accident Date 26/02/2020
Inspection Date 28/02/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

NSA



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20003357/Aba3s2	
			Date: 14/01/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHC 8906Z	Veh. Inspected	SLW 4061J
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00
	Claim No.	D20001211MFSH	Excess (\$)	0.00
	Assign From	CHRIS LIM	Assign Date	28/02/2020
2. Vehicle Particulars & Condition				
	Make & Model	HONDA VEZEL HYBRID	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	RU31222459	Colour	SILVER
	Odometer	167626 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	WEST LAKE	6 mm
	L/H Front Tyre	215/60 R16	WEST LAKE	6 mm
	R/H Rear Tyre	215/60 R16	WEST LAKE	6 mm
	L/H Rear Tyre	215/60 R16	WEST LAKE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	26/02/2020	Inspection Date	28/02/2020
	Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-18 KAKI BUKIT AUTOHUB SINGAPORE 417921		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 4061J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DEFORMED	810.70	810.70
2	FRONT BUMPER SIDE RETAINER @ \$20.60	O/S NECESSARY	41.20	20.60
1	FRONT RH DOOR	DENTED	1,080.50	1,080.50
1	FRONT RH DOOR FRAME BLACK STICKER	NECESSARY	33.00	33.00
1	FRONT RH DOOR INNER PLASTIC SEAL COVER	NOT NECESSARY	35.30	-
1	FRONT RH DOOR MECHANISM LOCK	DAMAGED	196.30	196.30
1	FRONT RH FENDER 'HYBRID' EMBLEM	NECESSARY	95.00	95.00
1	FRONT RH FENDER ARCH GARNISH	CUT	220.00	220.00
2	REAR BUMPER SIDE RETAINER L/R @ \$23.00	NOT NECESSARY	46.00	-
1	REAR RH BUMPER SIDE	TO REPAIR SEE LABOUR	195.00	-
1	REAR RH DOOR	DENTED	930.60	930.60
1	REAR RH DOOR CENTER RUBBER SEAL	CUT	35.00	35.00
1	REAR RH DOOR CLEAR STICKER	NECESSARY	21.70	21.70
1	REAR RH DOOR FRAME BLACK STICKER	NECESSARY	28.50	28.50
2	REAR RH DOOR HINGES (TOP & LOWER) @ \$38.50	BENT	77.00	77.00
1	REAR RH DOOR INNER PLASTIC SEAL COVER	NOT NECESSARY	35.30	-
1	REAR RH DOOR MECHNISM LOCK	NOT NECESSARY	196.30	-
1	REAR RH FENDER ARCH GARNISH	CUT	195.00	195.00
1	REAR RH WHEEL CAP	NOT NECESSARY	198.00	-
	LESS 20% DISCOUNT		-894.08	-748.78
			3,576.32	2,995.12
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT RH DOOR INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT RH FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR RH DOOR INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR RH FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
			260.00	90.00

Report Ref No. CC4/FCI20003357/Aba3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING. (TO FR)		50.00	30.00
	TO REMOVE, REINSTALL ROOF TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET. (TO FR)	NOT NECESSARY	100.00	-
	TO TRANSFER DOOR GLASS, REGULATOR GEAR, MOTOR, RAILING, CHANNEL, TRIM BOARD, MECHANISM LOCK AND HANDLE.		200.00	160.00
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		1,300.00	1,100.00
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF REAR RH BUMPER SIDE.		800.00	600.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		100.00	50.00
			2,550.00	1,940.00
	GRAND TOTAL		6,386.32	5,025.12
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,000.00

Report Ref No. CC4/FCI20003357/Aba3s2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 4061J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 4061J

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

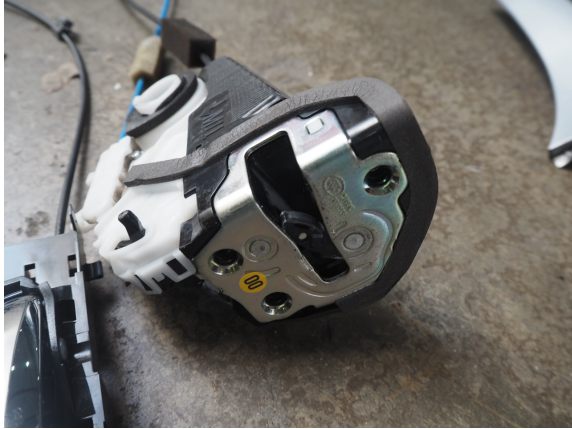




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

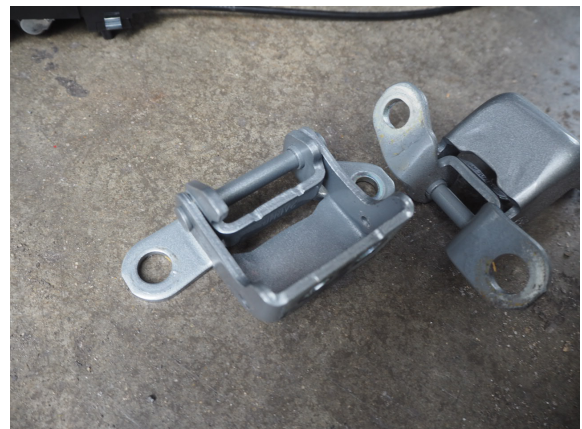



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

