



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2007557
INV Date 11/11/2020
Reference CC4/FCI20003819/Aea3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SLD 1454D
Insured Veh. SHB 4429R
Claim No. D20001369MFSH/1
Policy No. D-20094922MFSH
Accident Date 06/03/2020
Inspection Date 10/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20003819/Aea3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 11-11-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 4429R	Veh. Inspected	SLD 1454D
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20001369MFSH/1	Excess (\$)	0.00
Assign From	VIC	Assign Date	10/03/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ALTIS	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	MR053REH104551086	Colour	SILVER
Odometer	58690	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	YOKOHAMA	6 mm
L/H Front Tyre	205/55 R16	YOKOHAMA	6 mm
R/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm
L/H Rear Tyre	205/55 R16	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	06/03/2020	Inspection Date	10/03/2020
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 1454D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOTLID	TO REPAIR SEE LABOUR	781.10	-
1	REAR BOOTLID "ALTIS" EMBLEM	NECESSARY	54.10	54.10
1	REAR BOOTLID "COROLLA" EMBLEM	NECESSARY	50.20	50.20
1	REAR BOOTLID "LOGO" EMBLEM	NECESSARY	58.50	58.50
1	REAR BOOTLID MECHANISM LOCK	DAMAGED	379.20	379.20
1	REAR BOOTLID WEATHER STRIP	CUT	271.45	271.45
1	REAR BUMPER	DEFORMED	581.90	581.90
2	REAR BUMPER REFLECTOR L/R @\$141.45	N/S CRACKED	282.90	141.45
1	REAR BUMPER REINFORCEMENT	DENTED	398.70	398.70
2	REAR BUMPER REINFORCEMENT BRACKET L/R @\$165.00	N/S BENT	330.00	165.00
2	REAR BUMPER REVERSE SENSOR COVER L/R @\$121.10	NOT NECESSARY	242.20	-
2	REAR BUMPER REVERSE SENSOR L/R @\$189.50	DAMAGED	379.00	379.00
2	REAR BUMPER SIDE RETAINER L/R @\$65.00	NECESSARY	130.00	130.00
1	REAR END PANEL	DENTED	781.90	781.90
1	REAR END PANEL INNER TOP GARNISH	DEFORMED	185.99	185.99
1	REAR LH BUMPER END SEAL COVER	NOT NECESSARY	231.35	-
1	REAR LH FENDER INNER TRIM	NOT NECESSARY	338.00	-
1	REAR LH TAILLAMP	CRACKED	391.90	391.90
2	REAR TAILLAMP LOWER BRACKET L/R @\$88.70	N/S CRACKED	177.40	88.70
	LESS 25% DISCOUNT		-1,511.45	-1,014.50
			4,534.34	3,043.49
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET REAR END PANEL INNER TOP GARNISH CLIPS (SN)	NECESSARY	40.00	10.00
1	SET REAR LH FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR LH TAILLAMP CLIPS (SN)	NECESSARY	25.00	25.00
			195.00	65.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE,REINSTALL ELECTRICAL WIRING HARNESS,CHECK LIGHTING,AND REWIRE FOR PARKING SENSOR.		100.00	70.00
	TO REMOVE,REINSTALL ROOF TOP TRIM UPHOLSTERY,CUSHION SEAT,TRIM GARNISH,TRIM LINER CARPET (TO FR).		140.00	60.00
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS,REPAIR PORTION,AND WHERE CONSISTENT TO THE ACCIDENT.		1,000.00	800.00
	TO PROVIDE LABOUR,WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS,REPAIR,RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE,BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT.INCLUSIVE OF THE REPAIR OF REAR BOOTLID.		1,000.00	600.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	60.00
	TO TRANSFER REAR BOOTLID MECHANISM LOCK OUTER HANDLE REFLECTOR.	NOT NECESSARY	80.00	-
			2,440.00	1,590.00
	GRAND TOTAL		7,169.34	4,698.49
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,700.00

Report Ref No. CC4/FCI20003819/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1454D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1454D

RE-INSPECTION

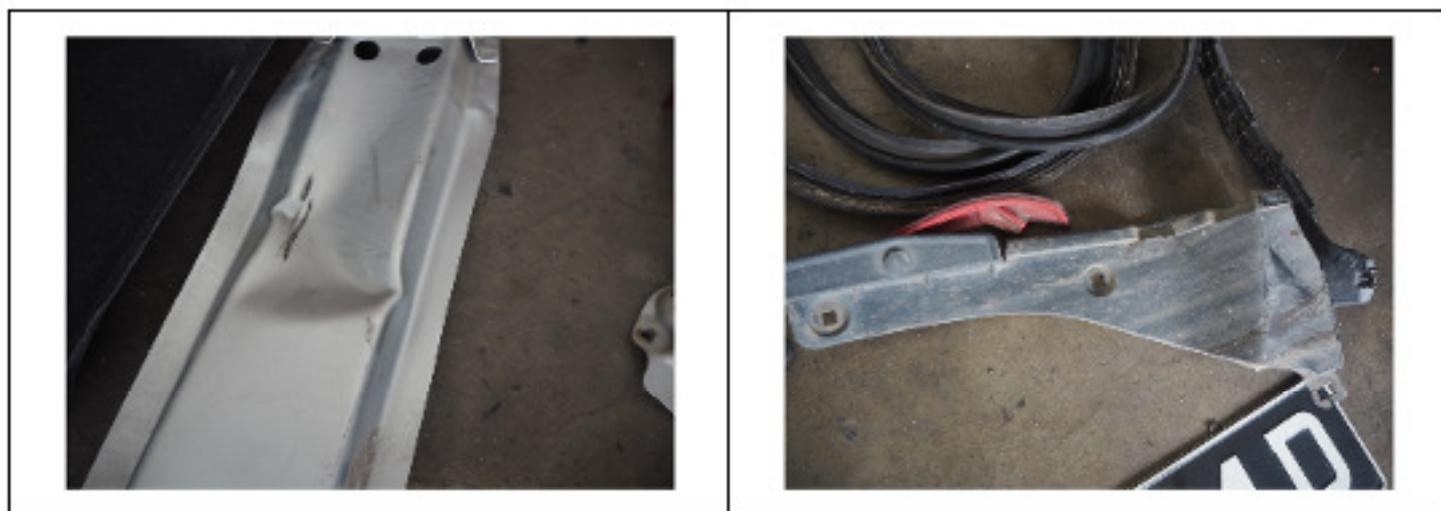



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 1454D

RE-INSPECTION

