

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSE

SINGAPORE 068877

INV No. AC2007713

INV Date 17/11/2020

Reference CC4/FCI20003888/T1ba3q2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLP 1482J

Insured Veh. SHA 2897R

Claim No. D20001384MFSH

Policy No. D-20094922MFSH

Accident Date 08/03/2020

Inspection Date 10/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LAM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile				
MS F	S FIRST CAPITAL INSURANCE LTD Ref : CC4/FCl20003888/T1ba3q2				
	OBINSON ROAD 11 CITY HOUSES	INGAPORE 068877	Date: 17-11-2020 Code: FCI2		
1.		Policy Particulars	- THIRD PARTY CLAIM		
	Insured Veh.	SHA 2897R	Veh. Inspected	SLP 1482J	
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
	Claim No.	D20001384MFSH	Excess (\$)	0.00	
	Assign From	HENG DING CHAO	Assign Date	10/03/2020	
2.		Vehicle Partic	culars & Condition		
	Make & Model	TOYOTA ALLION	c.c	1496	
	Engine No.	HIDDEN	Year of Reg.	2008	
	Chassis No.	NZT2603029205	Colour	SILVER	
	Odometer	365055	Steering	IN ORDER	
	Brakes	IN ORDER	Modification	SPORTS RIM	
	General	GOOD			
3.		Condition	ons of Tyres		
		Size	Make	Balance	
	R/H Front Tyre	195/60 R15	GOODYEAR	6 mm	
	L/H Front Tyre	195/60 R15	GOODYEAR	6 mm	
	R/H Rear Tyre	195/60 R15	GOODYEAR	6 mm	
	L/H Rear Tyre	195/60 R15	GOODYEAR	6 mm	
4.		<u> </u>	on of Damages		
	THE VEHICLE SU	STAINED DAMAGES AT THE FRO	ONT O/S PORTION AND UN	DERCARRIAGE.	
	DAMAGES SEE D	ETAILS.			
5.		General	Information		
	Accident Date	08/03/2020	Inspection Date	10/03/2020	
	Survey held at	MY CAR CONSULTANT PTE LT	D		
	53 UBI AVENUE 1 #01-33 PAYA UBI INDUSTRIAL PARK SINGAPORE 408934				
5a.			emarks		
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b.					
	ESTIMATED NORMAL PERIOD FOR REPAIR: 5 Working Days				



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 1482J

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BONNET	TO REPAIR SEE LABOUR	809.00	-
1	FRONT BUMPER	DEFORMED	425.00	425.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	305.00	-
1	FRONT BUMPER SIDE RETAINER LH	DEFORMED	52.00	52.00
1	FRONT HEADLAMP LH	CRACKED	600.00	600.00
1	FRONT FENDER LH	BENT	718.00	553.20
1	FRONT FENDER INNER SEAL LH	DEFORMED	180.00	180.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	870.00	-
1	LH FRONT SHOCK ABSORBER	BENT	412.50	412.50
1	LH FRONT SHOCK ABSORBER MOUNTING	NOT NECESSARY	147.10	-
1	LH FRONT LOWER ARM	BENT	368.70	368.70
1	LH FRONT KNUCKLE ARM	BENT	478.60	478.60
1	LH FRONT KNUCKLE ARM BEARING	BENT	132.40	132.40
1	LH FRONT STABILISER LINK	NOT NECESSARY	147.66	-
	LESS 25% DISCOUNT		-1,411.49	-800.60
			4,234.47	2,401.80
	SPECIAL NETT ITEMS			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	SET FRONT FENDER INNER SEAL CLIPS LH (SN)	NECESSARY	80.00	30.00
1	FRONT SPORT RIM LH (SN)	DENTED	220.00	220.00
1	FRONT TYRE LH (SN)	NOT NECESSARY	125.00	-
			505.00	280.00
	<u>LABOUR</u>			
	TO CHECK REAR ELECTRICAL WIRING .		80.00	30.00
	TO RESPRAY UNDERCOATING.		100.00	30.00
	APPLY ANTI RUST ON AFFECTED AREAS.		120.00	30.00
	SPRAY PAINTING ON AFFECTED AREAS.		800.00	600.00
	REMOVE AND REPLACE LH FRONT UNDERCARRIAGE.		300.00	150.00
	FRONT WHEEL ALIGNMENT CHECK .		150.00	80.00

Report Ref No. CC4/FCI20003888/T1ba3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	PANEL BEATIG ON AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF BONNET AND FRONT SUPPORT PANEL .		800.00	600.00
			2,350.00	1,520.00
	GRAND TOTAL		7,089.47	4,201.80

RECOMMENDED COST OF LUMP SUM REPAIRS	3,350.00
(TO ITS PRE-ACCIDENT CONDITION)	

Report Ref No. CC4/FCI20003888/T1ba3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

HO LEONG CHUAN

Automotive Assessor

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 1482J

INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315



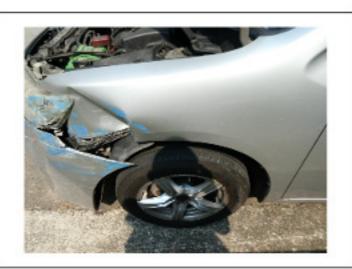











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 1482J

RE-INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315












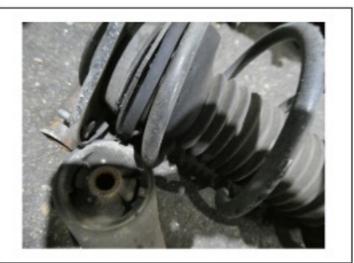



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 1482J

RE-INSPECTION











