



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2008142
INV Date 07/12/2020
Reference CC6/CTI20004110/Kea3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SJD 4227Y
Insured Veh. XE 3606Y
Claim No. SNM20D201352
Policy No. DMCVSN1764071902
Accident Date 14/03/2020
Inspection Date 16/03/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20004110/Kea3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Date : 07-12-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	XE 3606Y	Veh. Inspected	SJD 4227Y
Policy No.	DMCVSN1764071902	Coverage (\$)	0.00
Claim No.	SNM20D201352	Excess (\$)	0.00
Assign From		Assign Date	16/03/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA WISH (A)	c.c	1794
Engine No.	HIDDEN	Year of Reg.	2008
Chassis No.	ZNE100390844	Colour	METALLIC SILVER
Odometer	270027	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	VIKING	9 mm
L/H Front Tyre	195/65 R15	VIKING	9 mm
R/H Rear Tyre	195/65 R15	VIKING	9 mm
L/H Rear Tyre	195/65 R15	VIKING	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	14/03/2020	Inspection Date	16/03/2020
Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **8 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJD 4227Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAIL GATE	BENT	1,210.40	1,210.40
1	TAIL GATE GLASS	SHATTERED	1,137.50	1,137.50
1	TAIL GATE GLASS MOULDING	NECESSARY	80.40	80.40
1	TAIL GATE INNER TRIM	BUCKLED	348.80	348.80
1	TAIL GATE WIPER MOTOR	JAMMED	757.10	757.10
1	TAIL GATE WIPER BLADE	CUT	52.40	52.40
1	TAIL GATE WIPER ARM	DENTED	89.70	89.70
2	TAIL GATE DAMPER @\$224.60	O/S PUNCTURE	449.20	224.60
1	TAIL GATE INNER LOCK	DENTED	443.50	443.50
1	TAIL GATE OUTER CHROME	CRACKED	327.60	327.60
1	TAIL GATE LOGO	NECESSARY	50.80	50.80
2	REAR LICENSE PLATE LAMP @\$56.90	O/S CRACKED	113.80	56.90
1	REAR BUMPER FASCIA	BUCKLED	491.90	491.90
1	REAR O/S BUMPER SIDE RETAINER	DISTORTED	89.90	89.90
1	O/S TAILLAMP	BROKEN	472.60	472.60
1	O/S TAILLAMP CORNER PANEL	BENT	84.50	84.50
1	REAR END PANEL	BENT	441.20	441.20
1	REAR O/S FENDER	BUCKLED	838.50	838.50
1	REAR O/S FENDER INNER TRIM	BUCKLED	697.40	697.40
1	REAR O/S FENDER QUARTER GLASS	SHATTERED	429.20	429.20
1	REAR O/S FENDER INNER SHIELD	SERVICEABLE	65.60	-
	LESS 25% DISCOUNT		-2,168.00	-2,081.23
			6,504.00	6,243.67
1	TAIL GATE RUBBER (50%) (SN)	DISTORTED / CUT	304.00	152.00
	LESS 25% DISCOUNT		-76.00	-
			228.00	152.00
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER REVERSE SENSOR (SN)	SHORTED	300.00	200.00
1	REAR NO PLATE (SN)	DENTED	30.00	25.00

Report Ref No. CC6/CTI20004110/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR W/S GLASS SEALANT (SN)	NECESSARY	60.00	40.00
1	REAR O/S QUARTER GLASS SEALANT (SN)	NECESSARY	40.00	30.00
			430.00	295.00
	LABOUR			
	TO REMOVE & RENEW REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		150.00	120.00
	TO REMOVE ROOF LINING ,FRONT AND REAR SEATS ,TRIM BOARD AND CARPET.		120.00	100.00
	TO APPLY UNDERSEALING.		100.00	90.00
	TO PUTTY AND SPRAY REPLACED PARTS.		900.00	800.00
	TO REMOVE ,CUT -OUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN ,REFIX AND TO RENEW ABOVE PARTS.		1,000.00	900.00
			2,270.00	2,010.00
	GRAND TOTAL		9,432.00	8,700.67
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,950.00

Report Ref No. CC6/CTI20004110/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJD 4227Y

INSPECTION

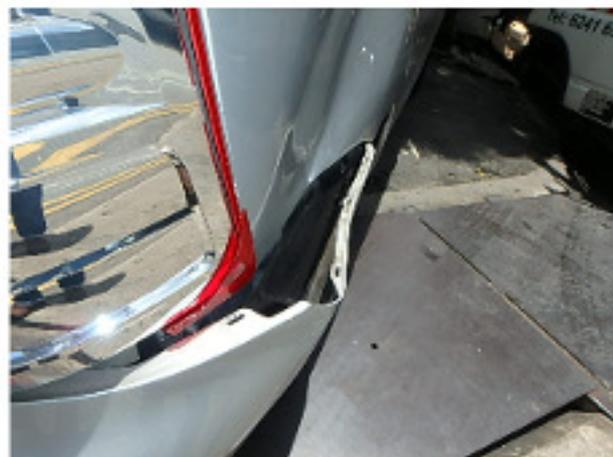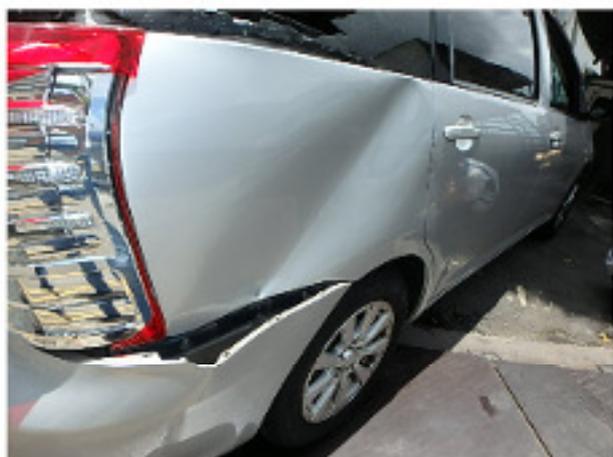




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

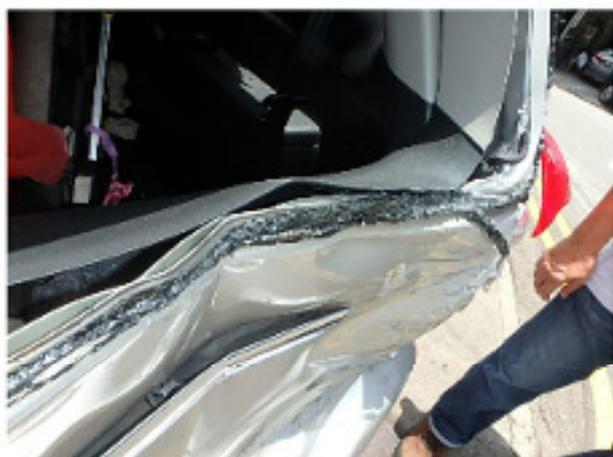




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

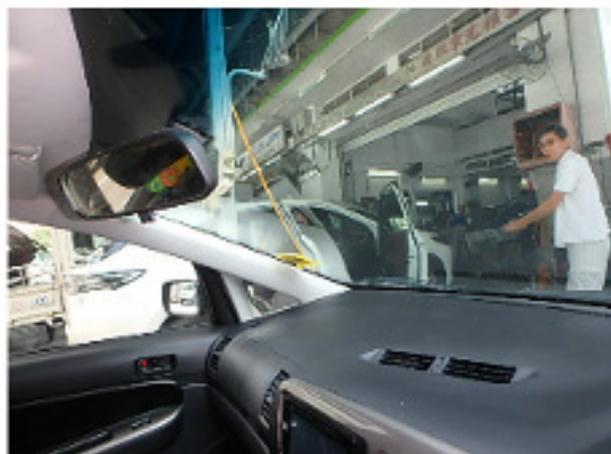



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJD 4227Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJD 4227Y

RE-INSPECTION

