



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2003492
INV Date 27/04/2020
Reference CS/AGI20004144/Atf3n2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SJM 6550C

Insured Veh. SLD 3451Z

Claim No. C10005924

Policy No.

Accident Date 15/03/2020

Inspection Date 18/03/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20004144/Atf3n2

(BUDGET DIRECT INSURANCE)

190 CLEMENCEAU AVENUE #03-01

SINGAPORE SHOPPING CENTRES SINGAPORE

239924

Date : 27-04-2020



Code : AGI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLD 3451Z	Veh. Inspected	SJM 6550C
Policy No.		Coverage (\$)	0.00
Claim No.	C10005924	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	17/03/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA WISH	c.c	1794
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	ZNE100418850	Colour	BLACK
Odometer	347655	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/45 R17	KAPSEN	6 mm
L/H Front Tyre	215/45 R17	KAPSEN	6 mm
R/H Rear Tyre	215/45 R17	KAPSEN	6 mm
L/H Rear Tyre	215/45 R17	KAPSEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	15/03/2020	Inspection Date	18/03/2020
Survey held at	GREEN FOREST AUTOMOBILE 8 KAKI BUKIT AVENUE 4 #05-25 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJM 6550C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	NOT NECESSARY	1,250.00	-
1	FRONT HEAD LAMP-LH	CRACKED	958.00	958.00
1	FRONT HEAD LAMP LOWER BRACKET-LH	NOT NECESSARY	151.20	-
1	FRONT BUMPER	TORN	1,377.00	565.00
2	FRONT BUMPER SIDE BRACKET @\$194.34	NOT NECESSARY	388.68	-
8	FRONT BUMPER CLIPS @\$12.90	NECESSARY	103.20	30.00
2	FRONT BUMPER SIDE CLIPS @\$22.90	NOT NECESSARY	45.80	-
1	FRONT BUMPER INNER SPONGE	NOT NECESSARY	297.57	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	534.90	-
1	FRONT BUMPER NUMBER PLATE	NOT NECESSARY	50.00	-
1	FRONT BUMPER LOWER CENTER GARNISH	NOT NECESSARY	385.10	-
1	FRONT BUMPER FOG LAMP-LH	NOT NECESSARY	287.20	-
1	FRONT BUMPER FOG LAMP COVER	NOT NECESSARY	182.20	-
1	FRONT BUMPER FOG LAMP CHROME	NOT NECESSARY	191.40	-
1	FRONT FENDER-LH	DISTORTED	854.10	650.00
1	FRONT FENDER SIGNAL LAMP-LH	CRACKED	121.75	72.00
1	FRONT FENDER COWLING-LH	DEFORMED	185.20	185.20
1	FRONT L/H FENDER SIDE GLASS	SHATTERED	561.40	561.40
8	FRONT L/H FENDER COWLING CLIPS @\$12.90	NECESSARY	103.20	30.00
1	FRONT FENDER INNER PANEL-LH	TO REPAIR SEE LABOUR	581.20	-
1	FRONT L/H DOOR	DISTORTED	1,069.40	1,069.40
1	FRONT L/H DOOR SIDE MIRROR	CRACKED	652.10	652.10
1	FRONT L/H DOOR TOP HINGES	BENT	80.70	80.70
1	FRONT L/H DOOR LOWER HINGES	BENT	80.70	80.70
1	FRONT L/H DOOR INNER TRIM BOARD	NOT NECESSARY	1,387.15	-
1	FRONT L/H DOOR INNER LOCK	NOT NECESSARY	380.80	-
1	FRONT L/H DOOR OUTER HANDLE	NOT NECESSARY	232.55	-
1	FRONT L/H DOOR INNER RUBBER	NOT NECESSARY	261.40	-
1	FRONT L/H DOOR GLASS GEAR	NOT NECESSARY	261.40	-
1	FRONT L/H DOOR FILM	NOT NECESSARY	120.00	-

Report Ref No. CS/AGI20004144/Atf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT L/H DOOR GLASS GEAR MOTOR	NOT NECESSARY	387.75	-
1	LH SIDE ROCKER PANEL	DENTED	550.00	550.00
1	FRONT LH DRIVE SHAFT	NOT NECESSARY	1,217.80	-
1	FRONT LH STABILIZER VALVE	NOT NECESSARY	220.00	-
1	FRONT STEERING RACK	BENT	2,200.00	1,885.00
1	FRONT SHOCK ABSORBER-LH	BENT	458.00	458.00
1	FRONT LOWER ARM-LH	BENT	425.30	425.30
1	FRONT KNUCKLE ARM-LH	DAMAGED	365.20	365.20
1	FRONT KNUCKLE ARM BEARING-LH	DAMAGED	182.50	182.50
1	FRONT SPORT RIM-LH	CUT	500.00	500.00
1	FRONT TYRE-LH	NOT NECESSARY	350.00	-
	LESS 25% DISCOUNT		-	-2,325.13
			19,991.85	6,975.37
	<u>SPECIAL NETT ITEMS</u>			
1	GUM (SN)	NECESSARY	50.00	30.00
			50.00	30.00
	<u>LABOUR</u>			
	TO REMOVE & RE-FIX SIDE GLASS.		120.00	40.00
	TO REMOVE & REFIX FRONT UNDERCARRIAGE.		400.00	320.00
	TO CHECK WHEEL ALIGNMENT COMPUTER.		150.00	80.00
	TO REMOVE & REFIX FRONT DOOR-LH FITTINGS.		200.00	80.00
	TUFF KOTE.		120.00	60.00
	TOWING CHARGES.		100.00	60.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT FENDER INNER PANEL-LH.		1,200.00	900.00
	SPRAY PAINTING.		1,200.00	900.00
	-		-	-
	-		-	-
	-		-	-
			3,490.00	2,440.00
GRAND TOTAL			23,531.85	9,445.37

Report Ref No. CS/AGI20004144/Atf3n2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,500.00
---	--	--	-----------------

Report Ref No. CS/AGI20004144/Atf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 6550C

INSPECTION

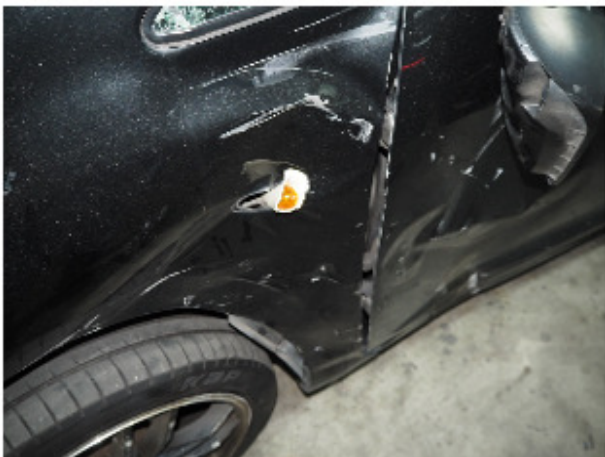



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

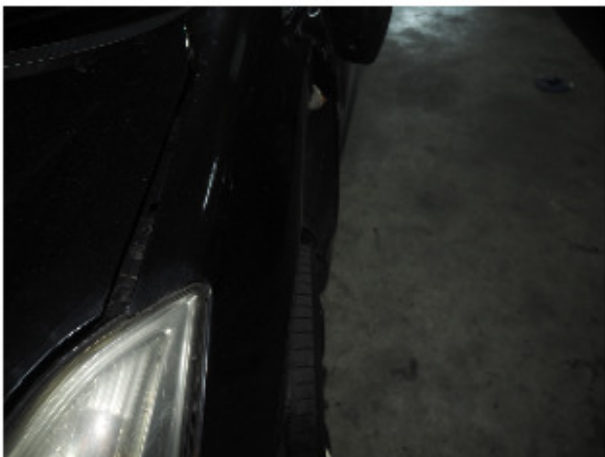



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 6550C

RE-INSPECTION

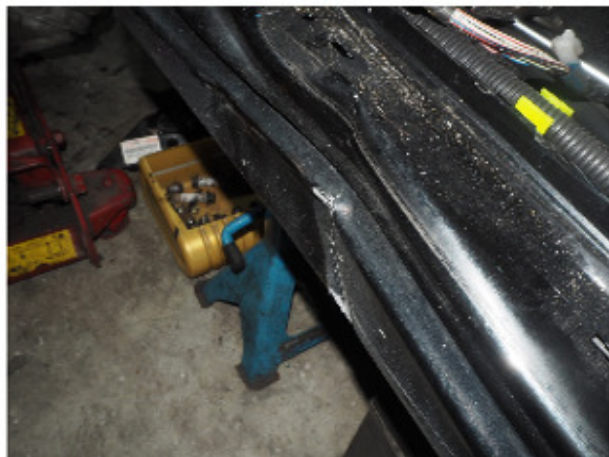



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

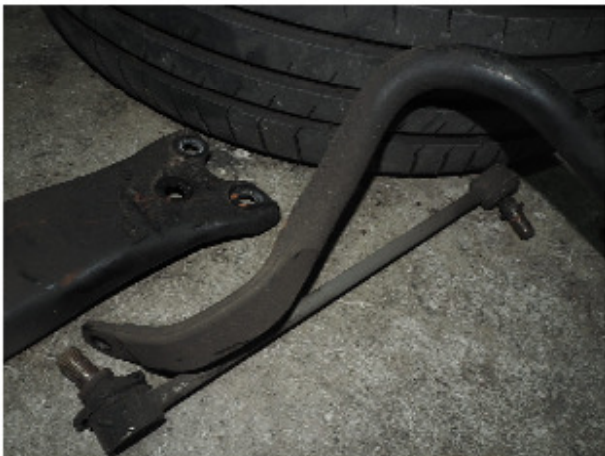



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

