

CL APPRAISER PTE LTD

24 Penshurst Place, Singapore 556440

Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783

Reg No: 201000228E

INVOICE

Liao Ping
C/o: Seng Yeow Motor Works
Blk 14 Defu Lane 10 #01-404
Singapore 539195

Invoice No: CL/191390

Ref No: SYM/11/1901/TP

Date: 20 November 2019

DESCRIPTION	AMOUNT
OUR SERVICE FEE CHARGES:	
• SURVEY INSPECTION FOR VEHICLE NO. <u>SJS 3518 K</u>	
• RESURVEY INSPECTION	
• DIGITAL PHOTOGRAPHS SERVICES (INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS)	
• TRANSPORTATION	
GRAND TOTAL	S\$ 586.00

E & O. E

All cheque payment should be "Crossed" and made payable to "CL APPRAISER PTE LTD"

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Penhurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Liao Ping
C/o: Seng Yeow Motor Works
Blk 14 Defu Lane 10 #01-404
Singapore 539195

Date : 20 November 2019
Our ref : SYM/11/1901/TP

Accident Date : 09 November 2019
Inspection Date : 11 November 2019
Repairer Name : Seng Yeow Motor Works
Blk 14 Defu Lane 10 #01-404
Singapore 539195

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : SJS 3518 K
Make / Model : Hyundai Avante
Chassis No : KMH DU41BR9U802913
Engine No : G4FC9U681082

Year / Capacity : 2009 / 1591 cc
Colour : Silver
Mileage : 124962

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	: Westlake	185/65 R15	5 mm	Sport
Front Offside	: Westlake	185/65 R15	5 mm	Sport
Rear Nearside	: Westlake	185/65 R15	5 mm	Sport
Rear Offside	: Westlake	185/65 R15	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the o/s rear portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 66 copies

REMARKS

This inspection was conducted entirely on a "**WITHOUT PREJUDICE**" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle
and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 6,700.00** on a contractual basis.

Under normal circumstances, the repair period would be about 7 (Seven) working days.

Vehicle Registration No: SJS 3518 K

Our Ref No: SYM/11/1901/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Rear windscreen moulding X (svc)	Necessary	\$ 89.60	\$ 89.60
1	Rear bumper ✓ BT	Damage	\$ 486.90	\$ 486.90 ✓
1	Rear bumper clip (1 set) ✓ m	Necessary	\$ 50.00	\$ 50.00 25 ✓
1	Rear bumper side retainer ✓ cm R/H	Necessary	\$ 44.80	\$ 44.80 ✓
1	Rear o/s fender X (R)	Damage	\$ 1,703.00	\$ 1,703.00
1	Rear o/s wheel hub c/w bearing ✓ cm	Damage	\$ 317.60	\$ 317.60 270.80 ✓
1	Rear o/s shock absorber X (svc)	Damage	\$ 286.50	\$ 286.50
1	Rear o/s knuckle arm	Damage	\$ 481.60	\$ 481.60
1	Rear o/s lower arm	Damage	\$ 315.00	\$ 315.00
1	Rear o/s stay arm } X (svc)	Damage	\$ 189.00	\$ 189.00
1	Rear o/s trailing arm	Damage	\$ 385.00	\$ 385.00
1	Rear o/s door X (R)	Damage	\$ 1,106.20	\$ 1,106.20
1	Rear o/s door outer handle ✓ scr	Damage	\$ 110.80	\$ 110.80 ✓
1	Rear o/s door weather strip ✓ m	Necessary	\$ 126.20	\$ 126.20 ✓
			\$ 5,692.20	\$ 5,692.20
Less 20%			\$ 1,138.44	\$ 1,138.44
Total Cost - List Items			\$ 4,553.76	\$ 4,553.76

SPECIAL NETT ITEMS

1	Rear windscreen sealant X (svc)	Necessary	\$ 80.00	\$ 50.00
1	Rear o/s tyre (Depreciation) X (svc)	Damage	\$ 400.00	\$ 200.00
1	Rear o/s wheel rim ✓ scr 15mm	Damage	\$ 750.00	\$ 750.00 280 ✓
Total Cost - Special Nett items			\$ 1,230.00	\$ 1,000.00

Total cost of parts

\$ 5,783.76 \$ 5,553.76

SCL APPRAISER PTE LTD

Vehicle Registration No: SJS 3518 K

Our Ref No: SYM/11/1901/TP

S/No	Description	Repairer's Estimate	Revised Amount
	Total cost of parts c/f	\$ 5,783.76	\$ 5,553.76

LABOUR

- | | | | |
|---|---|-------------|-------------------------------|
| 1 | To remove, refit, replaced damaged lamps and check up rear electrical wiring | \$ 80.00 | \$ 50.00 30V ✓ |
| 2 | To remove and refit inner garnishes, inner trim to assist repair. | \$ 150.00 | \$ 120.00 50V ✓ |
| 3 | To remove and refit rear undercarriage. <i>Per R/H</i> | \$ 350.00 | \$ 300.00 80V ✓ |
| 4 | To conduct wheel alignment. | \$ 150.00 | \$ 120.00 60V ✓ |
| 5 | To remove and refit rear windscreen glass. <i>X</i> | \$ 180.00 | \$ 120.00 |
| 6 | To remove and refit doors complete fittings and replace damaged parts, transfer all fittings to new door. <i>X</i>
<i>refer to No 8 labour</i> | \$ 150.00 | \$ 120.00 |
| 7 | To apply undercoating on repaired and replaced panel. | \$ 120.00 | \$ 90.00 40V ✓ |
| 8 | To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident. <i>+ Repair Per Door R/H, Per Fender R/H</i> | \$ 1,400.00 | \$ 1,000.00 700V ✓ |
| 9 | To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident. | \$ 1,200.00 | \$ 880.00 600V ✓ |

GRAND TOTAL

\$ 9,563.76	\$ 8,353.76
-------------	-------------

parts	1064.50
parts less	20%
	851.60
spec note	280
labour	1560
	2691.60
2/5 less	20%
	2153.28
total	\$ 2150.00

*paper survey marking
18/3/20 4.40pm
H. ANW (11/11/16)
Passenger after paint
without pre-finisher
2/5 less repair
4 days*

Vehicle Registration No: SJS 3518 K

Our Ref No: SYM/11/1901/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 6,700.00**


By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

CL APPRAISER PTE LTD

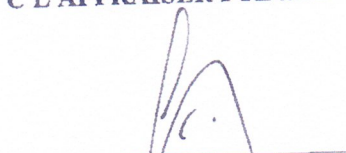

Cheong K. H.
Automotive Appraiser