

ASS. REC. BY:

REF:

CS/MSG 20004283/Dyd3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

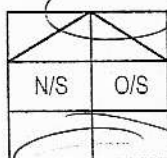Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 15 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SJW 4477S Regn: May, 2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Kia Cerato K3 c.c. 1591

Colour: Grey A/C: Insured / Std / NI / NA

Sp. Reading: 151775 T/Radio: Insured / Std / NI / NA

Eng/No: G4FGGH.641704

C/No: KNAFX 411MH5720676

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205 / 55 R16

R: ———

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Pirelli

Front Rear

R/Bal. S mm R/Bal. S mm

L/Bal. S mm L/Bal. S mm

D.O.A. 18/03/2020 D.O.I. 20/03/2020

Survey held at Alfred Auto AMK

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front y Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MSG SJW 6203M
11	MV 54K
	LTA 46.7K
	NL 7.3K
14/20	Sent Peli by Mennen
	19/2001 - (Red 1919640)
	07/04/2020 - To submit 1/5 192001 - with 42%
	15 days of rep.
	- To indicate Red in survey report.
	MV

Date/Time, File Pass to?

☐ : Prel. Report
☐ : Final Report

1)

Date/Time, File Return to?

2)

13/4/20 Typist

Report Format:

Lump Sum / LBI: (\$) \$19200/-

Days Of Repair: 15

Resurvey No. of Trip: 3

Add Fee:

☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Invs (\$)
☐ : Weekend (\$)

Survey Fee:

Transportation:

S + RS SI

Photos

Others

TOTAL



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim



Reference No.: 190320

Date: 19.03.2020

Tan Boon Ann

Blk 74 Whampoa Drive #10-322

Singapore 320074

KIA Cerato K3

Estimate Repair Cost for Vehicle Reg. No: SJW 4477 S

1 Pc. Front Bonnet <i>Deform</i>		952.00	✓
1 Pc. Front Bonnet Lock <i>NH</i>		49.00	X
2 Pcs. Front Bonnet Hinger <i>NH</i>	@ 37.00	74.00	X
10 Pcs. Front Bonnet Sponge Clips <i>NH</i>	@ 5.00	50.00	X
2 Pcs. Front Bonnet Stopper <i>NH</i>	@ 18.00	36.00	X
1 Pc. Front Fender <i>Deform o/s</i>		348.00	✓
1 Pc. Front Fender Dust Garnish <i>deformed / torn</i>		89.00	✓
10 Pcs. Front Fender Dust Garnish Clips <i>NH</i>	@ 5.00	50.00	✓ 20/- SN
2 Pcs. Front Head Lamp Assy. <i>o/s crack</i>	@ 1,807.00	3,614.00	✓ N/S many crack
2 Pcs. Front Head Lamp Bracket <i>o/s broken</i>	@ 40.00	80.00	LL
1 Pc. Front Bumper <i>Deform</i>		630.00	✓
1 Pc. Front Bumper KIA Logo <i>NH</i>		37.00	✓
2 Pcs. Front Bumper Side Retainer <i>o/s broken</i>	@ 40.00	80.00	LL
1 Pc. Front Bumper Sponge <i>turn</i>	N/S NH	196.00	✓
1 Pc. Front Bumper Reinforcement <i>Deform</i>		310.00	✓
2 Pcs. Front Bumper Bracket <i>NH</i>	@ 65.00	130.00	X
1 Pc. Front Bumper Top Rubber <i>NH</i>		57.00	X
1 Pc. Front Bumper Lower Grille <i>NH</i>		87.00	X
1 Pc. Front Bumper Fog Lamp Assy. <i>many crack o/s</i>		283.00	✓
1 Pc. Front Bumper Towing Cover <i>dislodged / broken</i>		14.00	✓
1 Pc. Front Bumper No. Plate Garnish <i>Deform</i>		39.00	✓
1 Pc. Front No. Plate & Box <i>bst</i>		50.00	✓ 45/- SN
10 Pcs. Front Bumper Clips <i>NH</i>	@ 6.00	60.00	✓ 30/- SN
1 Pc. Front Grille <i>crack</i>		385.00	✓
6 Pcs. Front Grille Clips <i>NH</i>	@ 6.00	36.00	✓ 15/- SN
1 Pc. Wiper Tank <i>deformed / crack</i>		198.00	✓
1 Pc. Front Support Panel <i>crack / Deform</i>		469.00	✓
1 Pc. Radiator <i>NH</i>		668.00	X
1 Pc. Radiator Coolant <i>NH</i>		60.00	X
1 Pc. Rear Boot <i>Buc</i>		1,388.00	✓
2 Pcs. Rear Boot Hinger <i>bst</i>	@ 74.00	148.00	✓




ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim

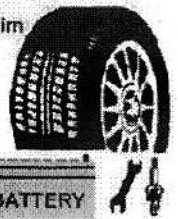

1 Pc. Rear Boot KIA Logo <i>Hec</i>		37.00	✓
1 Pc. Rear Boot Cerato K3 Emblem <i>Hec</i>		34.00	✓
1 Pc. Rear C&C Logo <i>Hec</i>		16.00	✓
2 Pcs. Rear Boot Lamp <i>CRACK</i>	@ 580.00	1,160.00	✓
2 Pcs. Rear Boot No. Plate Lamp <i>Hec</i>	@ 38.00	76.00	X
1 Pc. Rear Boot Reverse Cam <i>Hec</i>		297.00	X
2 Pcs Rear Boot Stopper <i>Hec</i> o/s <i>H/S</i> dislodge	@ 12.00	24.00	X ✓
1 Pc. Rear Boot Lock <i>Hec</i>		149.00	✓
1Pc. Rear Boot Opener Switch <i>Hec</i>		69.00	X
1 Pc. Rear Boot Handle <i>Hec</i>		38.00	X
1 Pc. Rear Boot inner Garnish <i>Hec</i>		221.00	✓
12 Pcs. Rear Boot Inner Garnish Clips <i>Hec</i>	@ 5.00	60.00	20/- SW
2 Pcs. Rear Lamp <i>CRACK</i> <i>Ministry CRACK</i>	@ 639.00	1,278.00	✓
2 Pcs. Rear Lamp Panel <i>Dented</i>	@ 210.00	420.00	✓
1 Pc. Rear Weather Slip <i>deformed</i>		105.00	✓
1 Pc. Rear Support Panel <i>Hec</i> <i>End Panel</i>		347.00	✓
1 Pc. Rear Support Panel Garnish <i>Hec</i>		58.00	✓
1 Pc. Rear Support Panel Lock Catch <i>Hec</i>		28.00	✓
1 Pc. Rear Spare Tank Floor Panel <i>Hec</i>		714.00	✓
1 Pc. Rear Spare Tank Tools Sponge <i>Hec</i>		290.00	X
1 Pc. Rear Spare Tank Insulator <i>Hec</i>		280.00	✓ 80/- SW
1 Pc. Rear Spare Tank Dust Garnish <i>Hec</i>		49.00	X
6 Pcs. Rear Spare Tank Dust Garnish Clips <i>Hec</i>	@ 5.00	30.00	X
1 Pc. Rear Spare Tyre Cover <i>SW</i>		280.00	X
1 Pc. Windscreen Moulding <i>Hec</i>		45.00	✓
1 Pc. Windscreen Seal <i>Hec</i>		28.00	✓
1 Pc. Windscreen Sealant <i>Hec</i>		120.00	40/- SW
2 Pcs. Rear Fender <i>Dented</i>	@ 1,224.00	2,448.00	✓
2 Pcs. Rear Fender Lower Dust Garnish <i>Hec</i>	@ 205.00	410.00	X
10 Pcs. Rear Fender Dust Garnish Clips <i>Hec</i>	@ 5.00	50.00	X
2 Pcs. Rear Fender Inner Garnish Trim <i>Hec</i>	@ 181.00	362.00	✓
20 Pcs. Rear Fender Inner Garnish Clips <i>Hec</i>	@ 5.00	100.00	30/- SW
1 Pc. Rear Fender Air Duct (RH) <i>deformed</i>		128.00	✓
1 Pc. Rear Bumper <i>Dented</i>		737.00	✓
1Pc. Rear Bumper Sponge <i>turn</i>		299.00	✓
1 Pc. Rear Bumper Reinforcement <i>broken</i>		346.00	✓ 64.00
4 Pcs. Rear Bumper Lower Bracket <i>Hec</i> <i>H/S</i> <i>Hec</i>	@ 32.00	128.00	✓ o/s 2 pc
1 Set Rear Bumper Parking Sensor <i>D-m</i>		380.00	220/- SW
1 Pc. Rear Bumper Spoiler <i>turn</i>		1,050.00	✓
2 Pcs. Rear Bumper Reflector <i>o/s CRACK</i> <i>H/S</i> <i>SW</i>	@ 132.00	264.00	✓
10 Pcs. Rear Bumper Clips <i>Hec</i>	@ 5.00	50.00	30/- SW



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
 Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
 Email: alfredauto@hotmail.com

Tyre &
Sports Rim



1 Pc. Rear Exhaust	✓	591.00	✓
4 Pcs. Rear Exhaust Mounting	✓	@ 24.00	96.00 X
1 Pc. Rear Exhaust Centre Pipe	✓	661.00	✓
1 Pc. Rear Exhaust Aluminum Heat Shield	✓	141.00	✓
1 Set Rear Tough Coat Shield	✓	400.00	X
1 Pc. Rear No. Plate & Box	✓	50.00	45/- SN
2 Pcs. Rear Big Bracket	✓	@ 98.00	196.00 ✓

1589.00

Total (Panels / Parts): 25,807.00 (SGD)

1st 10% discount.

LABOR CHARGES

To check wiring, remove & refit & check SRS, ABS, Sensor, head lamp sensor, room, tail lamp & resetting & erase fault code.	480.00	60/-	120/-
To remove & refit radiator, air-con condenser & top-up Air-con & gas.	200.00	120/-	
To remove & refit windscreen. ✓	180.00	120/-	
To remove & refit interior garnish, carpet, cushion, & All accident affected area. ✓	280.00	120/-	
To remove & refit exhaust pipe, box & all affected area.	220.00	80/-	100/-
To remove & refit fuel tank.	250.00	✓	
To remove & refit rear undercarriage & affected damage Area.	400.00	✓	
To check & adjust computer wheel alignment.	180.00	✓	
To welding, knocking, straightening repair & renew all Accident damaged affected area.	2,200.00	1800/-	
To respray painting on all accident affected area. (Front/Rear) (Pearl)	2,400.00	1600/-	




ALFRED AUTO

Services & Supplies

Bik 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim

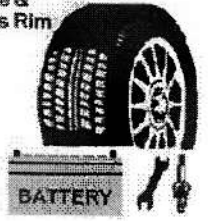

To rust proof all accident affected area.

250.00 80/-

Total (Labor Charges): **7,040.00 (SGD)**

TOTAL COST SUMMARY

PANELS / PARTS	25,807.00
LABOR CHARGES	7,040.00

Lchw	SH	Grand Total:	32,847.00 (SGD)
4060.00	575.00	Parts List	Total 23642.10
		21119.00	Supp 451.46
		102 19007.10	<u>24093.56</u>

We shall be glad if you can forward the payment at your early convenience. L/S 19200/-

Cheque should be crossed and make payable to 'Alfred Auto Services and Supplies'

ALFRED AUTO SERVICES & SUPPLIES

20/03/2020 @ 1600hrs.

NA Antenna

L/Sure 15 days.

yan

LKK Andu

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Supplementary Repair Cost for Vehicle Reg No: SJW44778

lpe Front Top Over Bumper Top Cover Base	✓	109.00
4pc Front Bumper Top Base. Clips	5.00 ✓	20.00 SH
lpe Front Bumper lower Beam.	x svc	165.30
lpe Front Radiator RH Side Garnish	✓ turn	105.00
lpe Front RH Feeder Inner Cover	✓ turn	99.30

List

~~480.00~~

479.40

(57. 431.46



total

57 20.00

Total 451.46