



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2100189

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 12/01/2021
Reference CC6/FCI20004468/Upa3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJF 6335U
Insured Veh. SHA 528U
Claim No. D20001638MFSH
Policy No. D-18088937MFSH
Accident Date 23/03/2020
Inspection Date 25/03/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC6/FCI20004468/Upa3q2	
			Date: 12/01/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHA 528U	Veh. Inspected	SJF 6335U
	Policy No.	D-18088937MFSH	Coverage (\$)	0.00
	Claim No.	D20001638MFSH	Excess (\$)	0.00
	Assign From	ERIC	Assign Date	25/03/2020
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA COROLLA ALTIS (A)	c.c	1598
	Engine No.	HIDDEN	Year of Reg.	2008
	Chassis No.	MR053ZEE106109597	Colour	GREY
	Odometer	230408 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	MICHELIN	6 mm
	L/H Front Tyre	195/65 R15	MICHELIN	6 mm
	R/H Rear Tyre	195/65 R15	MICHELIN	6 mm
	L/H Rear Tyre	195/65 R15	MICHELIN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	23/03/2020	Inspection Date	25/03/2020
	Survey held at	T K LEE AUTOMOTIVE PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-47 AUTOBAY SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJF 6335U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT	BENT / BUCKLED	681.10	681.10
2	REAR BOOT HINGE LH /RH @\$65.90	NOT NECESSARY	131.80	-
1	REAR BOOT RUBBER	TWISTED	169.45	169.45
1	REAR BOOT LOCK	TWISTED	155.20	155.20
1	REAR BOOT LOCK CATCH	NOT NECESSARY	45.10	-
1	REAR BOOT EMBLEM LOGO	NECESSARY	65.30	65.30
1	REAR BOOT EMBLEM '1.6'	NECESSARY	45.20	45.20
1	REAR BOOT EMBLEM 'COROLLA'	NECESSARY	76.10	76.10
1	REAR BOOT EMBLEM 'ALTIS'	NECESSARY	65.90	65.90
2	REAR BOOT REFLECTOR 'RH/LH' @\$225.80	NOT NECESSARY	451.60	-
2	REAR BOOT TAILLAMP LH/RH @\$390.70	O/S CRACKED	781.40	390.70
1	REAR BUMPER	DISTORTED / TORN	517.10	517.10
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	83.10	-
2	REAR BUMPER HOLDER RH/LH @\$55.60	NOT NECESSARY	111.20	-
1	REAR BUMPER FOAM	TORN	182.20	182.20
2	REAR BUMPER BRACKET RH/LH @\$167.40	O/S DENTED	167.40	83.70
2	REAR BUMPER SIDE HOLDER RH/LH @\$130.40	NOT NECESSARY	130.40	-
2	REAR BUMPER SIDE RETAINER RH/LH	NOT NECESSARY	155.00	-
1	REAR EXHAUST BOX	NOT NECESSARY	606.40	-
2	REAR EXHAUST MOUNTING @\$48.60	NOT NECESSARY	97.20	-
1	REAR END PANEL	BADLY DENTED	581.40	581.40
1	REAR END PANEL GARNISH	TWISTED	239.40	239.40
1	REAR SPARE TYRE PANEL CARDBOARD	TORN	202.60	202.60
	LESS 25% DISCOUNT		-1,435.39	-863.84
			4,306.16	2,591.51
	<u>SPECIAL NETT ITEMS</u>			
1	REAR INNER TRIM CLIPS (SN)	NOT NECESSARY	45.00	-
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR BUMPER CLIPS (SN)	NECESSARY	35.00	35.00
			360.00	235.00

Report Ref No. CC6/FCI20004468/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO KNOCK OUT DENT ,CUT/WELD REAR PANEL & REPLACE ACCIDENT PART.		900.00	600.00
	TO SPRAY PAINTING ON ACCIDENT PORTION .		1,100.00	800.00
	TO CHECK WIRING .		30.00	30.00
	TO REMOVE,REFIX CUSHION AND INNER TRIM .		120.00	80.00
	TO REFIX REVERSE CAMERA AND REPLACE REVERSE SENSOR .		150.00	50.00
	TO REMOVE ,REPLACE EXHAUST BOX .	NOT NECESSARY	120.00	-
	TO TUFF KOTE.		90.00	60.00
			2,510.00	1,620.00
	GRAND TOTAL		7,176.16	4,446.51
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,550.00

Report Ref No. CC6/FCI20004468/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJF 6335U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

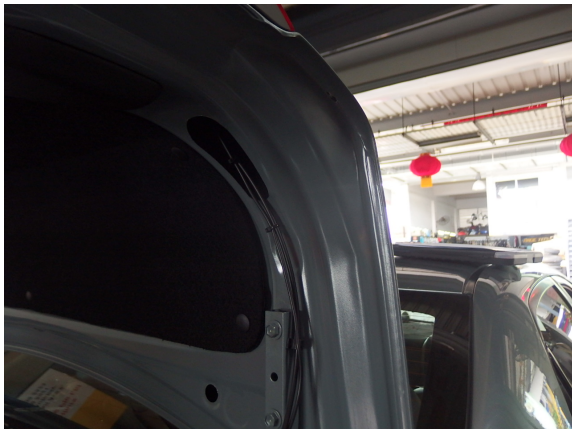




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

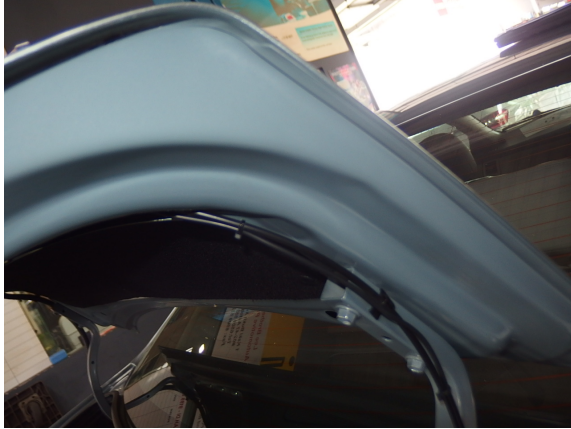




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

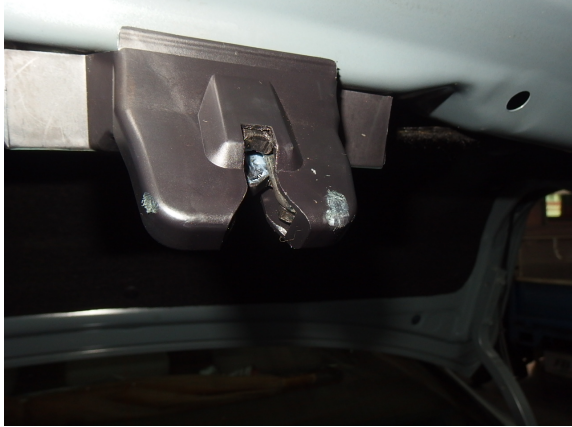



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

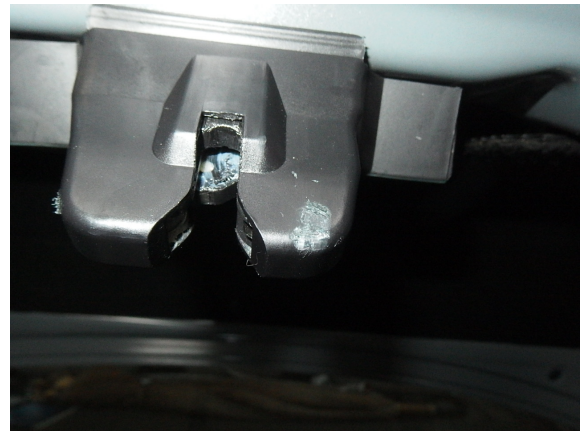



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

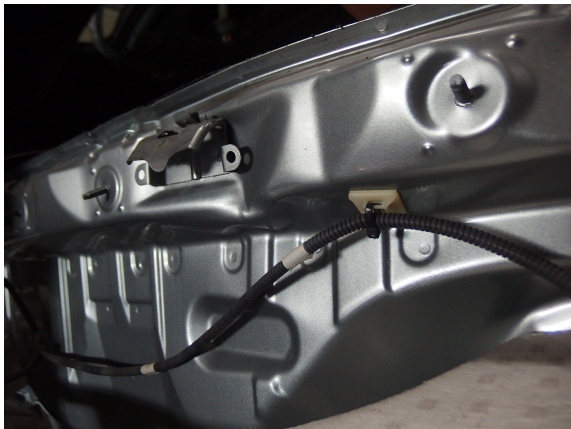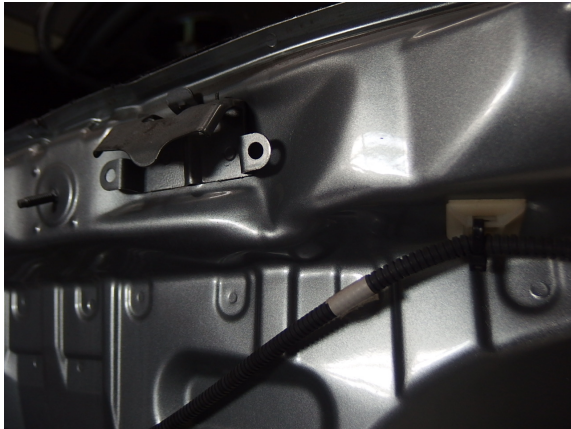




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

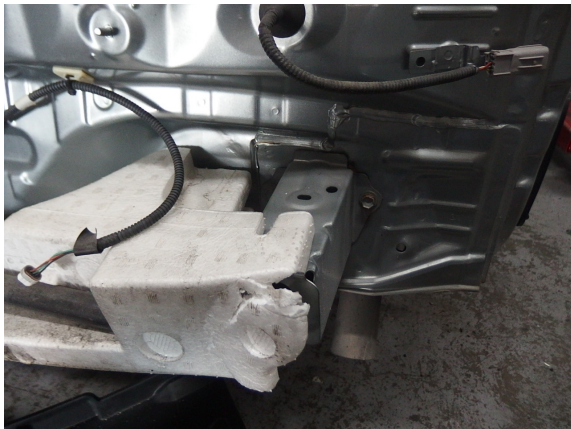




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

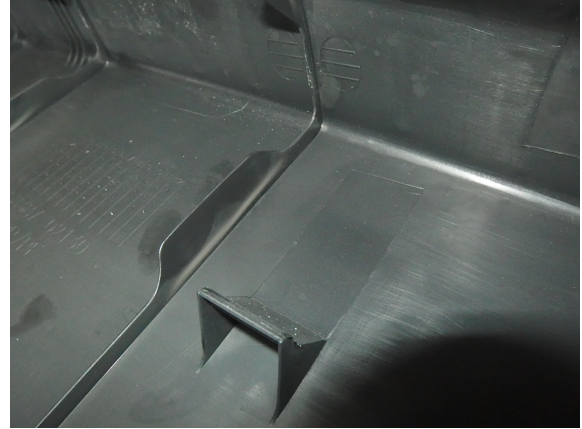



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJF 6335U

RE-INSPECTION

