



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2101525

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 10/03/2021
Reference CC4/FCI20004482/Aea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKC 3293E
Insured Veh. SHC 7711A
Claim No. D20001590MFSH
Policy No. D-20094921MFSH
Accident Date 19/03/2020
Inspection Date 25/03/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20004482/Aea3q2	
			Date: 10/03/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHC 7711A	Veh. Inspected	SKC 3293E
	Policy No.	D-20094921MFSH	Coverage (\$)	0.00
	Claim No.	D20001590MFSH	Excess (\$)	0.00
	Assign From	MERINA CHIA	Assign Date	25/03/2020
2. Vehicle Particulars & Condition				
	Make & Model	VOLKSWAGEN JETTA	c.c	1390
	Engine No.	HIDDEN	Year of Reg.	2011
	Chassis No.	WWWZZZ16ZBM103008	Colour	BLACK
	Odometer	176516 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/40 R18	KAPSEN	6 mm
	L/H Front Tyre	225/40 R18	KAPSEN	6 mm
	R/H Rear Tyre	225/40 R18	KAPSEN	6 mm
	L/H Rear Tyre	225/40 R18	KAPSEN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	19/03/2020	Inspection Date	25/03/2020
	Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKC 3293E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT DOOR RH	DENTED	1,485.20	1,236.00
1	FRONT DOOR INNERTRIM RH	NOT NECESSARY	642.30	-
1	FRONT DOOR INNERLOCK RH	DAMAGED	342.60	342.60
1	FRONT DOOR CATCH RH	NOT NECESSARY	54.60	-
1	FRONT DOOR SPEAKER RH	NOT NECESSARY	198.60	-
2	FRONT DOOR HINGE RH @\$95.60	NOT NECESSARY	191.20	-
1	FRONT DOOR CHECKER RH	NOT NECESSARY	96.30	-
1	FRONT DOOR WEATHERSTRIP FRAME RH	NOT NECESSARY	168.50	-
1	FRONT DOOR WEATHERSTRIP DOOR RH	NECESSARY	245.60	245.60
1	FRONT DOOR OUTER MOULDING RH	NOT NECESSARY	152.30	-
1	FRONT DOOR OUTER HANDLE RH	NOT NECESSARY	145.20	-
1	FRONT DOOR HANDLE COVER RH	NOT NECESSARY	54.60	-
1	FRONT RIM RH	NOT NECESSARY	897.60	-
1	REAR DOOR RH	DISTORTED	1,562.30	1,371.00
1	REAR DOOR SPEAKER RH	NOT NECESSARY	180.00	-
1	REAR DOOR INNER TRIM RH	NOT NECESSARY	623.50	-
1	REAR DOOR WEATHERSTRIP (DOOR)RH	NECESSARY	168.50	168.50
1	REAR DOOR WEATHERSTRIP (FRAME) RH	NOT NECESSARY	245.60	-
1	REAR DOOR INNER LOCK RH	NOT NECESSARY	375.60	-
1	REAR DOOR CATCH RH	NOT NECESSARY	56.30	-
2	REAR DOOR HINGE RH @\$86.30	NOT NECESSARY	172.60	-
1	REAR DOOR CHECKER RH	NOT NECESSARY	89.70	-
1	SIDE CENTRE PILLAR RH	TO REPAIR SEE LABOUR	895.20	-
1	REAR DOOR OUTER MOULDING RH	NOT NECESSARY	154.20	-
1	REAR DOOR OUTER HANDLE RH	NOT NECESSARY	125.30	-
1	REAR DOOR OUTER HANDLE COVER RH	NOT NECESSARY	54.20	-
1	SIDE ROCKER PANEL RH	TO REPAIR SEE LABOUR	985.60	-
1	REAR BUMPER	TORN	1,392.50	1,147.00
1	REAR BUMPER SIDE RETAINER RH	NOT NECESSARY	105.20	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER ATTACHMENT RETAINER R	NOT NECESSARY	105.60	-
1	REAR FENDER RH	TO REPAIR SEE LABOUR	1,759.30	-
1	REAR FENDER INNER SHIELD RH	NOT NECESSARY	178.60	-
1	REAR UPPER ARM RH	NOT NECESSARY	305.80	-
1	REAR LOWER ARM RH	NOT NECESSARY	480.50	-
1	REAR CONTROL ARM RH	NOT NECESSARY	437.80	-
1	REAR KNUCKLE ARM RH	NOT NECESSARY	818.10	-
1	REAR WHEEL HUB BEARING RH	NOT NECESSARY	425.60	-
1	REAR ABSORBER RH	NOT NECESSARY	548.90	-
1	REAR WHEEL SPEED SENSOR RH	NOT NECESSARY	195.80	-
	LESS 10% DISCOUNT		-1,711.69	-451.07
			15,405.21	4,059.63
1	REAR RIM RH (SN)	CUT	870.60	400.00
	LESS 10% DISCOUNT		-87.06	-
			783.54	400.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	REAR TYRE RH (SN)	TORN	250.00	200.00
1	SET REAR FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR DOOR INNER TRIM CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET FRONT DOOR INNER TRIM CLIPS (SN)	NOT NECESSARY	30.00	-
			470.00	230.00
	<u>LABOUR</u>			
	TO RENEW DAMAGED PARTS ,REPLACE BEAT ,WELD ,REALIGN AND ALIGNE ALL .INCLUSIVE OF THE REPAIR OF SIDE CENTRE PILLAR RH ,SIDE ROCKER PANEL RH AND REAR FENDER RH .		1,800.00	1,000.00
	TO RESPRAY AFFECTED AREAS.		1,800.00	1,000.00
	TO TUFFCOAT AFFECTED AREA.		200.00	60.00
	TO REMOVE/REFIT INTERIOR UPHOLSTERY .		150.00	60.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY SEALANT TO THE AFFECTED AREAS.	NOT NECESSARY	150.00	-
	TO CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	150.00	-
	TO REMOVE/REPLACE/REFIT REAR UNDERCARRIAGE.	NOT NECESSARY	180.00	-
	TO REMOVE /REFIT REAR WINDSCREEN .	NOT NECESSARY	120.00	-
	TO PERFORM COMPUTERISED WHEEL ALIGNMENT (BEFORE & AFTER).		160.00	80.00
	TO REMOVE/REPLACE TRANSFER FRONT DOOR MECHANISM .		150.00	80.00
	TO REMOVE /REPLACE TRANSFER REAR DOOR MECHANISM .		150.00	80.00
			5,010.00	2,360.00
GRAND TOTAL			21,668.75	7,049.63
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,000.00

Report Ref No. CC4/FCI20004482/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKC 3293E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

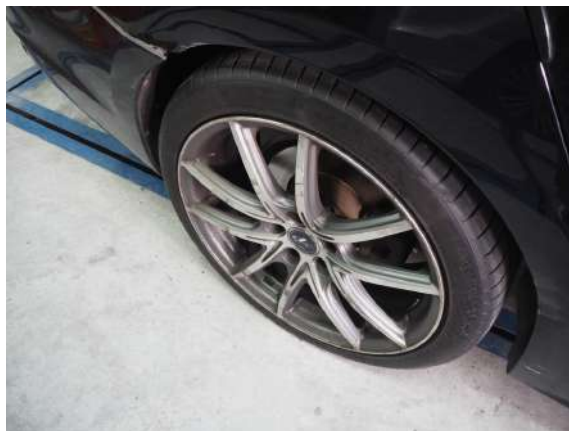




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

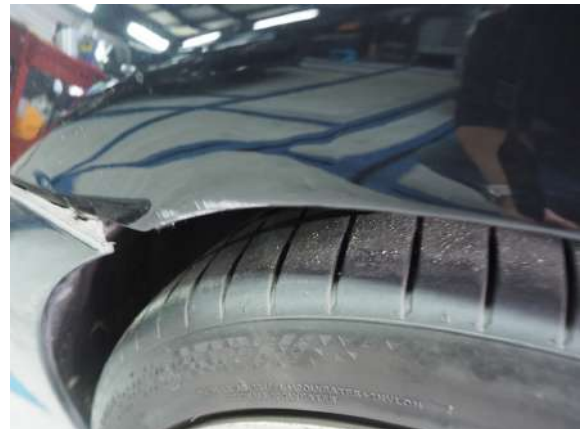



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

