


S K AUTO CONSULTANTS

Page No. 2

Our Reference TP/019/03785K
Vehicle No. SJB 8433C

4. DESCRIPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the Rear portion

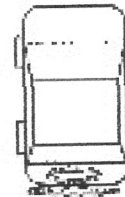

Please see attached schedule for details.

Estimated Amount : S\$10,042.58
Adjusted Amount : S\$6,300/-
Estimated Repair Days : 5 days

Pursuant to your instruction, we have NOT AUTHORIZED repair.
The assessment was conducted on a "Without Prejudice" basis.

If we are not notified of anything to the contrary within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by S K AUTO CONSULTANTS for any reliance on this report by any third party.

S K AUTO CONSULTANTS

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/019/037856
Your Reference: TDA

Date: 9/12/2019

TO: Lim Joon Lek Nicklaus
c/o Automedic Holdings
25 Kaki Bukit Road 4
#05-84 Synergy @ KB
Singapore 417800

Assessment of Vehicle No : SJB 8433C
Date of Accident : 25/11/2019
Date of Inspection : 29/11/2019

We have carried out a physical assessment of SJB 8433C at Automedic Holdings according to your instructions on 29/11/2019 and are pleased to submit our report as follows;

1. VEHICLE PARTICULARS

Registration No.	:	SJB 8433C
Make & Model	:	Toyota Rush
Year of Registration	:	2008 (COE expiry 2023)
Engine Capacity (cc)	:	1495
Chassis No.	:	J200E0016640
Engine No.	:	35Z1916308
Colour	:	Black
Mileage (km)	:	122403

2. VEHICLE CONDITION

Body Paint	:	Good
Steering	:	Serviceable
Foot Brakes	:	Serviceable
Parking Brake	:	Serviceable

3. TYRE PARTICULARS & CONDITION

Front		
RH Make/Size	:	Falken 225/50R17 - 50%
LH Make/Size	:	Falken 225/50R17 - 50%

Rear		
RH Make/Size	:	Falken 225/50R17 - 50%
LH Make/Size	:	Falken 225/50R17 - 50%

Note: % denotes the remaining percentage of the tyre

S K AUTO CONSULTANTS

Page No. 3

Our Reference TP/013/037856
Vehicle No. SJB 8423C

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)	OUR ASSESSMENT(\$\$)
PARTS (LIST ITEMS)				
1	Rear Tailgate (Back door) ✓ BT	Deep Dent	1980.00	1980.00 1250.80 ✓
1	Rear Tailgate inner lock * ✓ Jm	Damaged	382.00	382.00 191.80 ✓
1	Rear Tailgate inner lock catch X (R)	Bent	124.00	124.00
2	Rear Tailgate hinges @98.20 X (SVC)	Bent	196.40	196.40
1	Rear Tailgate inner trimboard X (SVC)	Deformed	429.50	429.50
1	Rear Tailgate Rush emblem ✓ ne	Necessary	72.00	72.00 72 ✓
1	Rear Tailgate top spoiler X (SVC)	Refix	980.00	0.00
1	Rear bumper ✓ DD	Deformed	1428.00	1428.00 830.60 ✓
2	Rear bumper reflector X (SVC)	Reuse	98.00	0.00
1	Rear spare tyre outer cover ✓ CRA	Cracked	1420.00	1420.00 1030.80 ✓
1	Rear spare tyre inner cover ✓ CRA	Dented	782.00	782.00 435.10 ✓
1	Rear spare tyre bracket (holder) ✓ BT	Bent	485.00	485.00 350.30 ✓
*Identified that when tailgate was in closed motion lock was not well secured (noise)		less 25%	8376.90	7298.50
			2094.22	1824.72
			6282.68	5474.18
SPECIAL NETT ITEMS				
1SET	Rear Tailgate inner trimboard clips ✓ ne	Necessary	60.00	48.00 25 ✓
1	Rear windscreen sealant ✓ ne	Necessary	100.00	88.00 40 ✓
1	Reverse Camera X (SVC)	Refix	480.00	0.00
1	Rear spare tyre X (SVC)	Reuse	250.00	0.00
1	Reverse sensor ✓ shunt	Damaged	280.00	250.00 200 ✓
TOTAL PARTS			7452.68	5844.18

S K AUTO CONSULTANTS

Page No. 4


Our Reference IP/019/0378SK
Vehicle No. SJB 8433C

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
1	LABOUR To remove the affected parts & fittings to commence repairs; replace damaged parts and components ✓	1200.00	1000.00 600 ✓
2	To supply paint materials, expandable items & putty, respray paint on parts replaced & repaired + End panel ✓	800.00	600.00 500 ✓
3	To remove and refix rear windscreen ✓	140.00	120.00 100 ✓
4	To remove and refix Tailgate top spoiler X refer to labour NOT included	150.00	120.00
5	To remove and replace reverse sensor and refix reverse camera and check for proper function ✓	150.00	100.00 20 ✓
6	To perform anti-rust treatment on affected areas ✓	150.00	120.00 30 ✓
Labour Total:		2590.00	2060.00
TOTAL (PARTS & LABOUR):		10042.68	7904.18

Note: (For Lump Sum Repair)

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or the use of ex stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements.

The final adjusted Lump Sum contract amount is S\$6,300/-

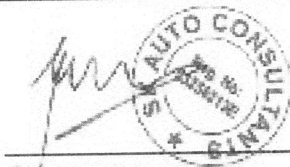

S. Kumanan
Motor Surveyor

parts 4161.40
parts less 25%
3121.05
spr nett 265
labour 1250

4,636.05
45 less 20%
3468.84
total
L/S 3,700.00

L/S repair without provision
resurvey after part
4 day
paper survey marking
1/4/20 5.00pm
H. ANN (HKL)

→
stamp
here