



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL  
(BUDGET DIRECT INSURANCE)  
190 CLEMENCEAU AVENUE #03-01  
SINGAPORE SHOPPING CENTRE  
SINGAPORE 239924

INV No. AC2003722  
INV Date 08/05/2020  
Reference CS/AGI20005001/Aqf3n2  
Code AGI



### PROFESSIONAL SERVICE FEE

Vehicle No. SJS 4492T

Insured Veh. SJP 4163J

Claim No. C10006108

Policy No.

Accident Date 04/04/2020

Inspection Date 07/04/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>450.00</b>
<b>GST (7%)</b>	<b>31.50</b>
<b>Grand Total</b>	<b>481.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

*HYN*




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTO & GENERAL INSURANCE (S) PL		Ref : CS/AGI20005001/Aqf3n2		
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date : 08-05-2020		
Code : AGI				
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SJP 4163J	Veh. Inspected	SJS 4492T	
Policy No.		Coverage (\$)	0.00	
Claim No.	C10006108	Excess (\$)	0.00	
Assign From	IVY RATILLA	Assign Date	07/04/2020	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	HONDA ODYSSEY	c.c	2354	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	JHMRB38309C201041	Colour	BLACK	
Odometer	129297	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	DUNLOP	6 mm	
L/H Front Tyre	215/60 R16	DUNLOP	6 mm	
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	04/04/2020	Inspection Date	07/04/2020	
Survey held at	SK AUTOMOBILE PTE LTD 23 KAKI BUKIT AVE 4 # 03-01 SINGAPORE 415933			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>11 Working Days</b>		



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJS 4492T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	BONNET	TO REPAIR SEE LABOUR	845.00	-
1	CENTER GRILLE	CRACKED	540.00	210.00
1	CENTER GRILLE LOGO	NECESSARY	69.00	38.00
1	CENTER GRILLE LOWER CHROME MOULDING	CUT	489.00	225.00
1	FRONT BUMPER	DEFORMED	932.00	785.00
1	FRONT BUMPER UNDER COVER	NOT NECESSARY	145.00	-
1	FRONT BUMPER REINFORCEMENT	DENTED	471.00	233.00
1	FRONT BUMPER LOWER GRILLE	CRACKED	224.00	85.00
2	FRONT BUMPER SIDE RETAINER @\$58.00	NECESSARY	116.00	78.00
2	FRONT BUMPER FOG LAMP @\$350.00	NOT NECESSARY	700.00	-
2	FRONT FENDER COWLING @\$125.00	NOT NECESSARY	250.00	-
2	HEAD LAMP @\$1025.00	N/S CRACKED / O/S CUT	2,050.00	1,468.00
2	HEAD LAMP LOWER BRACKET @\$68.00	CRACKED	136.00	76.00
2	HORN @\$112.00	CRACKED	224.00	90.00
1	AIRCON CONDENSOR	NOT NECESSARY	1,102.00	-
1	RADIATOR	NOT NECESSARY	1,217.50	-
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	746.50	-
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	186.00	-
1	TAILGATE	DENTED	1,899.00	991.00
1	TAILGATE OUTER GARNISH	DEFORMED	698.00	438.00
1	TAILGATE LOGO	NECESSARY	65.00	65.00
2	TAILGATE REFLECTOR @\$589.00	N/S CUT	1,178.00	375.00
2	TAILGATE DAMPER @\$154.00	NOT NECESSARY	308.00	-
1	TAILGATE INNER LOCK	DAMAGED	421.00	125.00
1	TAILGATE LOWER LOCK	NOT NECESSARY	51.00	-
1	TAILGATE WEATHER STRIP	CUT	254.00	254.00
2	TAILGATE STOPPER @\$24.00	NOT NECESSARY	48.00	-
1	TAILGATE INNER HANDLE	NOT NECESSARY	89.00	-
1	TAILGATE INNER BOARD	CRACKED	621.00	345.00

Report Ref No. CS/AGI20005001/Aqf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	TAILGATE INNER SIDE GARNISH @\$98.00	NOT NECESSARY	196.00	-
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	154.00	154.00
2	TAILLAMP @\$746.00	NOT NECESSARY	1,492.00	-
1	REAR BUMPER	DISTORTED	995.00	796.00
2	REAR BUMPER REFLECTOR @\$112.00	CRACKED	224.00	224.00
2	REAR BUMPER SIDE RETAINER @\$54.00	NECESSARY	108.00	72.00
1	REAR BUMPER REINFORCEMENT	BENT	354.00	197.00
2	REAR FENDER INNER TRIM @\$896.00	CRACKED	1,792.00	1,139.00
1	REAR END PANEL	DENTED	754.00	496.00
1	REAR END PANEL TOP GARNISH	DEFORMED	210.00	210.00
1	REAR END PANEL TOOLS GARNISH	NOT NECESSARY	89.00	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	884.00	-
1	REAR FLOOR MAT	NOT NECESSARY	354.00	-
1	REAR EXHAUST PIPE	NOT NECESSARY	1,345.00	-
	LESS 20% DISCOUNT		-5,005.20	-1,833.80
			20,020.80	7,335.20
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT NUMBER PLATE (SN)	DENTED	50.00	50.00
10	FRONT BUMPER CLIP @\$6.50 (SN)	NECESSARY	65.00	30.00
8	CENTER GRILLE CLIP @\$5.50 (SN)	NECESSARY	44.00	20.00
10	REAR BUMPER CLIPS @\$6.50 (SN)	NECESSARY	65.00	30.00
8	REAR FENDER TOP TRIM (INNER) CLIP @\$6.50 (SN)	NOT NECESSARY	52.00	-
10	REAR FENDER INNER TRIM CLIPS @\$6.50 (SN)	NECESSARY	65.00	65.00
4	REAR END PANEL TOP GARNISH CLIPS @\$8.50 (SN)	NECESSARY	34.00	10.00
1	TAIL GATE SEALANT (SN)	NOT NECESSARY	80.00	-
6	TAIL GATE OUTER GARNISH CLIP @\$6.50 (SN)	NECESSARY	39.00	20.00
10	TAIL GATE INNER BOARD CLIP @\$6.50 (SN)	NECESSARY	65.00	30.00
8	TAIL GATE INNER SIDE GARNISH CLIP @\$6.50 (SN)	NOT NECESSARY	52.00	-
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	60.00	40.00
4	TAILLAMP CLIP @\$8.50 (SN)	NOT NECESSARY	34.00	-
6	REAR END PANEL TOP GARNISH CLIPS @\$6.50 (SN)	REPEATED	39.00	-

Report Ref No. CS/AGI20005001/Aqf3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	REAR FLOOR PANEL INSULATOR SEAL (SN)	NOT NECESSARY	250.00	-
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
1	RADIATOR COOLANT (SN)	NOT NECESSARY	50.00	-
			1,494.00	595.00
	<b><u>LABOUR</u></b>			
	PANEL BEATING, REMOVING AND REPLACING PARTS. INCLUSIVE OF THE REPAIR OF BONNET AND FRONT SUPPORT PANEL.		800.00	400.00
	SPRAY PAINTING TO AFFECTED AREA.		800.00	400.00
	WIRING CHECK.		80.00	30.00
	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS.	NOT NECESSARY	120.00	-
	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST.	NOT NECESSARY	80.00	-
	TO PANEL BEAT, REMOVE AND REPLACE PARTS. INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL.		1,600.00	1,000.00
	TO SPRAY PAINT AFFECTED AREA.		1,400.00	900.00
	TUFF COAT.		250.00	80.00
	WIRING AND BULB CHECK.		180.00	30.00
	REMOVE AND REFIX CUSHION SEAT/UPHOLSTRY & ROOF LINING TO FACILITATE REPAIR.		450.00	80.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		120.00	50.00
	TRANSFER TAILGATE MECHANISM.		80.00	80.00
	REMOVE AND REFIX TAILGATE WINDSCREEN.		120.00	120.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE.	NOT NECESSARY	180.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	380.00	-
			6,760.00	3,170.00
<b>GRAND TOTAL</b>			<b>28,274.80</b>	<b>11,100.20</b>

Report Ref No. CS/AGI20005001/Aqf3n2



<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>8,800.00</b>
---	--	--	-----------------

Report Ref No. CS/AGI20005001/Aqf3n2

**ADRIAN LING WAI PING**

**B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI**

**Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SJS 4492T

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R










## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

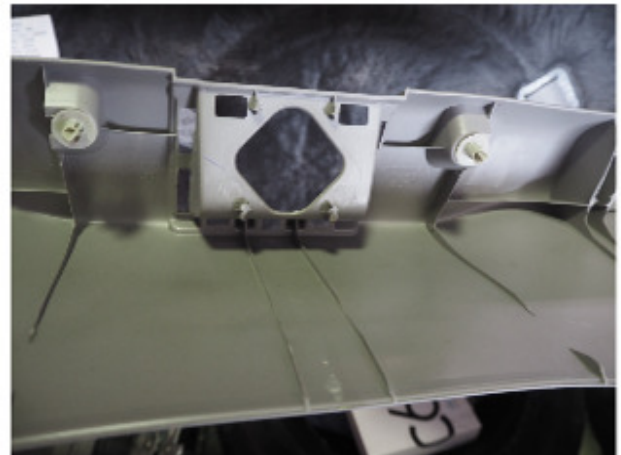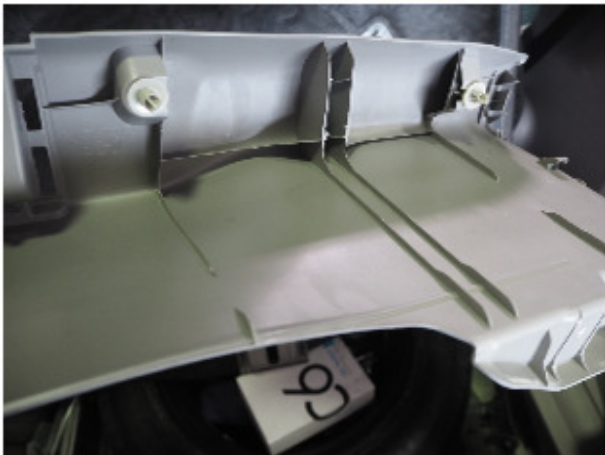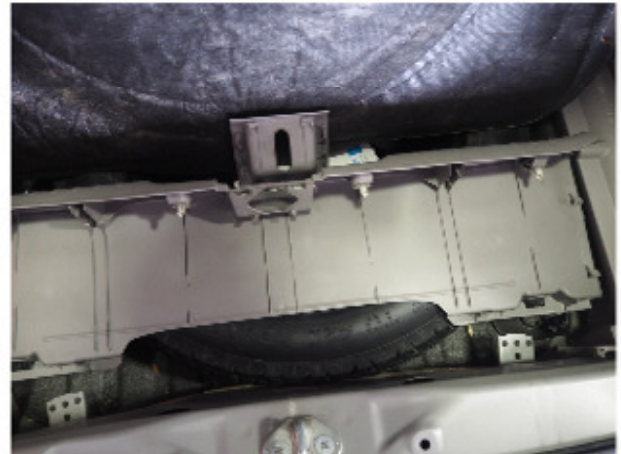



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 4492T

RE-INSPECTION

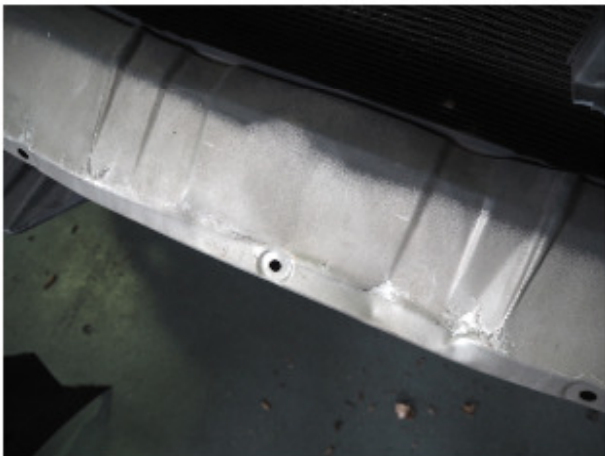





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

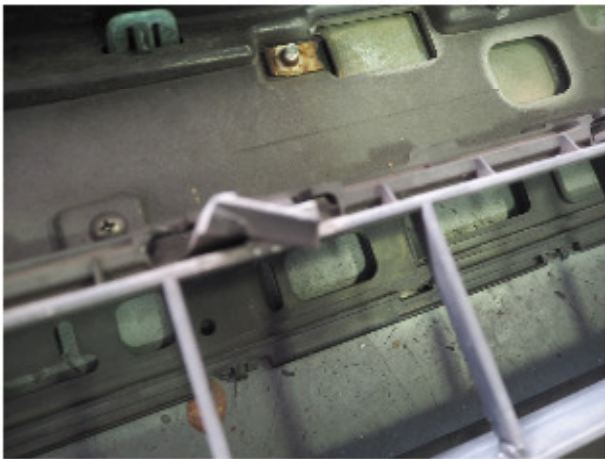





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

