

# PRESTIGE APPRAISER SERVICES

Insurance Loss Adjusters and Licensed Appraiser Regn. 652868584L

Blk 131 Rivervale Street #05-872 S'pore 540131 Tel:65528323 Fax:64574321

Our ref : PS/006/11/19

Date : 14th November 2019

Mr Ong Hong Kiat  
c/o 10 Kaki Bukit Road 2  
#01-06 First East Centre  
Singapore 417868

Dear Sir,

## Re : **THIRD PARTY CLAIM**

We refer to your instruction to appraise the vehicle **FU 9909 M** on 07th November 2019.

A static inspection was conducted during our survey and our report is enclosed for your perusal. The estimated repair cost submitted by **Messrs. Bike Image Motor Trading** for **\$8,915.00** as per our attached schedule have been inspected thoroughly each and every item and revised by us against the actual damages found on the vehicle which have been recommended by us accordingly.

The repairer has agreed to undertake repairs at our revised amount of **\$5,100.00 lump sum** corresponding to supply of parts, labour charges and spray-painting. However, we have not given instruction to authorize the repairs.

Under normal circumstances, the estimated period of repairs would be **FOUR (4) days**. Photographs of the damaged vehicle taken by us during our inspection are enclosed.

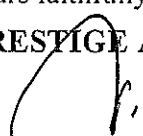
We are reverting the matter to you for a decision.

Please do not hesitate to contact us if you need any clarification.

Assuring you of our best services.

Yours faithfully,

**PRESTIGE APPRAISER SERVICES**

  
**LOUIS S C NG CAE AMIMI**  
**Dip. MTM. Automotive Engineer**  
**Licensed Appraiser**

Encl.

# PRESTIGE APPRAISER SERVICES

## VEHICLE INSPECTION REPORT

To: Mr Ong Hong Kiat  
c/o 10 Kaki Bukit Road 2  
#01-06 First East Centre  
Singapore 417868

Date : 14th November 2019  
Our Ref : PS/006/11/19  
Policy No :  
Sum Insured :  
Excess : T/P Claim

Assigned By : Mr Ong Hong Kiat  
Assignment Date : 07th November 2019  
Accident Date : 31st October 2019  
Inspection Date : 07th November 2019  
Workshop Name : Bike Image Motor Trading  
Survey Conducted At : 10 Kaki Bukit Road 2  
#01-06 First East Centre  
Singapore 417868

### PARTICULARS OF VEHICLE

Registration No	: FU 9909 M	Mileage	: 84794km
Make/Model	: Honda Phantom	Engine No	: HIDDEN
Type Of Body	: Motorcycle	Chassis No	: TA200008939
Year Of Manu./Regn.	: 2002	Passenger Cap.	: 1 Passenger
Colour	: Black	Others	: -

### CONDITION OF TYRES

Front Tyre : 5mm 100/80-17 Metzeler  
Rear Tyre : 5mm 130/90-15 Metzeler

*The above represent the estimated remaining life of the tyre treads.*

### PRE-ACCIDENT CONDITION (Static tests only)

Handbrake	: Serviceable	Body Work	: Good
Footbrake	: Serviceable	Paint Work	: Good
Steering	: Serviceable	Others	: -

### POINT OF IMPACT

The vehicle sustained impacts on the front, R/H,L/H & rear portion.

### GENERAL DESCRIPTION OF DAMAGES

The main body frame, handle bar, forks, fuel tank, exhaust muffler were dented/bent.

For details of damages please refer to schedule attached.

### REMARKS :

This survey was conducted strictly without prejudice.

# PRESTIGE APPRAISER SERVICES

Vehicle No : FU 9909 M

Our Ref : PS/006/11/19

Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.
<u>LIST ITEMS</u>				
2	front fork	warped	\$ 636.00	\$ 636.00
1	front mudguard	sliced	156.00	156.00
1	steering cone w/bearing	necessary	91.00	91.00
1	under bracket	dented	120.00	120.00
1	headlamp	dented/sliced	265.00	265.00
1	R/H front signal lamp	sliced	62.00	62.00
1	L/H front signal lamp	sliced	62.00	62.00
1	handle bar	bent	189.00	189.00
2	handle grip	necessary	76.00	76.00
1	brake lever	sliced	68.00	68.00
1	brake pedal	sliced	63.00	63.00
1	clutch lever	sliced	68.00	68.00
1	front brake disc	warped	168.00	168.00
2	front foot rest	sliced	112.00	112.00
1	L/H front foot rest bracket	dented	124.00	124.00
1	L/H rear foot rest	sliced	56.00	56.00
1	R/H rear foot rest	sliced	56.00	56.00
1	R/H rear signal lamp	sliced	64.00	64.00
1	L/H rear signal lamp	fractured	64.00	64.00
2	wing mirror	sliced	152.00	152.00
1	fuel tank	dented/distorted	680.00	680.00
1	fuel tank emblem ' LOGO '	necessary	36.00	36.00
1	rear wheel rim	serviceable	540.00	-
1	taillamp	serviceable	180.00	-
1	front wheel rim	warped/cut	540.00	540.00
1	gear pedal	bent	55.00	55.00
1	rear mudguard	dented/sliced	168.00	168.00
1	rear number plate garnish	dented	68.00	68.00
1	rear number plate lamp	scratched	98.00	98.00
1	front brake caliper	serviceable	285.00	-
1	engine protector bar	dented/sliced	198.00	198.00
2	rear shock absorber	serviceable	565.00	-
1	exhaust muffler	dented/sliced	780.00	780.00
			<u>6,845.00</u>	<u>5,275.00</u>
			Less 10%	-
			<u>\$ 6,845.00</u>	<u>\$ 4,747.50</u>
<u>S/NETT ITEMS</u>				
1	rear box	missing	300.00	240.00
1	rear box bracket	dented/sliced	180.00	160.00
1	rear number plate	dented	40.00	25.00
1	IU unit	sliced	160.00	156.00
<u>Labour Charges &amp; Misc</u>				
To dismantle & replace damaged parts, panel beat where necessary.			550.00	420.00
To putty, apply primer & spray-paint on the affected portion.			480.00	350.00
Balance b/d			<u>\$ 8,555.00</u>	<u>\$ 6,098.50</u>

# PRESTIGE APPRAISER SERVICES

Vehicle No : FU 9909 M

Our Ref : PS/006/11/19

Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.
		Balance b/d	\$ 8,555.00	\$ 6,098.50
	To align main body frame.		300.00	250.00
	Transportation charges.		60.00	50.00
			\$ <u>8,915.00</u>	\$ <u>6,398.50</u>

**Note:** The repairer has agreed to undertake the repairs at our adjusted amount of **\$5,100.00 lump sum** corresponding to supply of parts, labour and spray-painting charges.

Under normal circumstances, the estimated repair period would be **FOUR ( 4 )** days.  
Pursuant to your instruction we have **not** authorised repairs on your behalf.

PRESTIGE APPRAISER SERVICES



---

LOUIS S C NG CAE AMIMI (UK)  
Licensed Appraiser  
Dip. MTM. Automotive Engineer