



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2004049
INV Date 20/05/2020
Reference CS/SMO20005355/Avf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SKS 7669U
Insured Veh. FBH 476U
Claim No. CMTD2001496/GPL
Policy No.
Accident Date 22/04/2020
Inspection Date 23/04/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

SOMPO INSURANCE SINGAPORE PL

Ref : CS/SMO20005355/Avf3n2

50 RAFFLES PLACE

#05-01/06

SINGAPORE LAND TOWERSINGAPORE 048623

Date : 20-05-2020



Code : SMO

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	FBH 476U	Veh. Inspected	SKS 7669U
Policy No.		Coverage (\$)	0.00
Claim No.	CMTD2001496/GPL	Excess (\$)	0.00
Assign From	GRACE TEO	Assign Date	23/04/2020

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN SCIROCCO	c.c	1390
Engine No.	HIDDEN	Year of Reg.	2011
Chassis No.	WWWZZZ13ZCV013580	Colour	RED
Odometer	185254	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/35 R19	GOODYEAR	6 mm
L/H Front Tyre	235/35 R19	GOODYEAR	6 mm
R/H Rear Tyre	235/35 R19	GOODYEAR	6 mm
L/H Rear Tyre	235/35 R19	GOODYEAR	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	22/04/2020	Inspection Date	23/04/2020
Survey held at	NEW HOCK TECK MOTOR PTE LTD 1 KAKI BUKIT AVENUE 6 #01-43 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKS 7669U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT LID	DENTED	1,930.75	1,607.00
2	REAR BOOT LID HINGE @\$107.80	NOT NECESSARY	215.60	-
2	REAR BOOT LID SHOCK ABSORBER @\$123.45	NOT NECESSARY	246.90	-
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	91.15	91.15
1	REAR BOOT LID SCIROCCO LOGO	NECESSARY	97.35	97.35
1	REAR BOOT LID TSI LOGO	NECESSARY	69.55	69.55
1	REAR BOOT LID LOCK	NOT NECESSARY	178.05	-
1	REAR BOOT LID WEATHERSTRIP	NOT NECESSARY	323.85	-
1	REAR BOOT LID INNER TRIM BOARD	CUT	247.15	247.15
1	REAR BOOT LID WINDSCREEN	SHATTERED	807.80	807.80
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	80.00	60.00
1	REAR BOOT LID REVERSE CAMERA	NOT NECESSARY	850.00	-
1	REAR BOOT LID WIPER ARM	CUT	84.00	84.00
1	REAR R/H TAIL LAMP	CRACKED	377.85	377.85
4	REAR R/H TAIL LAMP CLIP @\$8.00	NECESSARY	32.00	32.00
1	REAR BUMPER	DEFORMED	1,275.05	1,121.00
10	REAR BUMPER CLIP @\$6.50	NECESSARY	65.00	30.00
1	REAR R/H BUMPER SIDE RETAINER	CRACKED	50.15	50.15
1	REAR R/H BUMPER SIDE REFLECTOR	NOT NECESSARY	67.45	-
1	REAR BUMPER INNER FOAM	NOT NECESSARY	106.00	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	611.00	-
1	REAR BUMPER REVERSE SENSOR	NOT NECESSARY	450.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,234.35	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	161.05	-
1	REAR END PANEL SEALANT	NOT NECESSARY	350.00	-
1	REAR R/H FENDER	TO REPAIR SEE LABOUR	1,773.00	-
1	REAR R/H FENDER AIR DUCT	CRACKED	78.90	78.90
1	REAR R/H FENDER COWLING	NOT NECESSARY	209.45	-
10	REAR R/H FENDER COWLING CLIP @\$6.50	NOT NECESSARY	65.00	-

Report Ref No. CS/SMO20005355/Avf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR R/H FENDER INNER TRIM BOARD	NOT NECESSARY	296.65	-
8	REAR R/H FENDER INNER TRIM BOARD CLIP @\$6.50	NOT NECESSARY	52.00	-
1	REAR R/H LOWER ARM	NOT NECESSARY	470.20	-
1	REAR R/H KNUCKLE ARM	NOT NECESSARY	774.80	-
1	REAR R/H KNUCKLE ARM BEARING	NOT NECESSARY	350.55	-
1	REAR R/H SHOCK ABSORBER	NOT NECESSARY	333.45	-
1	REAR R/H TRAILING ARM	NOT NECESSARY	443.60	-
	LESS 5% DISCOUNT		-	-237.70
			14,849.65	4,516.20
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BOOT LID TOP SPOILER (SN)	NOT NECESSARY	850.00	-
1	SET REAR RIM (SN)	CUT	2,500.00	650.00
1	REAR R/H TYRE (SN)	CUT	550.00	220.00
1	GUM (SN)	NECESSARY	50.00	50.00
			3,950.00	920.00
	<u>LABOUR</u>			
	TO REMOVE & REFIT CUSHION & TRIM BOARD.		280.00	60.00
	TO REMOVE & REFIT REAR REVERSE SENSOR.		100.00	50.00
	TO REMOVE & REFIT REAR WINDSCREEN.		120.00	120.00
	TO REMOVE & REFIT REAR R/H UNDERCARRIAGE.	NOT NECESSARY	380.00	-
	TO CHECK WHEEL ALIGNMENT.		150.00	80.00
	TO CHECK WIRING.		100.00	30.00
	TUFF KOTE.		150.00	60.00
	TOWING FEE.	NOT NECESSARY	150.00	-
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL AND REAR R/H FENDER.		1,200.00	600.00
	SPRAY PAINTING.		1,200.00	800.00
	-		-	-
	-		-	-
	-		-	-
			3,830.00	1,800.00
	GRAND TOTAL		22,629.65	7,236.20

Report Ref No. CS/SMO20005355/Avf3n2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,800.00
---	--	--	-----------------

Report Ref No. CS/SMO20005355/Avf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKS 7669U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No. 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKS 7669U

RE-INSPECTION

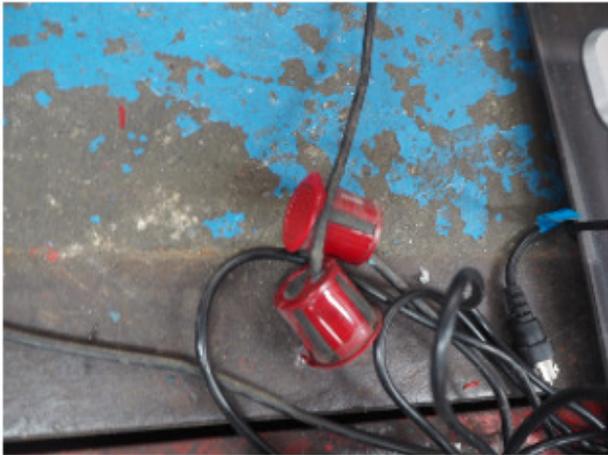



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

