

ASS. REC. BY:

CC6/CTI20005532/Dra³

OK

ASSIGNMENT

COR Jan 2028

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 16 days Res.: Yes or NoLum Sum: P/P % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SHA 903U Yr Regn: Jan / 2020

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Prius C.C. 1798Colour: Yellow A/C: Insured / Std / NI / NASp. Reading: 45457 T/Radio: Insured / Std / NI / NAEng/No: 2ZR2G13812C/No: 3TDKB3FU303090452Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R 15R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Westlake

Front Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 30/04/2020 D.O.I. 04/05/2020Survey held at Bifrost Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

China Taping SKT 4932Z29/01/2021Insured 7/P 26,033.02 with 16 days of rep.

Date/Time, File Pass to?



: Prel. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S+RS, SI

Photos

Others

TOTAL

Report Format: _____

Lump Sum / I.B.I. (\$) _____

Add Fee:



: Site Insp (\$ _____)



: Interview (\$ _____)



: Tech. Invs (\$ _____)



: Weekend (\$ _____)

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 4-May-20

MODEL: TOYOTA PRIUS New model

INSURANCE: China Taiping

VEHICLE NO.: SHA 903 U

DESCRIPTION	QTY	LIST PRICE	AMOUNT
PANEL SUB-ASSY, FRONT DOOR, LH HH repair	1	\$ 1,784.14	\$ 1,784.14
FRONT DOOR HINGE UPPER NH	1	\$ 116.17	\$ 116.17
FRONT DOOR HINGE LOWER NH	1	\$ 128.73	\$ 128.73
FRONT DOOR CHECK NH	1	\$ 216.69	\$ 216.69
FRONT DOOR COMFORT LOGO NH	1	\$ 105.86	\$ 105.86
BONNET Dental	1	\$ 1,341.63	\$ 1,341.63
INSULATOR CLIPS HH	1	\$ 5.08	\$ 5.08
BONNET RUBBER HH	1	\$ 50.11	\$ 50.11
BONNET HINGE (LH) vt	1	\$ 123.79	\$ 123.79
RADIATOR GRILLE deformed	1	\$ 618.24	\$ 618.24
RADIATOR GRILLE EMBLEM Hec	1	\$ 124.21	\$ 124.21
FRONT BUMPER COVER torn	1	\$ 705.61	\$ 705.61
FRONT BUMPER REINFORCEMENT Dental	1	\$ 982.97	\$ 982.97
FRONT BUMPER REINFORCEMENT ABSORBER Dental N/S 1 x 2	1	\$ 163.31	\$ 163.31
FRONT BUMPER LOWER REINFORCEMENT vt	1	\$ 514.07	\$ 514.07
FRONT BUMPER LOWER REINFORCEMENT BRACKET N/S 1 x 2	2	\$ 465.80	\$ 465.80
FRONT BUMPER SPONGE NF 0/S NH	1	\$ 111.23	\$ 111.23
FRONT BUMPER LOWER GRILLE cut deformed	1	\$ 209.75	\$ 209.75
LAMP ASSY, FOG, LH broken	1	\$ 1,298.58	\$ 1,298.58
FRONT BUMPER CLIPS Hec	1	\$ 31.05	\$ 31.05
FRONT BUMPER SIDE RETAINER N/S destroyed 0/S NH	2	\$ 108.69	\$ 108.69
FRONT LOWER CROSSMEMBER NH	1	\$ 504.89	\$ 504.89
FRONT UNDER COVER HH	1	\$ 255.20	\$ 255.20
FRONT BUMPER TOP GARNISH vt deformed	1	\$ 318.15	\$ 318.15
COVER, FRONT BUMPER HOLE, LH destroyed	1	\$ 40.06	\$ 40.06
ABSORBER, FRONT BUMPER, LOWER svc	1	\$ 180.25	\$ 180.25
UNIT ASSY, HEADLAMP, LH (LED) broken 3455-w	1	\$ 4,876.73	\$ 4,876.73
HEADLAMP ECU Dental / Dam 437.76	1	\$ 963.49	\$ 963.49
HEAD LAMP PANEL (LH) Dental	1	\$ 338.90	\$ 338.90
TOP PANEL CENTRE Dental / vt	1	\$ 515.17	\$ 515.17
TOP PANEL SIDE Dental	1	\$ 205.94	\$ 205.94
RADIATOR ASSY vt NH	1	\$ 2,599.70	\$ 2,599.70
COOLANT HH	1	\$ 63.52	\$ 63.52
DEFLECTOR, RADIATOR SIDE, LH broken	1	\$ 117.86	\$ 117.86
*RADIATOR TOP HOSE HH	1	\$ 60.74	\$ 60.74
RADIATOR BOTTOM MOUNTING HH	1	\$ 38.82	\$ 38.82
STAY, RADIATOR SUPPORT, LH NH	1	\$ 92.74	\$ 92.74
RADIATOR FAN BLADE (LH) HH	1	\$ 329.02	\$ 329.02
RADIATOR FAN MOTOR (LH) HH	1	\$ 767.43	\$ 767.43
RADIATOR FAN COWLING (LH) HH	1	\$ 637.01	\$ 637.01
RESERVE TANK ASSY, RADIATOR W/O CAP NH	1	\$ 557.97	\$ 557.97
CONDENSER ASSY, W/RECEIVER vt	1	\$ 1,886.61	\$ 1,886.61

1336.60

FENDER SUB-ASSY, FRONT LH <i>Bnc</i>	1	\$ 1,334.29	\$ 1,334.29	✓ 945.30
FRONT HOUSING ASSY <i>HH</i>	1	\$ 1,458.23	\$ 1,458.23	X
FRONT FENDER SHIELD <i>defunct N/S</i>	1	\$ 280.18	\$ 280.18	✓ 196.60
FRONT FENDER SHIELD CLIP <i>Hec N/S</i>	1	\$ 21.03	\$ 21.03	✓
FRONT FENDER HYBRID EMBLEM, LH <i>defunct Hec</i>	1	\$ 122.09	\$ 122.09	✓
BRACKET, FRONT SIDE PANEL, LH <i>HH</i>	1	\$ 121.81	\$ 121.81	X
TRAY, BATTERY <i>crack</i>	1	\$ 60.41	\$ 60.41	✓
CLAMP, BATTERY <i>HH</i>	1	\$ 22.73	\$ 22.73	X
FRONT WINDSCREEN GLASS MOULDING <i>Hec</i>	1	\$ 259.15	\$ 259.15	✓ 183.60
FRONT WINDSCREEN GLASS MOULDING LOWER <i>Hec</i>	1	\$ 294.44	\$ 294.44	✓ 208.60
WIPER TOP GARNISH <i>defunct</i>	1	\$ 943.33	\$ 943.33	✓ 668.32
FRONT WHEEL RIM <i>cut LH</i>	1	\$ 2,216.83	\$ 2,216.83	✓ 1570.55
FRONT WHEEL HUB CAP <i>HF</i>	1	\$ 248.14	\$ 248.14	X
FRONT WHEEL HUB BEARING <i>2 Dan LH</i>	1	\$ 790.36	\$ 790.36	2 ✓ 560.10
FRONT SUSPENSION LOWER ARM (LH) <i>2 Mustang</i>	1	\$ 891.93	\$ 891.93	2 ✓ 637.50
FRONT SHOCK ABSORBER (LH) <i>2 Mustang 401.80</i>	1	\$ 562.06	\$ 562.06	2 ✓
ABSORBER TOP MOUNTING <i>HH</i>	1	\$ 276.94	\$ 276.94	X
BAR, STABILIZER <i>HH</i>	1	\$ 497.41	\$ 497.41	X
LINK ASSY, FRONT STABILIZER, LH <i>HH</i>	1	\$ 277.78	\$ 277.78	X
KNUCKLE, STEERING, LH <i>defunct 476.75</i>	1	\$ 849.80	\$ 849.80	X ✓
JOINT ASSY, LOWER BALL, FRONT (LH/RH) <i>HH</i>	1	\$ 282.27	\$ 282.27	X
END SUB-ASSY, TIE ROD, LH <i>2 HH</i>	1	\$ 224.85	\$ 224.85	2 X
ENGNE MAIN WIRE <i>defunct socket broken 6138.00</i>	1	\$ 8,663.79	\$ 8,663.79	2 ✓
FRONT WINDSCREEN GLASS <i>crack</i>	1	\$ 2,296.93	\$ 2,296.93	✓ 1627.30
FRONT WINDSCREEN SIDE GARNISH <i>defunct N/S</i>	1	\$ 263.10	\$ 263.10	X
FRONT WINDSCREEN GLASS MOULDING <i>defunct requested</i>	1	\$ 259.15	\$ 259.15	X
SUB TOTAL <i>25653.96</i>			\$ 48,044.92	
LESS 20% <i>25%</i>			\$ 9,608.98	
DISCOUNTED TOTAL <i>19240.47</i>			\$ 38,435.94	
FRONT NO. PLATE <i>st</i>	SN 1	\$ 35.29	\$ 35.29	451-
FRONT NO. PLATE TRIM COVER <i>st</i>	SN 1	\$ 42.35	\$ 42.35	
FRONT NO. PLATE GARNISH <i>broken List</i>	SN 1	\$ 139.74	\$ 139.74	✓
BATTERY <i>crack</i>	SN 1	\$ 310.53	\$ 310.53	1501-
FRONT TYRE (RH) <i>HH</i>	SN 1	\$ 304.88	\$ 304.88	X
FRONT WINDSCREEN SEALANT <i>Hec</i>	SN 1	\$ 45.00	\$ 45.00	✓
SUB TOTAL <i>240.00</i>			\$ 877.79	
Labour Charge				
Panel Beating	1	\$1,600.00	\$ 1,600.00	1100/-
Spray Painting Charge	1	\$1,200.00	\$ 1,200.00	900/-
Wiring Charge	1	\$180.00	\$ 180.00	301-
Tuff Kote	1	\$160.00	\$ 160.00	401-
Towing Charge	1	\$80.00	\$ 80.00	HH
Transfer of Door Mechanism FRONT	1	\$80.00	\$ 80.00	HH
Re-set Frt Power Window System	1	\$200.00	\$ 200.00	HH
Four Wheel Alignment	1	\$120.00	\$ 120.00	601-
Remove/Refix Undercarriage (Frt)	1	\$400.00	\$ 400.00	2 1501-
Re-set Frt ABS System	1	\$200.00	\$ 200.00	HH
Remove/Refix Radiator	1	\$90.00	\$ 90.00	501-
Remove/Refix Aircon & Refill Gas	1	\$130.00	\$ 130.00	801-
Remove/Refix Fuse Box	1	\$120.00	\$ 120.00	501-

Remove/Refix Front Windscreen Glass	1	\$120.00	\$ 120.00
Remove/Refix Engine	1	\$600.00	\$ 600.00
Remove/Refix Dashboard	1	\$350.00	\$ 350.00
Front Chassis Alignment Charge	1	\$220.00	\$ 220.00
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$ 550.00
TOTAL LABOUR			\$ 6,400.00
ESTIMATE TOTAL			\$ 45,713.72
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.			

80/-
72/-
180/-
72/-
320/-


04/05/2020 e 1700m

NA Antu

HS P/PAT.

7/16
16 days

LKK Antu

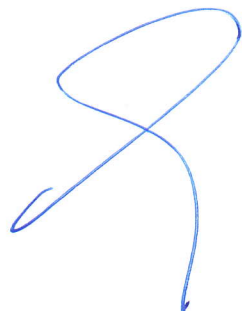

Check part prices.

22520.47
Supp 3612.55
T/P 26,033.02

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 5-May-20

INSURANCE: China Taiping

MODEL: TOYOTA PRIUS

VEHICLE NO.: SHA 903U (S)

DESCRIPTION	QTY	LIST PRICE	AMOUNT
BONNET HINGE (RH) <i>St</i>	1	\$ 123.79	\$ 123.79
FENDER SUB-ASSY, FRONT RH <i>Dental</i>	1	\$ 1,334.29	\$ 1,334.29
UNIT ASSY, HEADLAMP, RH (LED) <i>mainly crack</i>	1	\$ 4,876.73	\$ 4,876.73
BRACKET, FRONT SIDE PANEL, LH <i>NW</i>	1	\$ 121.81	\$ 121.81
FRONT Fender TOP GARNISH LH <i>dislodged</i>	1	\$ 225.40	\$ 225.40
SUB TOTAL			\$ 6,682.02
LESS 20% 25%			\$ 1,336.40
DISCOUNTED TOTAL			\$ 5,345.62
FRONT DOOR COMFORT LOGO RH <i>Nac</i> SN	1	\$ 105.86	\$ 105.86
TOTAL			\$ 5,451.48
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.			

✓ 57.70
✓ 945.30
✓ 3455.00
X
✓

✓

Tian

19/05/2020

2 KK Auto

4683.40

25% 3512.55

[Signature]