

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSE SINGAPORE 068877

INV Date Reference

INV No.

AC2006815

02/10/2020 CC4/FCI20005678/Uba3q2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLV 6421X

Insured Veh. SH 6800B

Claim No. D20002099MFSH

Policy No. D-20094922MFSH

Accident Date 08/05/2020

Inspection Date 13/05/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile				
MS F	MS FIRST CAPITAL INSURANCE LTD Ref : CC4/FCl20005678/Uba3q2				
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 0688		INGAPORE 068877	Date: 02-10-2020 Code: FCI2		
1.		Policy Particulars :	:- THIRD PARTY CLAIM		
	Insured Veh.	SH 6800B	Veh. Inspected	SLV 6421X	
	Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
	Claim No.	D20002099MFSH	Excess (\$)	0.00	
	Assign From	MAY CHUA	Assign Date	12/05/2020	
2.		Vehicle Partic	culars & Condition		
	Make & Model	HYUNDAI AVANTE (A)	c.c	1591	
	Engine No.	HIDDEN	Year of Reg.	2010	
	Chassis No.	KMHDU41BMAU933699	Colour	MAROON	
	Odometer	139835	Steering	AFFECTED	
	Brakes	IN ORDER	Modification	SPORTS RIM	
	General	GOOD			
3.		Condition	ons of Tyres		
		Size	Make	Balance	
	R/H Front Tyre	185/65 R15	FIRENZA	6 mm	
	L/H Front Tyre	185/65 R15	FIRENZA	6 mm	
	R/H Rear Tyre	185/65 R15	FIRENZA	6 mm	
	L/H Rear Tyre	185/65 R15	FIRENZA	6 mm	
4.		· · · · · · · · · · · · · · · · · · ·	on of Damages		
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION AND O/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION.				
	DAMAGES SEE DI				
5.	Т		Information		
	Accident Date	08/05/2020	Inspection Date	13/05/2020	
	Survey held at	ey held at TONY AUTOMOTIVE PTE. LTD 8 KAKI BUKIT AVENUE 4 #04-07 PREMIER @ KAKI BUKIT SINGAPORE 415875			
5a.	1	Re	emarks		
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b.	5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days				



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLV 6421X

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT RIGHT FENDER	TO REPAIR SEE LABOUR	956.20	-
1	FRONT RIGHT INNER COWLING	NOT NECESSARY	273.50	-
1	FRONT STEERING RACK	BENT / JAMMED	1,913.60	1,913.60
1	FRONT DRIVE SHAFT	SERVICEABLE	918.30	-
1	FRONT RIGHT SUSPENSION ASSY	BENT	827.60	422.30
1	FRONT RIGHT LOWER ARM	BUCKLED	330.20	330.20
1	FRONT RIGHT KNUCKLE	BENT	463.80	425.50
1	FRONT RIGHT WHEEL HUB BEARING ASSY	NECESSARY	250.60	183.90
1	FRONT RIGHT WHEEL HUB ASSY	BENT	280.50	280.50
1	FRONT RIGHT MEMBER ASSY	SERVICEABLE	1,514.80	-
1	FRONT RIGHT DOOR	BADLY DENTED	1,670.50	966.20
1	FRONT RIGHT DOOR STICKER	NECESSARY	30.40	30.40
1	FRONT RIGHT DOOR CHECKER	NOT NECESSARY	82.20	-
1	FRONT RIGHT DOOR UPPER HINGE	NOT NECESSARY	66.10	-
1	FRONT RIGHT DOOR LOWER HINGE	NOT NECESSARY	66.10	-
1	FRONT RIGHT DOOR WEATHERSTRIP	NECESSARY	156.20	133.50
1	FRONT RIGHT BODY WEATHER STRIP	NOT NECESSARY	139.50	-
1	FRONT RIGHT DOOR LATCH ASSY	NOT NECESSARY	387.20	-
1	FRONT RIGHT DOOR MODULE	NO SUCH PARTS	380.40	-
1	FRONT RIGHT DOOR SCUFF	TWISTED	86.00	86.00
1	FRONT RIGHT ROCKER PANEL	BADLY DENTED	783.30	783.20
1	FRONT RIGHT DOOR POWER MOTOR	BENT / JAMMED	650.50	650.50
1	FRONT RIGHT ROCKER PANEL OUTER GARNISH (ADDITIONAL)	NO SUCH PARTS	386.60	-
1	FRONT RIGHT DOOR TRIM BOARD (ADDITIONAL)	DEFORMED / TORN	1,150.50	645.30
	LESS 20% DISCOUNT		-2,752.92	-1,370.22
			11,011.68	5,480.88
	SPECIAL NETT ITEMS			
1	FRONT RIGHT SPORTS RIM (SN)	DENTED / BENT	551.20	350.00

Report Ref No. CC4/FCI20005678/Uba3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

6,100.00

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	SET DOOR PANEL CLIPS (SN) (ADDITIONAL)	NOT NECESSARY	60.00	-
			611.20	350.00
	LABOUR			
	REMOVE AND INSTALL DOOR POWER MOTOR .		300.00	60.00
	REMOVE AND INSTALL RH WHEEL ASSY .	NOT NECESSARY	600.00	-
	CHECK WHEEL ALIGNMENT.		120.00	60.00
	TUFFKOTE.		150.00	60.00
	SPRAY PAINTING .		1,000.00	700.00
	PANEL BEATING ,GENERAL INSTALLATION ETC.INCLUSIVE OF THE REPAIR OF FRONT RIGHT FENDER .		1,200.00	600.00
	REMOVE AND INSTALL FRONT UNDERCARRIAGE. (ADDITIONAL)		800.00	350.00
			4,170.00	1,830.00
	GRAND TOTAL		15,792.88	7,660.88

Report Ref No. CC4/FCI20005678/Uba3q2

RECOMMENDED COST OF LUMP SUM REPAIRS

(TO ITS PRE-ACCIDENT CONDITION)

CHUA KANG SENG

Licensed Appraiser




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 6421X



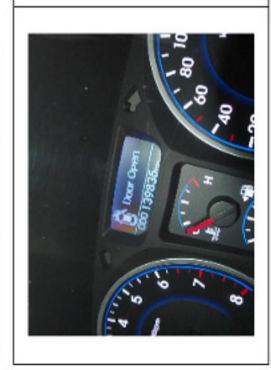














51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933



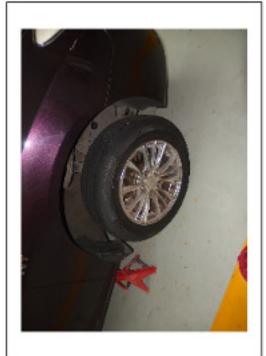












51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933





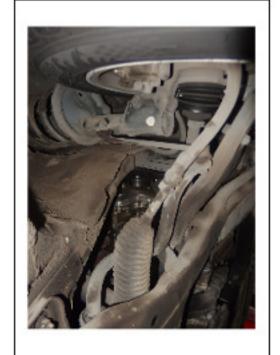









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933


















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315

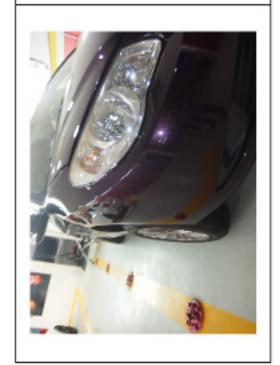












51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 6421X



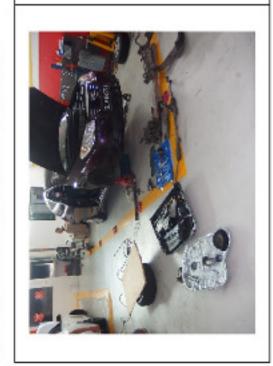












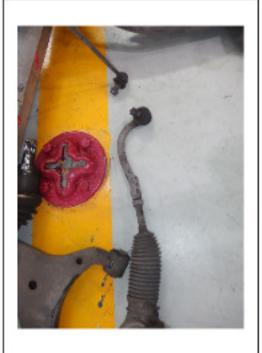




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315

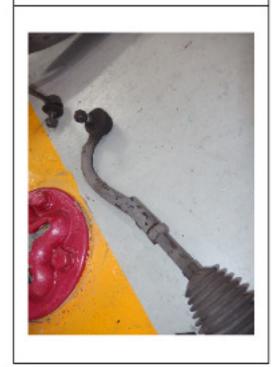


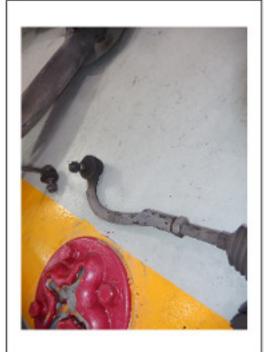



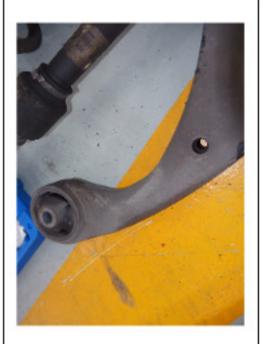



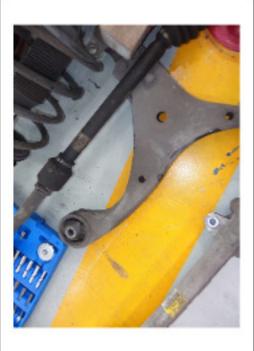




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933





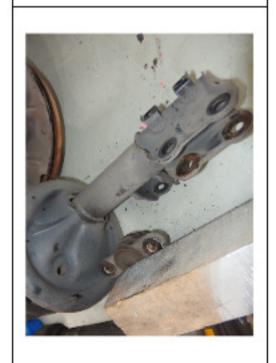










51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933







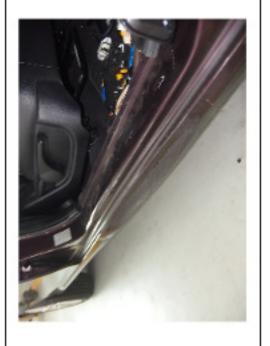







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 F.AX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933















51 Ubi Ave 1 #01-25 Paya Ubi hdustrial Park, Singapore 408933

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 6421X





