



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2008002
INV Date 27/11/2020
Reference CC4/FCI20005961/Aga3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SMP 7358J
Insured Veh. SHD 7208G
Claim No. D20002231MFSH
Policy No. D-20094922MFSH
Accident Date 26/05/2020
Inspection Date 27/05/2020

Description	Total
Survey Inspection	394.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	394.00
GST (7%)	27.58
Grand Total	421.58

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC4/FCI20005961/Aga3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 27-11-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 7208G	Veh. Inspected	SMP 7358J
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20002231MFSH	Excess (\$)	0.00
Assign From	RACHEL WU	Assign Date	27/05/2020

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI AVANTE	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	KMHD841CMLU996841	Colour	GREY
Odometer	23489	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	KUMHO	6 mm
L/H Front Tyre	205/55 R16	KUMHO	6 mm
R/H Rear Tyre	205/55 R16	KUMHO	6 mm
L/H Rear Tyre	205/55 R16	KUMHO	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	26/05/2020	Inspection Date	27/05/2020
Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 7358J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	TORN	658.20	658.20
1	FRONT BUMPER TOP RUBBER SEAL	NOT NECESSARY	85.20	-
1	FRONT BUMPER TOP BRACKET LH	CRACKED	98.60	98.60
1	FRONT BUMPER SIGNAL LAMP LH	CRACKED	165.80	165.80
1	FRONT BUMPER RETAINER RH	DAMAGED	86.90	86.90
1	FRONT BUMPER AIR GUIDE RH	CRACKED	125.80	125.80
1	FRONT BUMPER SIDE STRIP RH	CRACKED	92.60	92.60
1	FRONT BUMPER SIDE COVER RH	CRACKED	98.60	98.60
1	FRONT BUMPER LOWER LIP	NOT NECESSARY	295.60	-
1	FRONT BUMPER LOWER COVER RH	NOT NECESSARY	202.30	-
1	FRONT ENGINE UNCOVER COVER	CRACKED	356.80	197.00
1	FRONT BUMPER SPONGE	CRACKED	225.60	225.60
1	FRONT BUMPER LOWER STIFFENER	NOT NECESSARY	175.20	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	589.50	-
1	FRONT BUMPER RADIATOR GRILLE	NOT NECESSARY	1,082.90	-
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	202.50	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	987.50	-
1	FRONT WASHER TANK	NOT NECESSARY	98.70	-
1	FRONT WASHER TANK MOTOR	NOT NECESSARY	52.60	-
1	FRONT HEADLAMP RH	CRACKED	1,756.40	1,756.40
1	FRONT HEADLAMP BRACKET RH	CRACKED	98.60	98.60
1	FRONT BONNET	NOT NECESSARY	1,971.20	-
1	FRONT BONNET INSULATOR	NOT NECESSARY	385.90	-
1	FRONT FENDER RH	DENTED	985.60	985.60
1	FRONT FENDER INNER COWLING RH	TORN	189.30	189.30
1	FRONT FENDER SIGNAL LAMP RH	NOT NECESSARY	67.80	-
1	FRONT KNUCKLE ARM RH	NOT NECESSARY	423.50	-
1	FRONT WHEEL HUB BEARING RH	NOT NECESSARY	458.90	-
1	FRONT STABILIZER LINK RH	NOT NECESSARY	158.90	-
1	FRONT STABILIZER BAR RH	NOT NECESSARY	298.70	-
1	FRONT STABILIZER BUSH RH	NOT NECESSARY	48.90	-

Report Ref No. CC4/FCI20005961/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT ABSORBER TOP MOUNTING RH	NOT NECESSARY	158.90	-
1	STEERING RACK ASSY	NOT NECESSARY	1,023.70	-
1	FRONT LOWER ARM RH	NOT NECESSARY	345.20	-
1	FRONT ABSORBER RH	NOT NECESSARY	398.70	-
	LESS 20% DISCOUNT		-2,890.22	-955.80
			11,560.88	3,823.20
1	FRONT RIM RH (SN)	CUT	982.50	600.00
	LESS 20% DISCOUNT		-196.50	-
			786.00	600.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT FENDER INNER COWLING CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET FRONT ENGINE UNDERCOVER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT HEADLAMP CLIPS (SN)	NECESSARY	30.00	10.00
1	SET FRONT ENGINE UNDERCOVER CLIPS (SN)	REPEATED	30.00	-
			200.00	100.00
	<u>LABOUR</u>			
	TO RENEW DAMAGED PARTS ,REPLACE ,BEAT ,WELD ,REALIGN STRAIGHTEN MEMBER .		1,200.00	500.00
	TO RESPRAY AFFECTED AREAS.		1,200.00	400.00
	TO TUFFCOAT AFFECTED AREA.	NOT NECESSARY	150.00	-
	TO REMOVE /REFIT FRONT CONDENSER AND TOP UP GAS FOR SUPPORT PANEL REPLACE.	NOT NECESSARY	120.00	-
	LABOUR TO REMOVE /REFIT/REPLACE FRONT UNDERCARRIAGE.	NOT NECESSARY	200.00	-
	TO PERFORM COMPUTERISED WHEEL ALIGNMENT BEFORE/ AFTER.		160.00	80.00
	TO PERFORM COMPUTERISED FAULT CODE CLEARANCE AND SETTling.	NOT NECESSARY	160.00	-
	TO REMOVE /REFIT WIRING CHECKS FOR HEADLAMP .		150.00	30.00
			3,340.00	1,010.00

Report Ref No. CC4/FCI20005961/Aga3q2



GRAND TOTAL		15,886.88	5,533.20
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,400.00

Report Ref No. CC4/FCI20005961/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 7358J

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

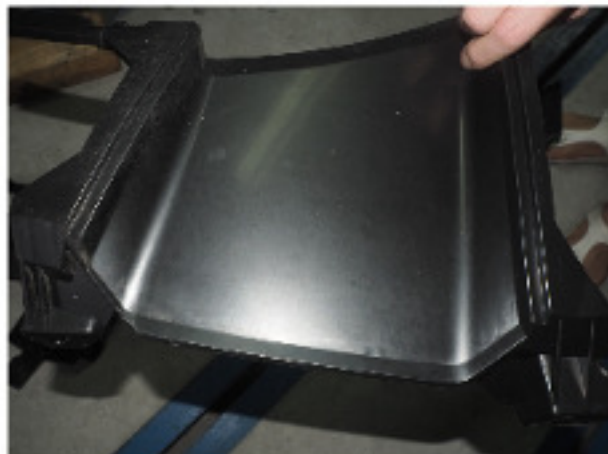



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

