

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/ Adjusters Cargo Surveyors & Licensed Appraisers

227 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



## AUTOMOBILE INSPECTION REPORT

To:

**MD ZAKIR HOSSAIN**

**C/O 27A JURONG PORT ROAD #01-29**

**SINGAPORE 619101**

### INSURANCE DETAILS

Insured : -  
Policy No. / Claim No. : -  
Sum Insured : -  
Excess Clause : -  
Windscreen Coverage : -  
Type of Claims : Third Party Claims  
Third Party Insurer : -  
Third Party Policy No. : -

### REFERENCE

Assigned By : As above  
Accident Date : 14 MARCH 2020  
Assignment Date : 23 MARCH 2020  
Inspection Date : 23 MARCH 2020  
Our Reference No. : PAS/HH/200317/TP

Inspection Report Date : 29 March 2020

Workshop Name :

**HUP HUP WORKSHOP PTE LTD**

Inspection Address :

**27A JURONG PORT ROAD #01-29**

**SINGAPORE 619101**

### PARTICULARS OF VEHICLE

Registration No. : SLX 5599 M  
Make/Model : MERCEDES BENZ E250 CGI A  
Yr of Manuf/Regn : 2010  
Carrying Capacity : 4 Seater  
Chassis No. : WDD2120472A199270  
Engine No. : 27186030053247  
Colour : Metallic White  
Class : Passenger ( Private )

Mileage : 119325 Km/h  
Radio/Cassette : Fitted  
CD Disc Player : Fitted  
Air Conditioner : Fitted  
Clock : Fitted  
Seat Belt : Fitted  
Wing Mirror : Fitted  
Other Accessories : Fitted

### PRE-ACCIDENT CONDITION (Static Check Only) VEHICLE VALUE

Body Work : Good  
Paint Work : Good  
Handbrake : Serviceable  
Footbrake : Serviceable  
Steering : Serviceable  
Any Apparent : None  
Eng Modifications

Market Value : APPROXIMATELY \$36,250.00

Wreck Value (Part) : APPROXIMATELY \$30,251.00

### TYRE SIZE & CONDITION

Front N/s Size : 245/35R19 80 %  
Make : GOODYEAR  
Rear N/s size : 245/35ZR19 80 %  
Make : FIRENZA  
Spare Size : 185/60R14 80 %  
Make : GOODYEAR

Front O/s Size : 245/35R19 80 %  
Make : GOODYEAR  
Rear O/s Size : 245/35ZR19 80 %  
Make : FIRENZA  
Spare Size :  
Make :  
Jack & Tools : Intact/ Missing

Type of Wheel Rims: Alloy

Note: The above percentage % represent the estimated remaining tyre threads.

# PRECISION APPRAISAL SERVICES

Insurance Loss Assessors / Adjusters Cargo Surveyors & Licensed Appraisers




VEHICLE REGISTRATION NO. : SLX 5599 M

APPENDIX A

## POINT OF IMPACT

Direction of impact/damage marked (→) (X)

The vehicle sustained impact on its Rear O/s Portion. (see Diagram D)

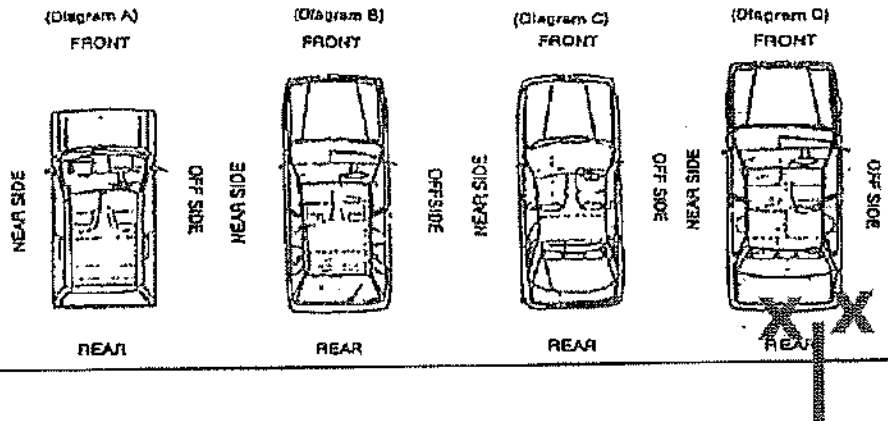

## GENERAL DESCRIPTION OF DAMAGES

Parts damaged were :

The rear bumper and reinforcement were dented.

## ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 23/03/2020 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s HUP HUP WORKSHOP PTE LTD as per attached Appraisal Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Lump Sum Repair Basis of \$ 5,050.00 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts	6896	99	5398	83
Towing Charges	-		-	
PB Labour Charges	600	00	380	00
Others Misc Charges	520	00	340	00
Paintwork	300	00	250	00
Total	\$ 8416	99	\$ 6368	83

Under normal circumstances, the duration of repairs should not exceed Four (04) days excluding Pre - Repair Inspection ( PRI ) / Pre - Repair Survey ( PRS ) waiting time frame & Public Holidays. Attached photographs taken during inspection Forty - Three ( 43 ) Photographs.

## SPECIAL REMARKS

1. The inspection was conducted on a 'without prejudice' basis
2. On 24/03/2020, we examined the extent of damages
3. On 27/03/2020, we examined the repaired vehicle.

Yours Faithfully,

TFNG PHILIP FOO  
ACII CAE, AMIMI  
AIAME, AMSAE-A  
Licensed Appraiser/Adjuster

Inspection Report Date: 29 March 2020

VEHICLE REGN NO : SLX 5599 M  
 OUR REFERENCE : PAS/HH/200317/TP  
 INSPECTION REPORT DATE : 29-Mar-20


# APPRAISEMENT SCHEDULE


CONTINUATION SHEET NO :

1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount \$ cts	Recommendation / Revised Amount \$ cts
		<u>PARTS SUPPLY - LIST ITEMS</u>			
1	1pc	Rear bumper	Badly dented	2067.00	2067.00
2	1pc	Rear bumper reinforcement	Dented	242.32	Repair
3	1set	Rear bumper clips	Necessary	65.00	65.00
4	2pcs	Rear bumper bracket@\$68	O/s Cracked	136.00	68.00
5	2pcs	Rear bumper side retainer@\$46.70	O/s Bent	93.40	46.70
6	1pc	Rear bumper lower garnish	Badly dented	512.14	512.14
7	4pcs	Rear bumper sensor@\$258.03	2pcs Dented/Jammed	1032.12	516.06
8	4pcs	Rear bumper sensor holder@\$5.6	2pcs Necessary	22.40	11.20
9	1pc	Rear bumper tow hook cover	Dented	48.00	48.00
10	2pcs	Rear bumper side mldg@\$122.9	O/s Bent	245.80	122.90
11	1pc	Rear bumper centre mldg	Bent	196.50	196.50
12	1pc	O/s Taillamp	Cracked	598.31	598.31
13	1pc	Front N/s Passenger headrest	Jammed	860.00	860.00
14	1pc	Front n/s headrest sensor	Jammed	798.00	798.00
				<u>6916.99</u>	<u>5909.81</u>
		Less: 10% discount		-	<u>590.98</u>
				<u>6916.99</u>	<u>5318.83</u>
		<u>SPECIAL NETT ITEMS</u>			
1	1set	Rear no. plate ( Chrome ) & garni	Dented	80.00	80.00
		Total spare parts		<u>6996.99</u>	<u>5398.83</u>
		<u>LABOUR &amp; MISC. CHARGES</u>			
1		Remove the necessary affected parts, straighten rear bumper reinforcement and replace parts		600.00	380.00
2		Putty and Spraypaint on all affected parts		300.00	250.00
3		Reset headrest sensors, rear parking using diagnostic tools		300.00	200.00
4		Tuff Kote		50.00	30.00
5		Remove and refit rear bumper sensors		100.00	60.00
6		Rewire rear portion		50.00	30.00
7		Check electrical		20.00	20.00
		Note: Recommended lump sum repair at \$5,050.00nett			
SUB / GRAND TOTAL				<u>8416.99</u>	<u>6368.83</u>

PRECISION APPRAISAL SERVICES



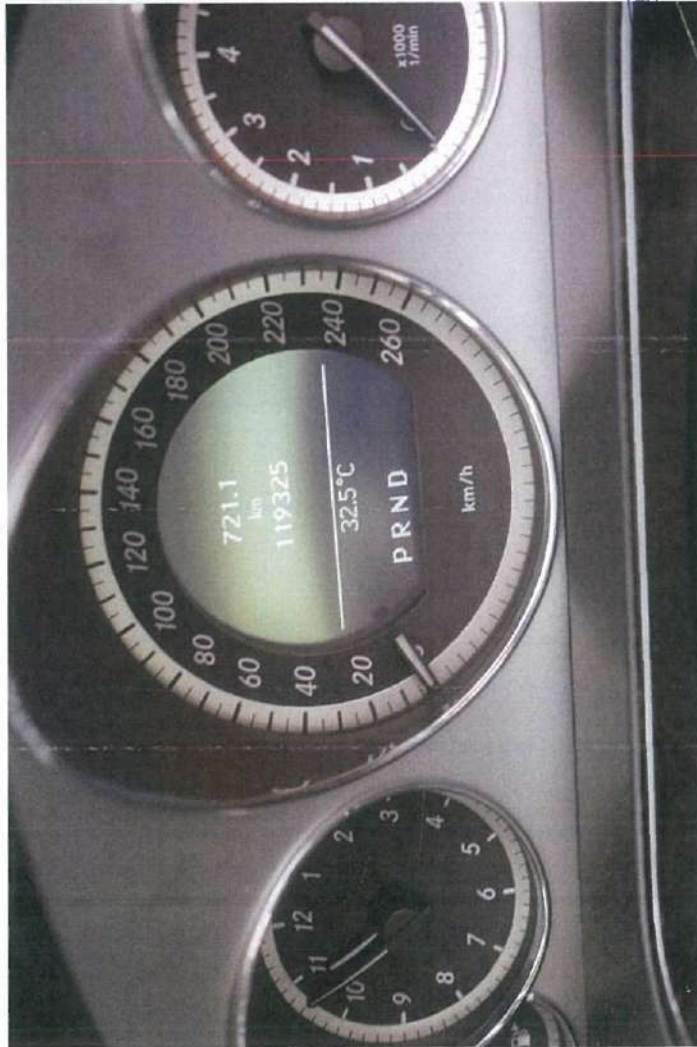

















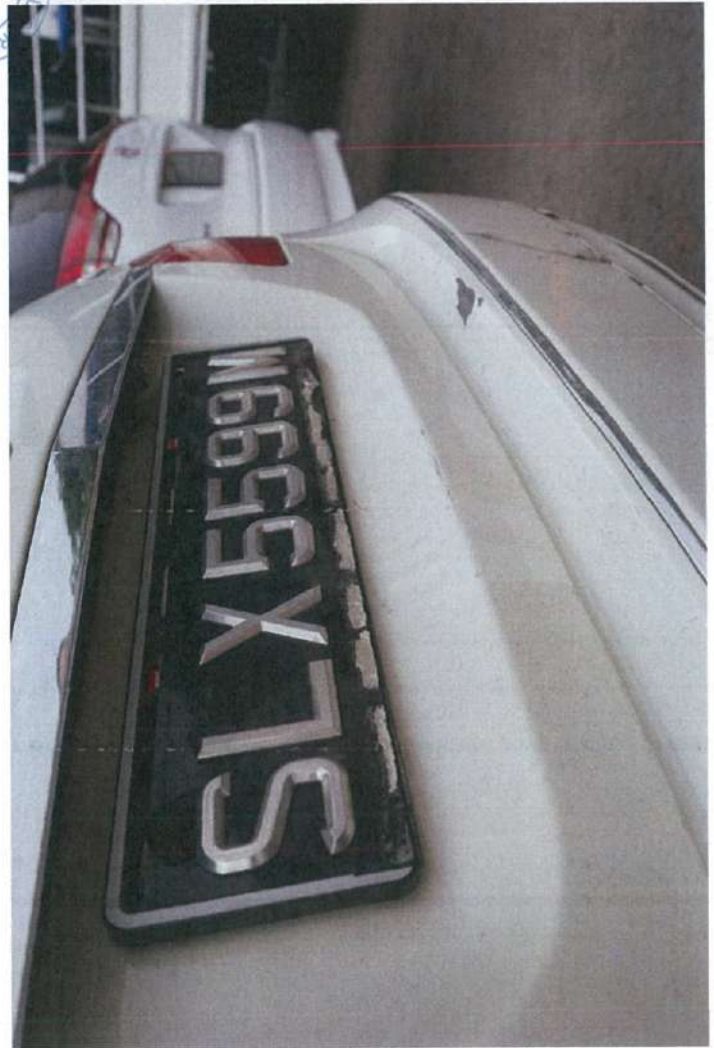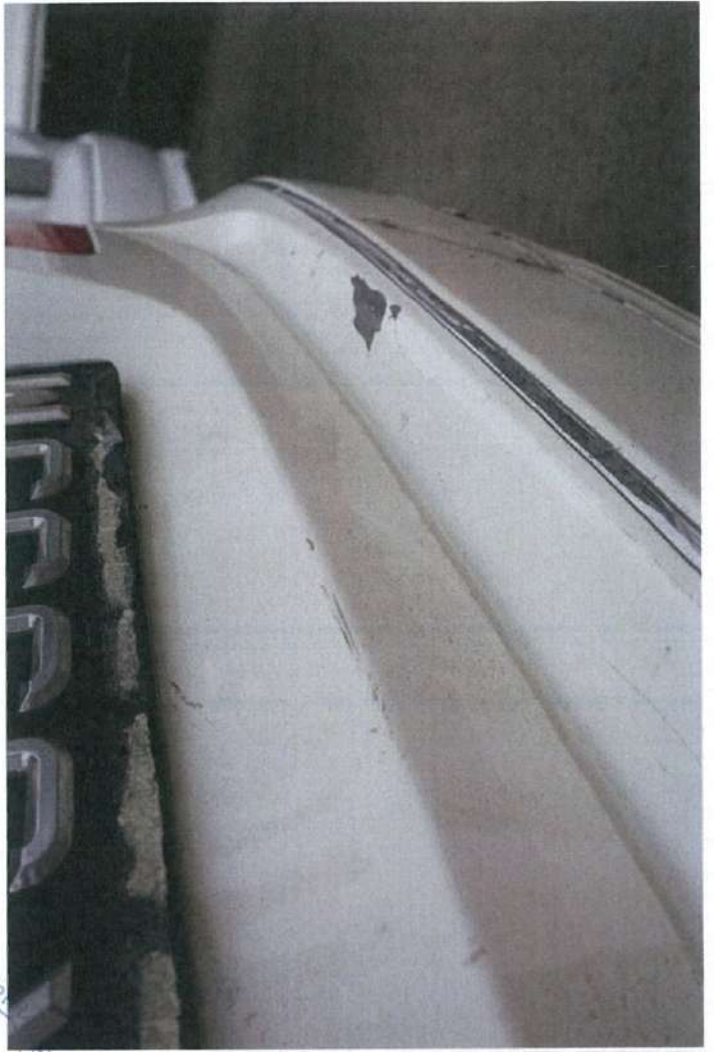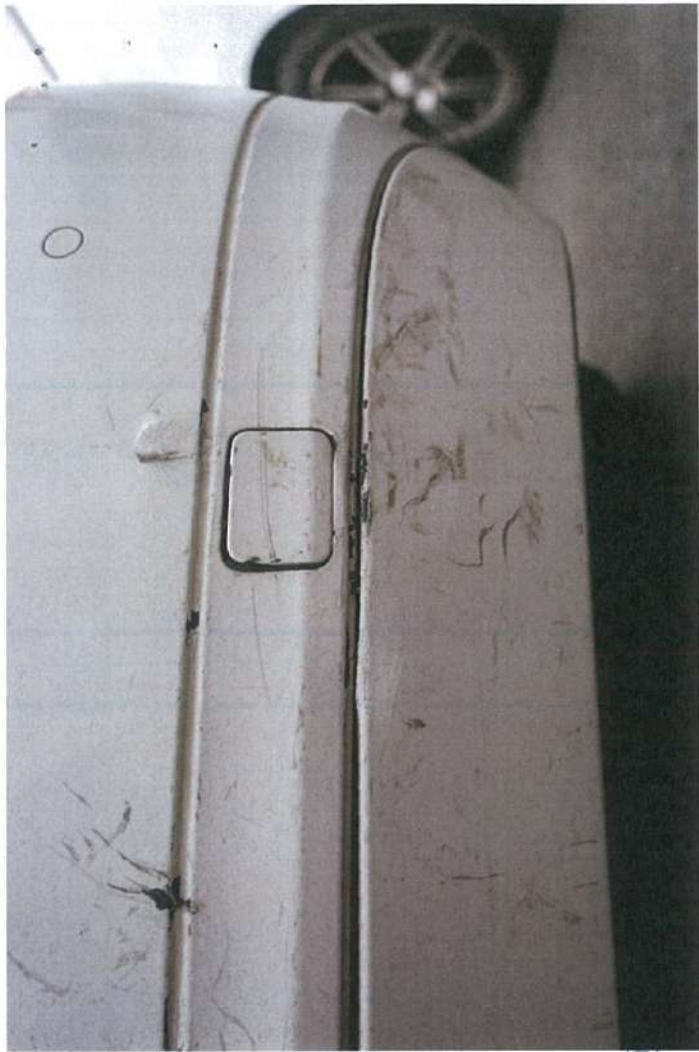



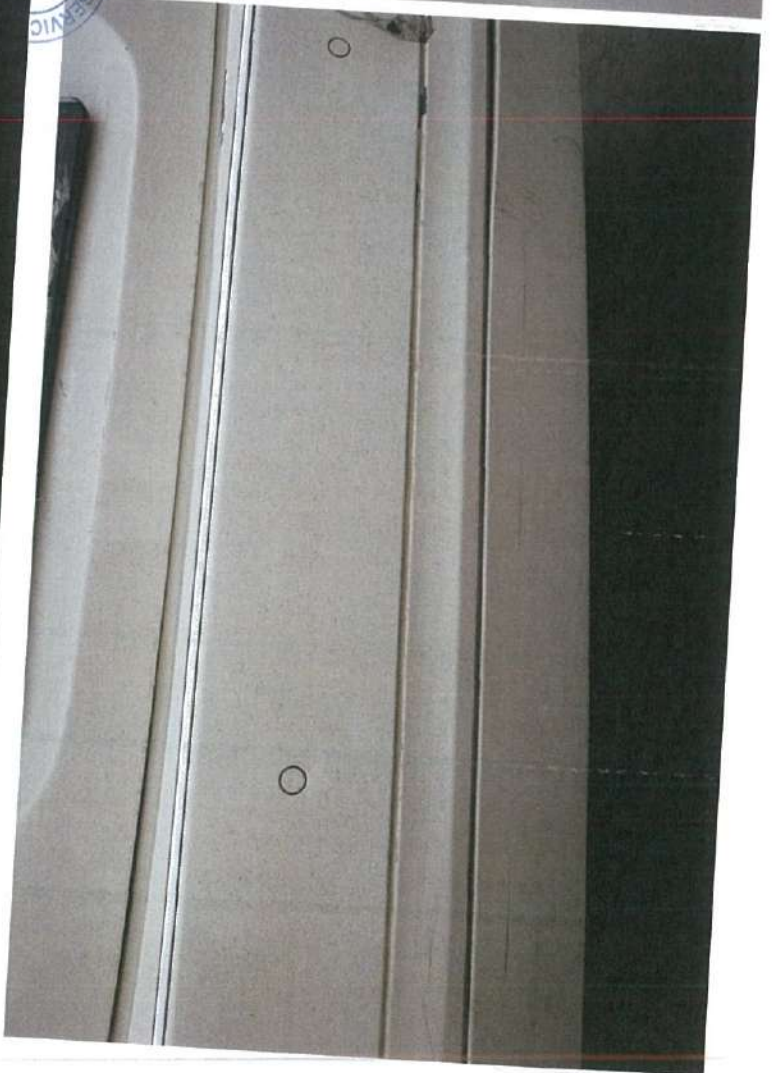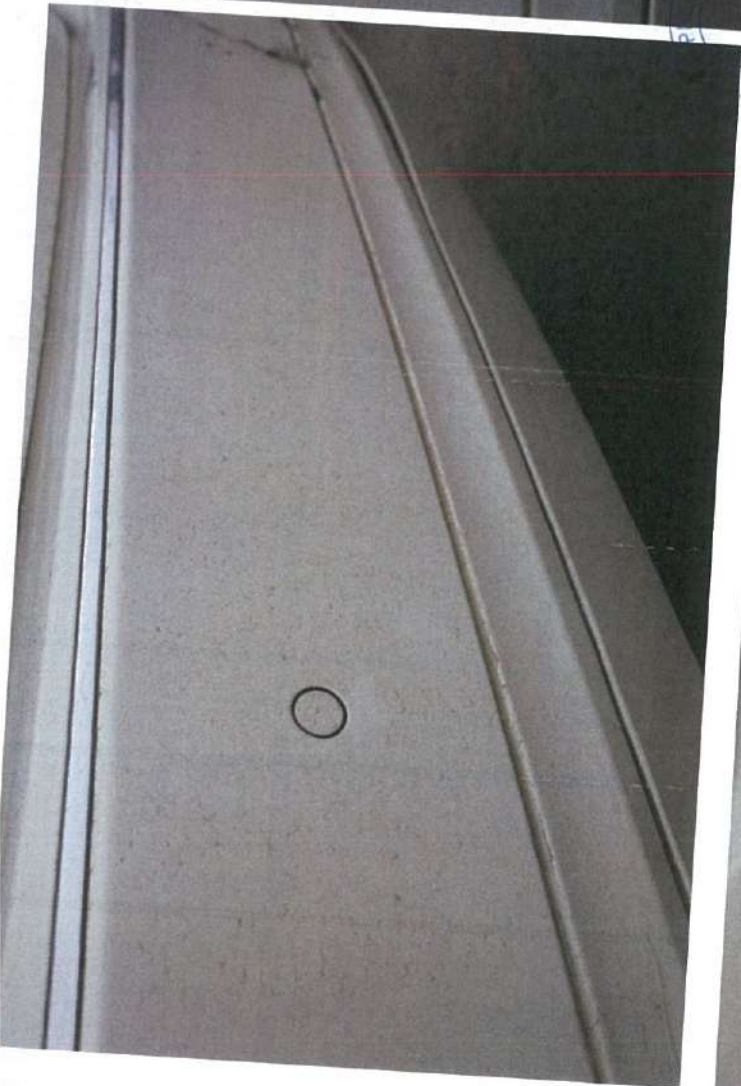



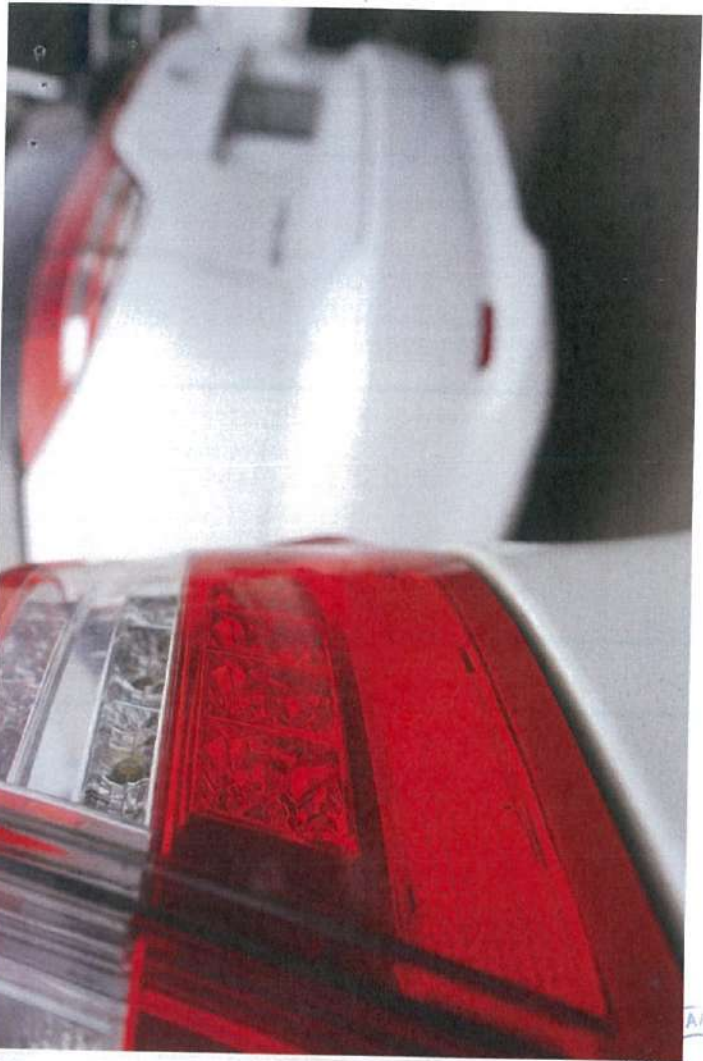













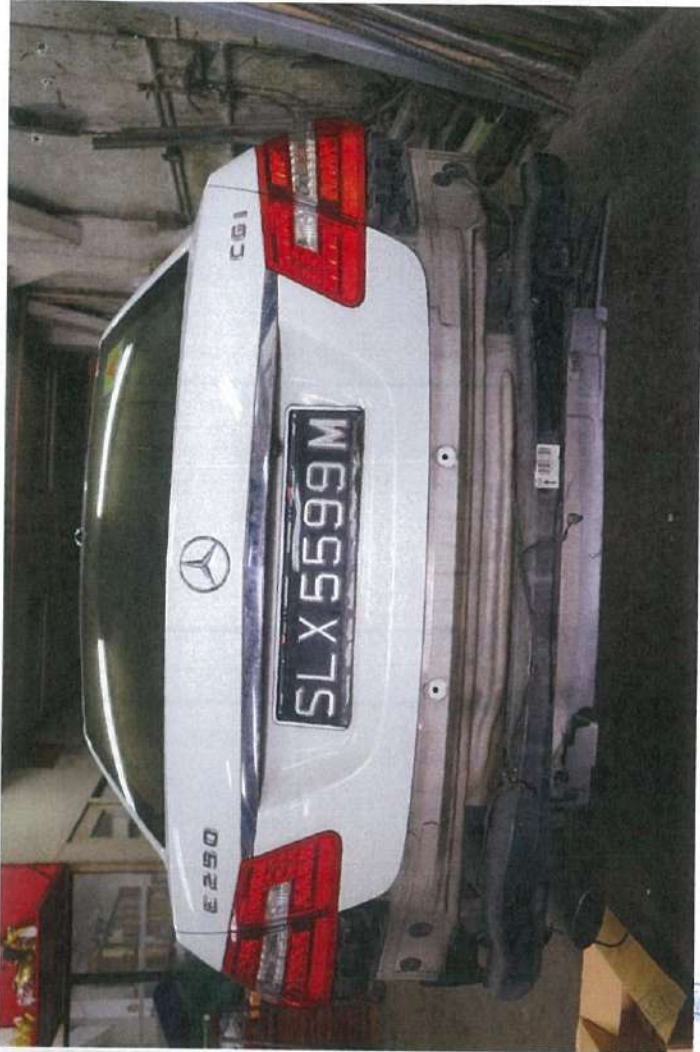



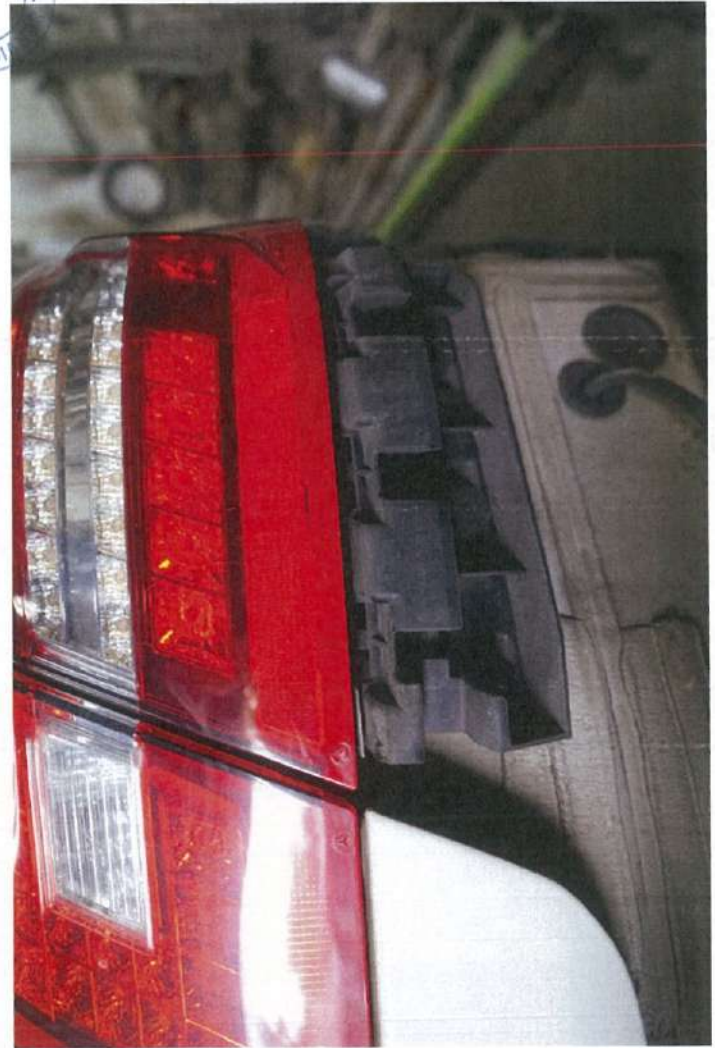





APPRaisal

