



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2006204
INV Date 09/09/2020
Reference CC3/LPC20006044/Kba3s2
Code LPC2



PROFESSIONAL SERVICE FEE

Vehicle No. SHD 5271K
Insured Veh. YP 6405X
Claim No. 10/20/20/VC05/023367
Policy No. Z20VC05004740
Accident Date 27/05/2020
Inspection Date 28/05/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

Ref : CC3/LPC20006044/Kba3s2

300 BEACH ROAD
#17-04/07 THE CONCOURSESINGAPORE 199555

Date : 09-09-2020



Code : LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	YP 6405X	Veh. Inspected	SHD 5271K
Policy No.	Z20VC05004740	Coverage (\$)	0.00
Claim No.	10/20/20/VC05/023367	Excess (\$)	0.00
Assign From		Assign Date	28/05/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	JTDKB3FU003079117	Colour	METALLIC WHITE / RED
Odometer	178952	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	SAILUN	9 mm
L/H Front Tyre	195/65 R15	SAILUN	9 mm
R/H Rear Tyre	195/65 R15	SAILUN	9 mm
L/H Rear Tyre	195/65 R15	SAILUN	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	27/05/2020	Inspection Date	28/05/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **2.500 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 5271K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	PANEL SUB-ASSY, FRONT DOOR, LH	TO REPAIR SEE LABOUR	1,300.70	-
1	HINGE ASSY, FRONT DOOR, UPPER LH	TO REPAIR SEE LABOUR	97.50	-
1	HINGE ASSY, FRONT DOOR, LOWER LH	TO REPAIR SEE LABOUR	110.60	-
1	CHECK ASSY, FRONT DOOR	SERVICEABLE	183.80	-
1	WEATHERSTRIP, FRONT DOOR LH	SERVICEABLE	231.30	-
1	TAPE, BLACK OUT, NO.1 FRT LH	NOT NECESSARY	13.30	-
1	TAPE, BLACK OUT, NO.2 FRT LH	NOT NECESSARY	43.50	-
1	TAPE, BLACK OUT, NO.3 FRT LH	NOT NECESSARY	26.30	-
1	LEFT SIDE VIEW MIRROR	CRACKED	1,339.30	1,339.30
1	COVER, OUTER MIRROR, LH	SERVICEABLE	108.60	-
1	MIRROR OUTER, LH	TO REPAIR SEE LABOUR	148.70	-
1	DOOR HARNESS WIRE LH	SERVICEABLE	532.80	-
1	MOULDING ASSY, BODY ROCKER PANEL, LH	SERVICEABLE	594.80	-
1	FRONT BUMPER	SERVICEABLE	516.00	-
1	FRONT BUMPER SIDE RETAINER LH	SERVICEABLE	82.30	-
1	FRONT BONNET	TO REPAIR SEE LABOUR	983.10	-
1	FRONT LED LAMP (LOWER) LH	SERVICEABLE	951.40	-
1	FRONT HEADLAMP LH	SERVICEABLE	2,637.60	-
1	FRONT FENDER LH	TO REPAIR SEE LABOUR	977.80	-
1	LINER, FRONT FENDER, LH	SERVICEABLE	206.70	-
1	FRONT FENDER EMBLEM LH	NECESSARY	54.60	54.60
	LESS 25% DISCOUNT		-2,785.17	-348.47
			8,355.53	1,045.43
<u>SPECIAL NETT ITEMS</u>				
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NECESSARY	100.00	60.00
1	FRONT WHEEL RIM (SN)	SERVICEABLE	1,879.40	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT WHEEL RIM COVER (SN)	SERVICEABLE	211.50	-
1	FRONT TYRE 195/65/15 (SN)	SERVICEABLE	350.00	-
1	SET FRONT BUMPER RETAINER CLIP (SN)	NOT NECESSARY	39.00	-
1	SET FRONT FENDER LINER CLIP (SN)	NOT NECESSARY	38.00	-
1	SET FRONT BUMPER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	45.00	-
			2,731.90	60.00
	LABOUR			
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	PANEL BEATING, KNOCKING AND STRAUGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY, FRONT DOOR, LH; HINGE ASSY, FRONT DOOR, UPPER LH; HINGE ASSY, FRONT DOOR, LOWER LH; MIRROR OUTER, LH; FRONT BONNET AND FRONT FENDER LH.		6,000.00	350.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	700.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO TRANSFER OF FRONT BUMPER FITTINGS, ATTACHMENT TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT FENDER FITTINGS, ATTACHMENT TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT BONNET FITTINGS, ATTACHMENT TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
			14,170.00	1,070.00
	GRAND TOTAL		25,257.43	2,175.43



RECOMMENDED COST OF REPAIRS			2,175.43
-----------------------------	--	--	----------

Report Ref No. CC3/LPC20006044/Kba3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5271K

INSPECTION

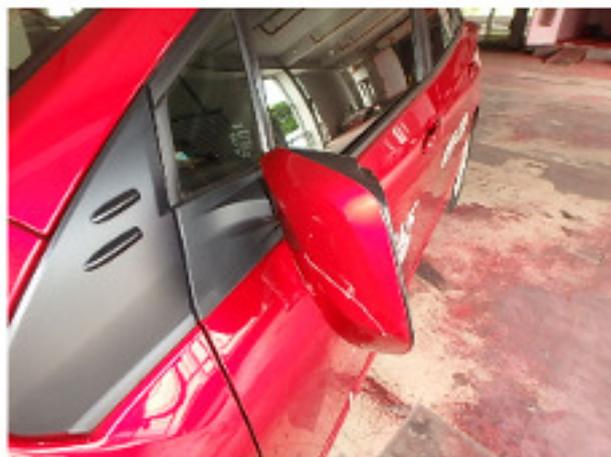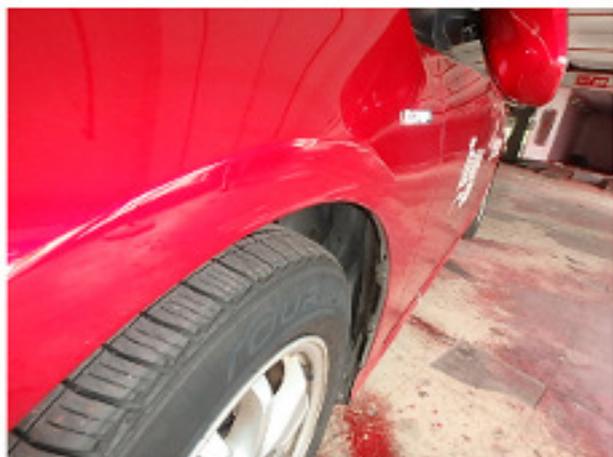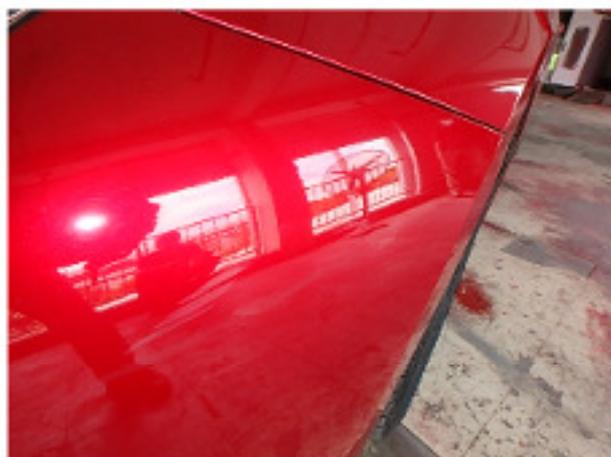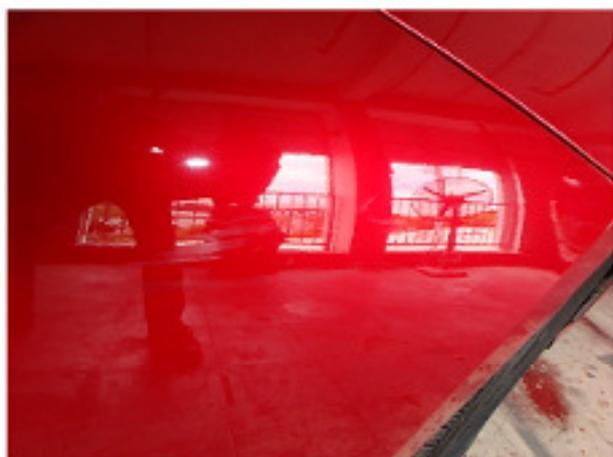





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

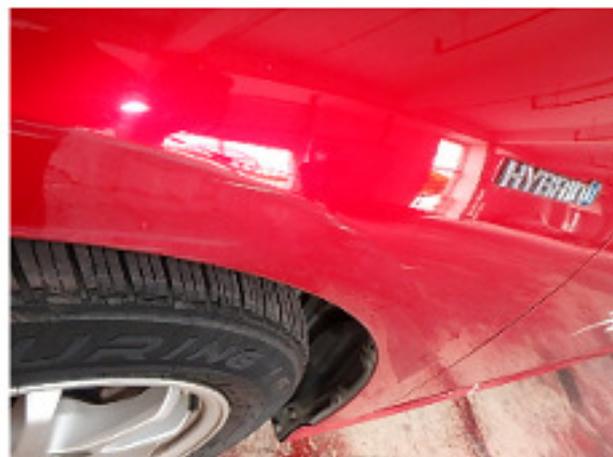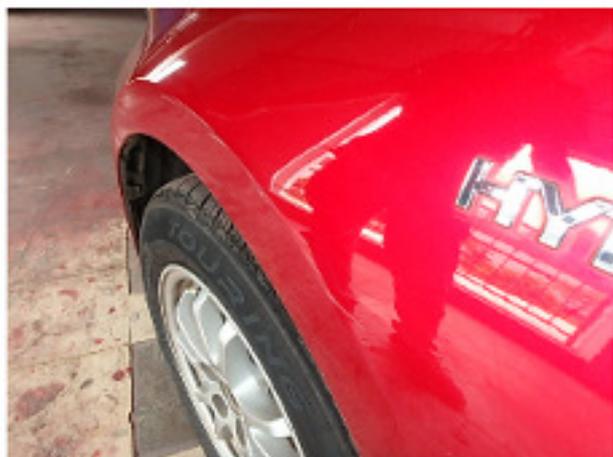



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

