



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006808
INV Date 02/10/2020
Reference CC3/FCI20006068/Kes3q2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9354D
Insured Veh. SHD 3060R
Claim No. D20002303MFSH
Policy No. D-18088936MFSH
Accident Date 28/05/2020
Inspection Date 01/06/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CC3/FCI20006068/Kes3q2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 02-10-2020



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 3060R	Veh. Inspected	SHD 9354D
Policy No.	D-18088936MFSH	Coverage (\$)	0.00
Claim No.	D20002303MFSH	Excess (\$)	0.00
Assign From		Assign Date	01/06/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	JTDKB3FU803079382	Colour	M.P. WHITE / RED
Odometer	118177	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	SAILUN	9 mm
L/H Front Tyre	195/65 R15	SAILUN	9 mm
R/H Rear Tyre	195/65 R15	GITI	9 mm
L/H Rear Tyre	195/65 R15	GITI	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/05/2020	Inspection Date	01/06/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **2 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9354D

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BUCKLED	442.60	442.60
1	REAR BUMPER RE-INFORCEMENT	TO REPAIR SEE LABOUR	332.70	-
1	REAR BUMPER TOWING COVER	SERVICEABLE	15.40	-
1	GUARD,REAR BUMPER,CENTER	DENTED / CUT	576.30	576.30
1	REAR BUMPER SIDE RETAINER LH	SERVICEABLE	116.50	-
1	REAR BUMPER SIDE RETAINER RH	SERVICEABLE	117.70	-
1	REAR TAILGATE	TO REPAIR SEE LABOUR	1,147.80	-
1	REAR TAILGATE OUTER GARNISH	SERVICEABLE	925.60	-
1	REAR TAILGATE WEATHERSTRIP	SERVICEABLE	372.30	-
1	PANEL SUB-ASSY,BODY LOWER BACK	SERVICEABLE	650.30	-
1	TAILLAMP LOWER RH	SERVICEABLE	502.00	-
1	TAILLAMP UPPER RH	SERVICEABLE	451.80	-
1	REAR BUMPER SIDE RH	SERVICEABLE	123.70	-
1	REAR BUMPER SIDE LH	SERVICEABLE	123.70	-
1	TAILLAMP LOWER LH	CRACKED	502.00	502.00
1	TAILLAMP UPPER LH	SERVICEABLE	443.30	-
1	COVER,DECK TRIM,REAR	SERVICEABLE	126.70	-
1	COVER,FLOOR UNDER,NO 1	SERVICEABLE	175.10	-
1	COVER,FLOOR UNDER,NO 2	SERVICEABLE	241.90	-
1	COVER,REAR FLOOR	SERVICEABLE	229.90	-
	LESS 25% DISCOUNT		-1,904.32	-380.22
			5,712.98	1,140.68
<u>SPECIAL NETT ITEMS</u>				
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	69.00	69.00
1	REAR TAILGATE TOYOTA LOGO (SN)	NOT NECESSARY	47.00	-
1	REAR TAILGATE WORDING "PRIUS" (SN)	NOT NECESSARY	52.90	-
1	REAR TAILGATE WORDING "HYBRID" (SN)	NOT NECESSARY	53.50	-
1	REAR TAILGATE STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-

Report Ref No. CC3/FCI20006068/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TAILGATE STICKER "6555-3333" (SN)	NOT NECESSARY	80.00	-
1	REAR BUMPER PROTECTOR (SN)	NECESSARY	120.00	30.00
1	REAR WHEEL RIM (SN)	SERVICEABLE	1,879.40	-
1	REAR TYRE 195/65/15 (SN)	SERVICEABLE	350.00	-
1	REAR WHEEL RIM COVER (SN)	SERVICEABLE	211.50	-
1	REAR RH BUMPER RETAINER CLIP (SN)	NOT NECESSARY	38.00	-
1	REAR LH BUMPER RETAINER CLIP (SN)	NOT NECESSARY	38.00	-
1	SET TAILLAMP LOWER CLIP (SN)	NOT NECESSARY	33.00	-
1	SET TAILLAMP UPPER CLIP (SN)	NOT NECESSARY	33.00	-
1	REAR LICENCE PLATE WITH MOULDING (SN)	NOT NECESSARY	100.00	-
			3,885.30	99.00
<u>LABOUR</u>				
	TO TRANSFER OF TAILGATE FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR BUMPER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF REAR BUMPER RE-INFORCEMENT AND REAR TAILGATE.		6,000.00	200.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	280.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	50.00
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-

Report Ref No. CC3/FCI20006068/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			14,170.00	550.00
	GRAND TOTAL		23,768.28	1,789.68
	RECOMMENDED COST OF REPAIRS			1,789.68

Report Ref No. CC3/FCI20006068/Kes3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9354D

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

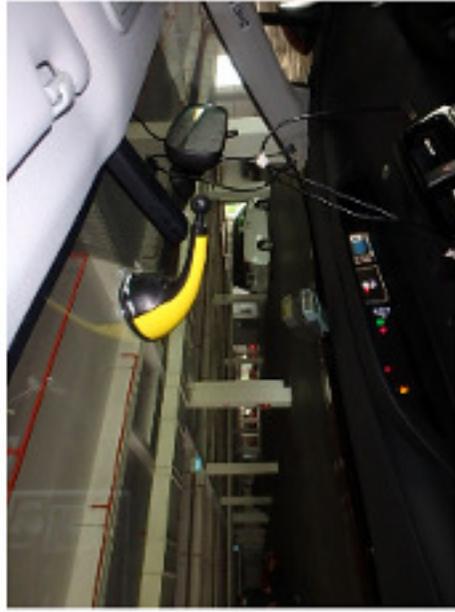



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9354D

RE-INSPECTION

