



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102194

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 05/04/2021
Reference CC4/FCI20006364/T1gs3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 176J
Insured Veh. SHA 5300B
Claim No. D20002398MFSH
Policy No. D-20094922MFSH
Accident Date 10/06/2020
Inspection Date 17/06/2020

Description	Total
Third Party Express Settlement	350.00
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20006364/T1gs3q2	
			Date: 05/04/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 5300B	Veh. Inspected	SKZ 176J	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20002398MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	17/06/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL HYBRID	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	RU31115657	Colour	WHITE	
Odometer	678296 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R15	A-PLUS	6 mm	
L/H Front Tyre	215/60 R15	A-PLUS	6 mm	
R/H Rear Tyre	215/60 R15	A-PLUS	6 mm	
L/H Rear Tyre	215/60 R15	A-PLUS	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	10/06/2020	Inspection Date	17/06/2020	
Survey held at	EM-1 AUTO PTE LTD BLK 8 SIN MING INDUSTRIAL ESTATE SECTOR C #01-68 SINGAPORE 575643			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 176J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	TO REPAIR SEE LABOUR	1,265.00	-
1	TAILGATE BADGE	NOT NECESSARY	58.00	-
1	TAILGATE EMBLEM VEZEL	NECESSARY	65.00	65.00
1	TAILGATE EMBLEM HYBRID	NECESSARY	68.00	68.00
1	TAILGATE WEATHERSTRIP	DEFORMED	190.00	190.00
1	REAR BUMPER	DEFORMED	980.00	777.90
2	REAR BUMPER SIDE RETAINERS @\$42.00	N/S NOT NECESSARY / O/S DEFORMED	84.00	42.00
2	REAR BUMPER ATTACHMENT RETAINERS @\$39.00	N/S NOT NECESSARY / O/S DEFORMED	78.00	39.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	30.00
1	REAR BUMPER SIDE PAD RH	DEFORMED	275.00	275.00
1	REAR BUMPER UNDER COVER	NOT NECESSARY	196.00	-
1	SET REAR BUMPER UNDER COVER CLIPS	NOT NECESSARY	30.00	-
1	END PANEL	BENT	652.00	515.60
1	END PANEL TOP TRIM	DEFORMED	176.00	176.00
1	SET END PANEL TOP TRIM CLIPS	NECESSARY	30.00	10.00
1	SPARE TYRE PANEL TOP BOARD	NOT NECESSARY	462.00	-
1	SPARE TYRE PANEL TOP TRAY	DEFORMED	381.00	381.00
1	ALARM SENSOR SPEAKER	NOT NECESSARY	150.00	-
1	TAILLAMPS RH	NOT NECESSARY	680.00	-
1	TAILLAMP INNER SEALER	NOT NECESSARY	38.00	-
1	SET TAILLAMPS CLIP	NOT NECESSARY	25.00	-
1	REAR FENDER INNER TRIM RH	CRACKED	335.00	335.00
1	SET REAR FENDER INNER TRIM CLIPS	NECESSARY	30.00	30.00
1	REAR FENDER ARCH GARNISH RH	DEFORMED	195.00	195.00
1	SET REAR FENDER ARCH GARNISH CLIP	NECESSARY	30.00	10.00
	LESS 20% DISCOUNT		-1,304.60	-627.90
			5,218.40	2,511.60

Report Ref No. CC4/FCI20006364/T1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET REVERSE SENSOR (SN)	NOT WORKING	250.00	200.00
1	SET BODY PANEL JOINT SEALANT (SN)	NECESSARY	120.00	40.00
			370.00	240.00
	<u>LABOUR</u>			
	PANEL BEATING .INCLUSIVE OF THE REPAIR OF TAILGATE .		1,000.00	600.00
	SPRAY PAINTING -2 TONE PEARL.		1,000.00	800.00
	CHECK WIRING .		30.00	30.00
	ANTI RUST.		80.00	30.00
	REMOVE AND INSTALL CARPET AND SEAT.		100.00	50.00
	REMOVE AND INSTALL REVERSE SENSOR .		90.00	30.00
			2,300.00	1,540.00
	GRAND TOTAL		7,888.40	4,291.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,400.00

Report Ref No. CC4/FCI20006364/T1gs3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 176J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

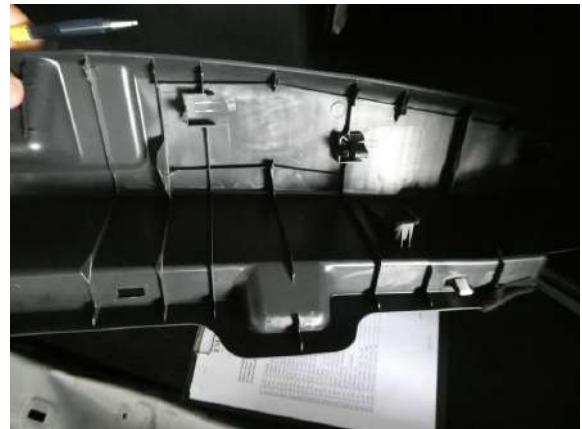



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 176J

RE-INSPECTION

