



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

INDIA INTERNATIONAL INSURANCE PL  
64 CECIL STREET  
#05-02 IOB BUILDING  
SINGAPORE 049711

INV No. AC2006712  
INV Date 29/09/2020  
Reference CC3/III15007251/K1pa3s2-1  
Code III2



#### PROFESSIONAL SERVICE FEE

Vehicle No. SHB 7829A  
Insured Veh. SHD 1200S  
Claim No.  
Policy No. MPRE0003  
Accident Date 24/04/2015  
Inspection Date 28/04/2015

Description	Total
Survey Inspection	600.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Less:AC1703079 DD 21/03/2017	-450.00
<b>Subtotal</b>	<b>150.00</b>
<b>GST (7%)</b>	<b>10.50</b>
<b>Grand Total</b>	<b>160.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### Affiliated to Federation Internationale Des Experts En Automobile

INDIA INTERNATIONAL INSURANCE PL

Ref : CC3/III15007251/K1pa3s2-1

64 CECIL STREET  
#05-02 IOB BUILDING SINGAPORE 049711

Date : 29-09-2020



Code : III2

### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHD 1200S	Veh. Inspected	SHB 7829A
Policy No.	MPRE0003	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	28/04/2015

### 2. Vehicle Particulars & Condition

Make & Model	CHEVROLET EPICA	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2012
Chassis No.	KL1LA69RJBB098520	Colour	RED
Odometer	430764	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/60R15	FALKEN	7 mm
L/H Front Tyre	195/60R15	FALKEN	7 mm
R/H Rear Tyre	195/60R15	FALKEN	7 mm
L/H Rear Tyre	195/60R15	FALKEN	7 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND REAR O/S PORTION. DAMAGES SEE DETAILS.
---

### 5. General Information

Accident Date	24/04/2015	Inspection Date	28/04/2015
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>12 Working Days</b>
-------------------------------------	------------------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 7

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 7829A

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT BUMPER	TO REPAIR SEE LABOUR	1,202.00	-
1	FRONT BUMPER LOWER ABSORBER	SERVICEABLE	180.00	-
1	FRONT BUMPER REINFORCEMENT	SERVICEABLE	356.00	-
1	FRONT BUMPER RETAINER RH	SERVICEABLE	102.00	-
1	FRONT BUMPER RETAINER LH	SERVICEABLE	102.00	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	78.00	-
1	FRONT BUMPER LOWER STIFFENER	SERVICEABLE	134.37	-
1	FRONT BUMPER FOG LAMP OUTER COVER RH	SERVICEABLE	32.40	-
1	FRONT BUMPER FOG LAMP OUTER COVER LH	SERVICEABLE	32.40	-
1	FRONT SUPPORT PANEL ASSY	SERVICEABLE	1,222.32	-
1	HEADLAMP RH (LAMP A-HEAD RH)	SERVICEABLE	816.00	-
1	HEADLAMP LH (LAMP A-HEAD LH)	SERVICEABLE	816.00	-
1	BONNET (PANEL A-HOOD)	SERVICEABLE	1,250.00	-
1	BONNET MOULDING	SERVICEABLE	257.00	-
1	CENTRE 'CHEVROLET' LOGO BADGE	NOT NECESSARY	144.30	-
1	BONNET LOCK	SERVICEABLE	60.00	-
1	RADIATOR ASSEMBLY	SERVICEABLE	618.00	-
1	RADIATOR GRILLE	SERVICEABLE	367.00	-
1	RADIATOR GRILLE TOP COVER	SERVICEABLE	45.02	-
1	FAN BLADE (SMALL)	SERVICEABLE	536.00	-
1	FAN BLADE (BIG)	SERVICEABLE	634.00	-
1	AIRCON CONDENSER	SERVICEABLE	600.00	-
1	AIR INTERCOOLER	SERVICEABLE	652.00	-
1	FRONT FENDER RH	SERVICEABLE	837.60	-
1	FRONT FENDER LH	DENTED	837.60	837.60
1	FRONT FENDER LINER RH	SERVICEABLE	47.00	-
1	FRONT FENDER LINER LH	TORN	47.00	47.00
1	FRONT SHOCK ABSORBER ASSY LH	SERVICEABLE	216.17	-
1	FRONT LOWER ARM LH	SERVICEABLE	283.00	-
1	FRONT KNUCKLE ARM LH	SERVICEABLE	230.00	-

Report Ref No. CC3/III15007251/K1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR RH	DENTED	1,133.00	1,133.00
1	FRONT SIDE VIEW MIRROR RH	TO REPAIR SEE LABOUR	939.00	-
1	FRONT DOOR GLASS GUIDE RH CHROME MOULDING	CUT	60.00	60.00
1	FRONT DOOR OUTER MOULDING	CRACKED	220.00	220.00
1	FRONT DOOR OUTER HANDLE	SERVICEABLE	125.00	-
1	FRONT DOOR HANDLE SUPPORT	SERVICEABLE	3.00	-
1	FRONT DOOR OUTER HANDLE INNER SEAL	NECESSARY	89.15	89.15
1	FRONT DOOR OUTER KEY LOCK	SERVICEABLE	25.00	-
1	FRONT DOOR HINGE UPPER	DENTED	65.00	65.00
1	FRONT DOOR HINGE LOWER	DENTED	65.00	65.00
1	FRONT DOOR INNER LOCK	SERVICEABLE	586.00	-
1	FRONT DOOR INNER LOCK LATCH RH	SERVICEABLE	206.00	-
1	FRONT DOOR CHECK / ARRESTOR	SERVICEABLE	67.50	-
1	FRONT DOOR WEATHERSTRIP RH	SERVICEABLE	138.79	-
1	FRONT DOOR GLASS CHANNEL WEATHERSTRIP	SERVICEABLE	160.00	-
1	FRONT DOOR INNER TRIM BOARD	SERVICEABLE	455.69	-
1	FRONT DOOR POWER WINDOW MOTOR (MASTER) RH	JAMMED	284.97	284.97
1	FRONT DOOR POWER WINDOW MOTOR SWITCH	JAMMED	145.00	145.00
1	FRONT DOOR WINDOW REGULATOR GEAR RH	BENT	84.58	84.58
1	OUTER PILLAR PANEL RH	SERVICEABLE	715.00	-
1	PILLAR INNER PANEL RH	SERVICEABLE	850.00	-
1	CENTER PILLAR PANEL RH	SERVICEABLE	698.15	-
1	FRONT SIDE ROCKER PANEL GARNISH RH	TO REPAIR SEE LABOUR	236.40	-
1	FRONT SIDE ROCKER PANEL GARNISH LH	SERVICEABLE	236.40	-
1	FRONT DOOR LH	DENTED	1,133.00	1,133.00
1	FRONT SIDE VIEW MIRROR LH	CRACKED	939.00	939.00
1	FRONT DOOR GLASS GUIDE LH CHROME MOULDING	CUT	60.00	60.00
1	FRONT DOOR OUTER MOULDING	DEFORMED	220.00	220.00
1	FRONT DOOR OUTER HANDLE	CUT	125.00	125.00
1	FRONT DOOR HANDLE SUPPORT	SERVICEABLE	3.00	-
1	FRONT DOOR OUTER HANDLE INNER SEAL	NOT NECESSARY	89.15	-
1	FRONT DOOR OUTER KEY LOCK	SERVICEABLE	25.00	-

Report Ref No. CC3/III15007251/K1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR HINGE UPPER	SERVICEABLE	65.00	-
1	FRONT DOOR HINGE LOWER	SERVICEABLE	65.00	-
1	FRONT DOOR INNER LOCK	SERVICEABLE	586.00	-
1	FRONT DOOR INNER LOCK LATCH LH	SERVICEABLE	206.00	-
1	FRONT DOOR CHECK / ARRESTOR	SERVICEABLE	67.50	-
1	FRONT DOOR WEATHERSTRIP LH	SERVICEABLE	138.79	-
1	FRONT DOOR GLASS CHANNEL WEATHERSTRIP	SERVICEABLE	160.00	-
1	FRONT DOOR INNER TRIM BOARD	SERVICEABLE	455.69	-
1	FRONT DOOR POWER WINDOW MOTOR (MASTER) LH	SERVICEABLE	284.97	-
1	FRONT DOOR POWER WINDOW MOTOR SWITCH	SERVICEABLE	145.00	-
1	FRONT DOOR WINDOW REGULATOR GEAR LH	SERVICEABLE	84.58	-
1	REAR DOOR LH (PANEL A-RR DR LH)	SERVICEABLE	1,133.00	-
1	REAR DOOR RH (PANEL A-RR DR RH)	DENTED	1,133.00	1,133.00
1	REAR DOOR TOP HINGE RH	SERVICEABLE	35.00	-
1	REAR DOOR BOTTOM HINGE RH	SERVICEABLE	35.00	-
1	REAR DOOR INNER LOCK RH	SERVICEABLE	425.00	-
1	REAR DOOR CHECK / ARRESTOR RH	SERVICEABLE	65.00	-
1	REAR DOOR OUTER WEATHERSTRIP MOULDING RH	SERVICEABLE	85.00	-
1	REAR DOOR OUTER HANDLE RH	SERVICEABLE	60.00	-
1	REAR DOOR OUTER HANDLE - RUBBER SEAL RH	NOT NECESSARY	25.00	-
1	REAR DOOR INNER OPENING HANDLE RH	SERVICEABLE	45.50	-
1	REAR DOOR INNER TRIM BOARD RH	SERVICEABLE	455.69	-
1	REAR DOOR CHANNEL WEATHERSTRIP / FELT RH	SERVICEABLE	89.50	-
1	REAR DOOR POWER WINDOW MOTOR (MASTER) RH	JAMMED	274.97	274.97
1	REAR DOOR REGULATOR GEAR RH	BENT	55.30	55.30
1	REAR BUMPER	DEFORMED	1,202.00	1,202.00
1	REAR BUMPER BEAM	BENT	239.94	239.94
1	REAR BUMPER CENTRE ABSORBER	TORN	260.00	260.00
1	REAR BUMPER SIDE RETAINER RH	CRACKED	68.76	68.76
1	REAR BUMPER SIDE RETAINER LH	CRACKED	68.76	68.76
1	REAR BUMPER REFLECTORS RH	CRACKED	119.74	119.74
1	REAR BUMPER REFLECTORS LH	SERVICEABLE	119.74	-
1	REAR BUMPER TOW HOOK COVER	MISSING	93.00	93.00

Report Ref No. CC3/III15007251/K1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LUGGAGE FLOOR PANEL	DENTED	973.00	973.00
1	REAR LUGGAGE FLOOR PANEL INSULATOR	NECESSARY	63.50	63.50
1	REAR LUGGAGE FLOOR PANEL TRIM BOARD	CRACKED	378.00	378.00
1	REAR END PANEL OUTER	DENTED	623.76	623.76
1	REAR END PANEL INNER TRIM	CRACKED	263.84	263.84
1	BOOTLID	TO REPAIR SEE LABOUR	973.00	-
1	BOOTLID INNER TRIM BOARD	SERVICEABLE	400.00	-
1	BOOTLID WEATHERSTRIP	SERVICEABLE	344.28	-
1	BOOTLID LOCK - TOP	SERVICEABLE	466.56	-
1	BOOTLID LOCK - BOTTOM	SERVICEABLE	39.40	-
1	BOOTLID 'CHEVROLET' BADGE	NECESSARY	120.62	120.62
1	BOOTLID LOGO	NECESSARY	138.84	138.84
1	BOOTLID 'EPICA LT' BADGE	NECESSARY	119.84	119.84
1	BOOTLID REFLECTOR CENTRE	SERVICEABLE	217.97	-
1	BOOTLID REFLECTOR RH	CRACKED	128.40	128.40
1	BOOTLID REFLECTOR LH	SERVICEABLE	128.40	-
1	REAR GAS T/GATE SPRING RH	SERVICEABLE	286.90	-
1	REAR GAS T/GATE SPRING LH	SERVICEABLE	286.90	-
1	BOOTLID HINGE RH	SERVICEABLE	120.00	-
1	BOOTLID HINGE LH	SERVICEABLE	120.00	-
1	REAR TAIL LAMP RH	BROKEN	479.30	479.30
1	REAR TAIL LAMP PANEL RH	DENTED	359.00	359.00
1	REAR TAIL LAMP LH	SERVICEABLE	479.30	-
1	REAR TAIL LAMP PANEL LH	SERVICEABLE	359.00	-
1	REAR EXHAUST BOX (MUFFLER A-EXH,RR)	SERVICEABLE	1,110.00	-
1	REAR FENDER RH	DENTED	1,145.00	1,145.00
1	REAR FENDER INNER COWLING RH	TORN	298.00	298.00
1	REAR FENDER INNER TRIM RH	TORN	418.44	418.44
1	REAR FENDER INNER WHEEL HOUSE PANEL RH	DENTED	2,556.35	2,556.35
1	REAR FENDER LH	SERVICEABLE	1,145.00	-
1	LONGITUDINAL A-RR RH	SERVICEABLE	709.20	-
1	REAR SHOCK ABSORBER RH	SERVICEABLE	243.57	-

Report Ref No. CC3/III15007251/K1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR AXLE HOUSING (AXLE A-RR)	SERVICEABLE	711.00	-
1	PARALLEL LINK RR (LINK A-PARALLEL RR)	SERVICEABLE	93.00	-
1	PARALLEL LINK FRT (LINK A-PARALLEL FRT)	SERVICEABLE	93.00	-
1	STABILIZER BAR RR (BAR RR STABILIZER)	SERVICEABLE	97.00	-
1	TRAILING LINK RR RH (LINK A-TRAILING RR RH)	SERVICEABLE	90.00	-
1	UPR ARM RH (ARM A-UPR RH)	SERVICEABLE	343.00	-
1	REAR KNUCKLE ARM RH	SERVICEABLE	350.00	-
	LESS 10% DISCOUNT		-4,853.78	-1,708.97
			43,683.98	15,380.69
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET FRONT BUMPER FASTENER CLIP (SN)	NOT NECESSARY	24.00	-
1	SET RADIATOR GRILLE TOP COVER CLIP (SN)	NOT NECESSARY	10.00	-
1	CANS RADAITOR COOLANT (SN)	NOT NECESSARY	60.00	-
1	SET RADIATOR GRILLE CLIP (SN)	NOT NECESSARY	35.00	-
1	SET BONNET UNDER WEATHERSTRIP SEAL CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET BONNET INSULATOR CLIP (SN)	NOT NECESSARY	30.00	-
2	BONNET STOPPER (SN)	NOT NECESSARY	15.00	-
2	SET FRONT FENDER LINER CLIP (SN)	N/S NECESSARY / O/S NOT NECESSARY	60.00	30.00
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	DOOR STICKER "TRANS-CAB" LH (SN)	NECESSARY	80.00	80.00
1	DOOR STICKER "6555-3333" LH (SN)	NOT NECESSARY	80.00	-
1	DOOR STICKER "TRANS-CAB" RH (SN)	NECESSARY	80.00	80.00
1	DOOR STICKER "6555-3333" RH (SN)	NECESSARY	80.00	80.00
1	SET REAR BUMPER PARKING SENSOR (SN)	SHORTED	300.00	300.00
1	SET REAR BUMPER FASTENER CLIP (SN)	NECESSARY	30.00	30.00
1	REAR BOOT STICKER "TRANS-CAB" (SN)	NECESSARY	30.00	30.00
1	REAR BOOT STICKER "6555-3333" (SN)	NECESSARY	30.00	30.00
1	SET BOOTLID INNER TRIM BOARD CLIP (SN)	NOT NECESSARY	40.00	-
1	REAR EXHAUST MOUNTING (SN)	SERVICEABLE	10.00	-
1	SET REAR FENDER INNER TRIM CLIP RH (SN)	NECESSARY	30.00	30.00
1	SET REAR FENDER INNER TRIM CLIP LH (SN)	NOT NECESSARY	30.00	-

Report Ref No. CC3/III15007251/K1wa3s2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR FENDER INNER COWLING LH CLIP (SN)	NOT NECESSARY	30.00	-
1	SET REAR FENDER INNER COWLING RH CLIP (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER END DUST COVER CLIP (SN)	NECESSARY	30.00	30.00
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	100.00
1	REAR TYRE RH (SN)	SERVICEABLE	360.00	-
1	REAR WHEEL RIM RH (SN)	DENTED	254.00	254.00
1	HUB CUP RIM (SN)	NOT NECESSARY	35.00	-
1	FRONT WHEEL RIM HUB CAP LH (SN)	SERVICEABLE	166.30	-
1	FRONT TYRE LH (SN)	SERVICEABLE	180.00	-
1	FRONT TYRE RIM LH (SN)	SERVICEABLE	126.00	-
			2,575.30	1,164.00
	<b>LABOUR</b>			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF FRONT BUMPER, FRONT SIDE VIEW MIRROR RH, FRONT SIDE ROCKER PANEL GARNISH RH AND BOOTLID.		16,800.00	2,000.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	60.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	60.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		16,200.00	1,600.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.		380.00	150.00
	TO REMOVE AND REFIT REAR W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		170.00	100.00
	TO TRANSFER OF LUGGAGE PANEL FITTINGS AND CONDUCT WATER SEEPAGE TEST.		170.00	60.00
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00

Report Ref No. CC3/III15007251/K1wa3s2





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.		170.00	60.00
	TO DISMANTLE AND REFIT REAR UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	REMOVE AND RENEWAL OF PARTS, FINAL CHECKING AND TESTING.		380.00	60.00
	TO DROP AXLE ASSY, REMOVE AND RENEWAL OF THE NECESSARY PARTS.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT, VACUUM AND CHARGE-IN-GAS.	NOT NECESSARY	380.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	NOT NECESSARY	380.00	-
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.	NOT NECESSARY	380.00	-
	TOWING FEE.		120.00	70.00
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
			38,090.00	4,340.00
<b>GRAND TOTAL</b>			<b>84,349.28</b>	<b>20,884.69</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>16,700.00</b>

Report Ref No. CC3/III15007251/K1wa3s2

KALVIN ANG WEI KUN

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 7829A

INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

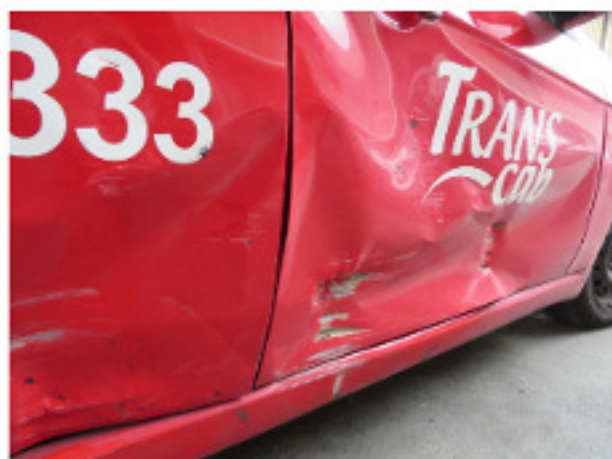






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

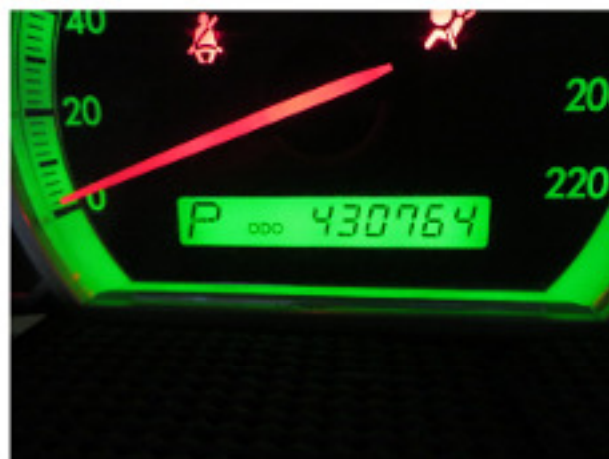





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 7829A

RE-INSPECTION

