

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL (BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRE SINGAPORE 239924

INV No. AC2007024

INV Date 16/10/2020

Reference CS/AGI20007048/Ksf3q2

Code AGI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 5385R

Insured Veh. SLH 712U

Claim No. C10006640

Policy No.

Accident Date 05/07/2020

Inspection Date 07/07/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Rea. No: 199607198R GST Rea. No. 19-9607198-R

	Reg. No: 199607198R GST Reg. No. 19-9607198-R			
		Affiliated to Federation Internation	nale Des Experts En Automobi	le
AUT	JTO & GENERAL INSURANCE (S) PL Ref : CS/AGI20007048/Ksf3q2			
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date: 16-10-2020		
			Code: AGI	
1.		Policy Particulars	:- THIRD PARTY CLAIM	
	Insured Veh.	SLH 712U	Veh. Inspected	SHD 5385R
	Policy No.		Coverage (\$)	0.00
	Claim No.	C10006640	Excess (\$)	0.00
	Assign From	IVY RATILLA	Assign Date	07/07/2020
2.		Vehicle Partic	culars & Condition	
	Make & Model	TOYOTA PRIUS (A)	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2019
	Chassis No.	JTDKB3FU903078922	Colour	METALLIC WHITE / RED
	Odometer	188269	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3.		Condition	ons of Tyres	
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	9 mm
	L/H Front Tyre	195/65 R15	SAILUN	9 mm
	R/H Rear Tyre	195/65 R15	SAILUN	9 mm
	L/H Rear Tyre	195/65 R15	SAILUN	9 mm
4.		Description	on of Damages	
	THE VEHICLE SU	STAINED DAMAGES AT THE N/S	FRONT PORTION.	
	DAMAGES SEE D	ETAILS.		
5.		General	Information	
	Accident Date	05/07/2020	Inspection Date	07/07/2020
	Survey held at	TRANS-CAB AUTO SERVICES	PTE LTD	
		NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a.		Re	emarks	
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b.		Estimate	Days of Repair	
	1			

2 Working Days

ESTIMATED NORMAL PERIOD FOR REPAIR:



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 5385R

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	BUCKLED	516.00	516.00
1	REINFORCEMENT ,FRONT BUMPER	TO REPAIR SEE LABOUR	716.60	-
1	REINFORCEMENT ,FRONT BUMPER ,NO.2	TO REPAIR SEE LABOUR	246.10	-
1	ABSORBER ,FRONT BUMPER ,LOWER	SERVICEABLE	132.70	-
1	ABSORBER ,FRONT BUMPER ENERGY	SERVICEABLE	79.60	-
1	FRONT BUMPER SIDE RETAINER LH	DISTORTED	82.30	82.30
1	COVER SUB-ASSY ,ENGINE NO.1	SERVICEABLE	472.40	-
1	COVER SUB-ASSY ,ENGINE UNDER ,NO.2	SERVICEABLE	241.90	-
1	EXTENSION ,FRONT BUMPER ,LH	SERVICEABLE	120.10	-
1	FRONT LED LAMP (LOWER) LH	CUT	951.40	951.40
1	FRONT HEADLAMP LH	SERVICEABLE	2,637.60	-
1	COMPUTER SUB-ASSY ,HEADLAMP ,LH NO.1	SERVICEABLE	960.50	-
1	MOTOR, HEADLAMP LEVELING ,LH	SERVICEABLE	487.50	-
1	FRONT FENDER LH	BENT	977.80	977.80
1	LINER ,FRONT FENDER ,LH	CRACKED	206.70	206.70
1	EMBLEM ,SIDE PANEL	NECESSARY	54.60	54.60
1	GRILLE SUB-ASSY ,RADIATOR	SERVICEABLE	346.00	-
1	GRILLE ,RADIATOR ,LOWER NO.1	SERVICEABLE	170.10	-
1	EMBLEM ASSY ,RADIATOR GRILLE	SERVICEABLE	90.80	-
1	FRONT BONNET	TO REPAIR SEE LABOUR	983.10	-
1	HINGE ASSY ,HOOD ,LH	TO REPAIR SEE LABOUR	58.90	-
1	COVER ,RADIATOR SUPPORT OPENING	SERVICEABLE	235.30	-
1	BRACKET ,FRONT BUMPER SIDE ,LH	SERVICEABLE	59.30	-
1	BRACKET ,HEADLAMP ,LH	SERVICEABLE	34.80	-
1	STAY SUB-ASSY ,FRONT BUMPER ,LH	SERVICEABLE	47.50	-
1	BRACKET ,FRONT SIDE PANEL ,LH	SERVICEABLE	58.50	-
1	SUPPORT ,RADIATOR ,UPPER LH	SERVICEABLE	78.90	-
1	SUPPORT SUB-ASSY ,RADIATOR ,LH	SERVICEABLE	245.10	-

Report Ref No. CS/AGI20007048/Ksf3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	BATTERY	SERVICEABLE	1,584.90	-
1	CLAMP SUB ASSY ,BATTERY	SERVICEABLE	115.50	-
1	WIRE ,ENGINE ROOM MAIN	SERVICEABLE	7,323.90	-
1	APRON ASSY ,FRONT FENDER ,LH	SERVICEABLE	176.80	-
1	BRACE SUB-ASSY ,FENDER APRON ,LH	SERVICEABLE	292.50	-
1	MOULDING ASSY ,BODY ROCKER PANEL ,LH	SERVICEABLE	594.80	-
	LESS 25% DISCOUNT		-5,345.13	-697.20
			16,035.37	2,091.60
	SPECIAL NETT ITEMS			
1	FRONT WHEEL RIM (SN)	SERVICEABLE	1,879.40	-
1	FRONT WHEEL RIM COVER (LOCAL REPAIR)(SN)	SCRATCHED	211.50	30.00
1	FRONT TYRE 195/65/15 (SN)	SERVICEABLE	350.00	-
1	SET CLIP ,FRONT FENDER LINER (SN)	NECESSARY	45.00	45.00
1	FRONT NUMBER PLATE WITH MOULDING (SN)	SERVICEABLE	200.00	-
1	SET BUMPER CLIP FRT (SN)	NECESSARY	75.00	75.00
1	SET FRONT BUMPER RETAINER CLIP (SN)	NOT NECESSARY	45.00	-
1	SET ENGINE UNDER COVER CLIP (SN)	NOT NECESSARY	40.00	-
1	SET ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	45.00	-
			2,890.90	150.00
	<u>LABOUR</u>			
	LABOUR CHARGE MOUNT AND DISMANTLE VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF REINFORCEMENT ,FRONT BUMPER,REINFORCEMENT ,FRONT BUMPER,NO.2,FRONT BONNET AND HINGE ASSY,HOOD,LH.		6,000.00	400.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		6,000.00	440.00
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT BUMPER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-

Report Ref No. CS/AGI20007048/Ksf3q2



RECOMMENDED COST OF REPAIRS

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

3,191.60

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO TRANSFER OF BONNET FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT BATTERY ,ELECTRICAL WIRING ,FUSE BOX AND RELAY TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
			14,380.00	950.00
	GRAND TOTAL		33,306.27	3,191.60

Report Ref No. CS/AGI20007048/Ksf3q2

KONG SENG CHEONG

Licensed Appraiser



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5385R

INSPECTION












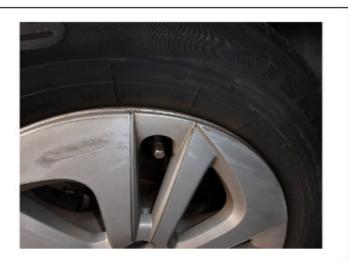



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



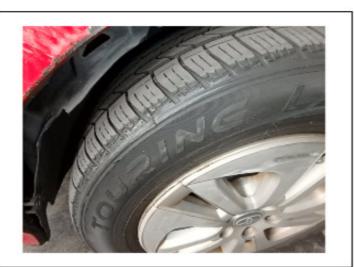





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5385R

RE-INSPECTION





