

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSE

SINGAPORE 068877

INV No. AC2007546

INV Date 11/11/2020

Reference CC4/FCI20007323/R1ea3s2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJJ 6262A

Insured Veh. SHA 9526R

Claim No. D20002687MFSH

Policy No. D-18088937MFSH

Accident Date 06/07/2020

Inspection Date 16/07/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

NSA



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

	Affiliated to Federation Internationale Des Experts En Automobile				
MS F	MS FIRST CAPITAL INSURANCE LTD Ref: CC4/FCI20007323/R1ea3s2				
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date: 11-11-2020 Code: FCI2			
1.		Policy Particulars	:- THIRD PARTY CLAIM		
	Insured Veh.	SHA 9526R	Veh. Inspected	SJJ 6262A	
	Policy No.	D-18088937MFSH	Coverage (\$)	0.00	
	Claim No.	D20002687MFSH	Excess (\$)	0.00	
	Assign From	ERIC WOO	Assign Date	15/07/2020	
2.		Vehicle Partic	culars & Condition		
	Make & Model	MERCEDES BENZ E200 AVG	c.c	1991	
	Engine No.	HIDDEN	Year of Reg.	2018	
	Chassis No.	WDD2130422A402422	Colour	BLUE	
	Odometer	41358	Steering	IN ORDER	
	Brakes	IN ORDER	Modification	SPORTS RIM	
	General	FAIR			
3.		Condition	ons of Tyres		
		Size	Make	Balance	
	R/H Front Tyre	245/45 R18	HANKOOK	6 mm	
	L/H Front Tyre	245/45 R18	HANKOOK	6 mm	
	R/H Rear Tyre	245/45 R18	HANKOOK	6 mm	
	L/H Rear Tyre	245/45 R18	HANKOOK	6 mm	
4.		•	on of Damages		
	THE VEHICLE SU	STAINED DAMAGES AT THE O/S	REAR PORTION.		
	DAMAGES SEE D	ETAILS.			
5.		General	Information		
	Accident Date	06/07/2020	Inspection Date	16/07/2020	
	Survey held at	CYCLE & CARRIAGE INDUSTR	IES (1986) PL		
		188 PANDAN LOOP SINGAPORE 128378 (MERCEDES-BENZ)			
5a.		Re	emarks		
		ON WAS CONDUCTED ON A"WIT CE TO YOUR INSTRUCTIONS, W		REPAIRS.	
5b.	5b. Estimate Days of Repair				
	ESTIMATED NORI	MAL PERIOD FOR REPAIR:	11 Working Days		



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJJ 6262A

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	RIGHT REAR DISK WHEEL (SN)	SCRATCHED	759.71	759.71
1	RIGHT REAR SHOCK ABSORBER (SN)	SERVICEABLE	574.61	-
1	RIGHT REAR WHEEL CARRIER (SN)	BENT	1,651.86	1,651.86
1	RIGHT REAR WHEEL FLANGE (SN)	BENT	470.99	470.99
1	RIGHT REAR SPRING LINK ARM (SN)	BENT	249.19	249.19
1	REAR W/SCREEN (SN)	NECESSARY	1,477.30	1,477.30
2	ONE-COMPONENT ADHESIVE (SN)	NECESSARY	313.66	313.66
1	RIGHT REAR FENDER (SN)	BUCKLED	2,296.77	2,296.77
1	RIGHT REAR FENDER VENTILATION FLAP (SN)	SERVICEABLE	26.26	-
1	FUEL TANK FILLER RECESS (SN)	SERVICEABLE	216.82	-
1	REAR BUMPER (SN)	DEFORMED	2,021.87	2,021.87
1	RIGHT REAR BUMPER SIDE STABILITY (SN)	BENT	83.62	83.62
1	RIGHT REAR DOOR (SN)	TO REPAIR SEE LABOUR	2,337.96	-
1	RIGHT REAR DOOR WEATHERSTRIP (SN)	NOT NECESSARY	305.97	-
1	RIGHT REAR DOOR INSULATION (SN)	NOT NECESSARY	37.13	-
1	RIGHT REAR DOOR WINDOW GUIDE RAIL (SN)	NOT NECESSARY	184.65	-
1	TS TWO-COMPONENT ADHESIVE (SN)	NECESSARY	776.81	776.81
1	RIGHT REAR PUSHING STRUT ARM (SN) (ADDITIONAL)	BENT	107.87	107.87
1	RIGHT REAR CAMBER ARM (SN) (ADDITIONAL)	BENT	237.62	237.62
1	RIGHT REAR STRUT ARM (SN) (ADDITIONAL)	BENT	185.70	185.70
1	RIGHT REAR TIE ROD (SN) (ADDITIONAL)	BENT	216.01	216.01
1	COLLAR NUT (SN) (ADDITIONAL)	NECESSARY	23.72	23.72
1	SEAM SEAL (SN) (ADDITIONAL)	NECESSARY	104.99	104.99
1	(STR) TWO-COMPONENT ADHESIVE (SN) (ADDITIONAL)	NECESSARY	102.00	102.00
1	CLIP (SN) (ADDITIONAL)	NECESSARY	1.26	1.26
6	BLIND RIVET (SN) (ADDITIONAL)	NECESSARY	8.10	8.10
2	BLIND RIVET W CSK. HEAD (SN) (ADDITIONAL)	NECESSARY	3.90	3.90
1	SEAM SEAL (SN) (ADDITIONAL)	NECESSARY	104.99	104.99
1	MOUNTING CLIP (SN) (ADDITIONAL)	NECESSARY	4.46	4.46
			14,885.80	11,202.40

Report Ref No. CC4/FCI20007323/R1ea3s2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

23,902.40

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	LABOUR			
	INSTALL SOLAR FILM ON REAR W/SCREEN.		300.00	300.00
	PANEL BEATING TO REPAIR AFFECTED AREAS, REMOVE AND REPLACE WITH NEW BODY PANELS WITH REFINISH.		5,760.00	4,800.00
	RESPRAY RIGHT REAR FENDER, RIGHT REAR DOOR, REAR BUMPER AND REAR END PANEL.		2,400.00	2,100.00
	USING XENTRY SYSTEM TO CHECK CONTROL UNITS, RESET SYSTEM TO STANDARD SETTINGS.		380.00	380.00
	CHECK REAR LIGHTING SYSTEM AND CONDUCT WATER TEST FOR ANY LEAKAGE.		120.00	120.00
	TRANSFER MECHANICAL & ELECTRICAL COMPONENTS OVER TO NEW DOOR.	NOT NECESSARY	480.00	-
	RENEW REAR W/SCREEN.		560.00	560.00
	REMOVE AND REFIT REAR UPHOLSTERY, TRIMS GARNISHS, TRIMS BOARDS AND SEATS CUSHIONS FOR NEC. REPAIRS.		1,200.00	960.00
	REMOVE & REFIT FUEL TANK FILLING HOSE, DRAIN AND REFILL FUEL FOR NEC. REPAIRS.		420.00	420.00
	RENMOVE UNDERCARRIAGE FROM VEHICLE FOR THE REPLACEMENT OF COMPONENTS. INCLUSIVE OF THE REPAIR OF RIGHT REAR DOOR.		2,400.00	1,920.00
	INSPECT & CONDUCT OPTICAL WHEEL ALIGNMENT.		540.00	540.00
	TRANSFER TYRE OVER TO NEW RIM.		60.00	60.00
	INSPECT & CONDUCT OPTICAL WHEEL ALIGNMENT. (2ND INSPECTION)		540.00	540.00
			15,160.00	12,700.00
	GRAND TOTAL		30,045.80	23,902.40

Report Ref No. CC4/FCI20007323/R1ea3s2

MOHAMMED RASUL BIN MOHD YUNUS

RECOMMENDED COST OF REPAIRS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 6262A

INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315


















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

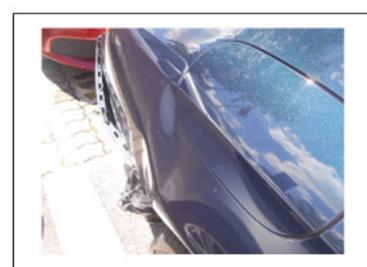

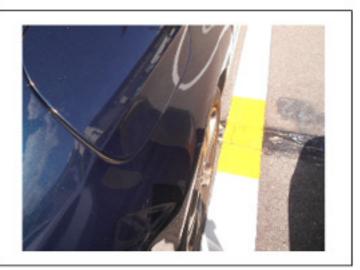

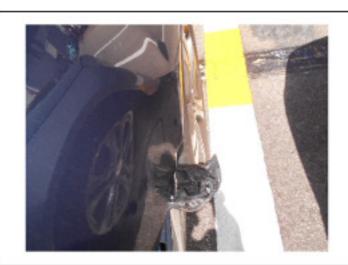









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

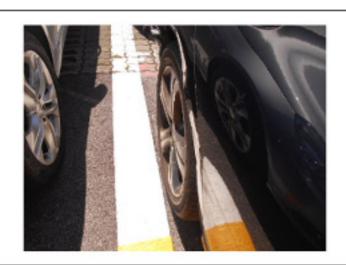













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 6262A

RE-INSPECTION















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3581 FAX: 6256 4315

