



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2007066
INV Date 19/10/2020
Reference CS/AGI20007347/Kqf3q2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SML 6474J

Insured Veh. SKS 148C

Claim No. C10006704

Policy No.

Accident Date 13/07/2020

Inspection Date 20/07/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20007347/Kqf3q2

(BUDGET DIRECT INSURANCE)

190 CLEMENCEAU AVENUE #03-01

SINGAPORE SHOPPING CENTRESINGAPORE

239924

Date : 19-10-2020



Code : AGI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKS 148C	Veh. Inspected	SML 6474J
Policy No.		Coverage (\$)	0.00
Claim No.	C10006704	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	16/07/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA FREED (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	GB71084742	Colour	METALLIC GREY
Odometer	85480	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/65 R15	WEST LAKE	9 mm
L/H Front Tyre	185/65 R15	WEST LAKE	9 mm
R/H Rear Tyre	185/65 R15	DUNLOP	8 mm
L/H Rear Tyre	185/65 R15	DUNLOP	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	13/07/2020	Inspection Date	20/07/2020
Survey held at	THIAM HENG HUAT PTE LTD 176 SIN MING DRIVE #05-14 SINGAPORE 575721		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 6474J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	BENT	2,150.00	1,208.00
1	TAILGATE LOCK	DENTED	285.00	195.00
1	TAILGATE LOCK SENSOR	SERVICEABLE	320.00	-
1	TAILGATE WEATHERSTRIP	SERVICEABLE	221.00	-
1	TAILGATE 'HONDA' LOGO	NECESSARY	99.70	99.70
1	TAILGATE 'FREED' EMBLEM	NECESSARY	79.80	79.80
1	TAILGATE 'HYBRID' EMBLEM	NECESSARY	65.00	65.00
1	TAILGATE CHROME MOULDING	SERVICEABLE	385.00	-
2	TAILGATE LAMP @\$590.00	SERVICEABLE	1,180.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	194.00	194.00
1	REAR BUMPER	MTG CRACKED / BROKEN	1,299.30	921.00
2	REAR BUMPER SIDE RETAINER @\$76.00	NECESSARY	152.00	152.00
2	REAR BUMPER BRACKET @\$68.00	TO REPAIR SEE LABOUR	136.00	-
1	REAR BUMPER REINFORCEMENT	NO SUCH PARTS	691.70	-
1	REAR BUMPER SPONGE	NO SUCH PARTS	161.50	-
2	REAR BUMPER REFLECTOR @\$199.20	SERVICEABLE	398.40	-
2	REAR BUMPER REFLECTOR INNER BRACKET @\$56.00	TO REPAIR SEE LABOUR	112.00	-
1	REAR BUMPER TOW COVER	SERVICEABLE	69.50	-
2	TAILLAMP @\$689.00	SERVICEABLE	1,378.00	-
2	TAILLAMP PANEL @\$165.00	TO REPAIR SEE LABOUR	330.00	-
1	SMART BUZZER SENSOR	SERVICEABLE	269.00	-
1	REAR ANTENNA SENSOR	SERVICEABLE	281.70	-
1	END PANEL	TO REPAIR SEE LABOUR	785.00	-
1	END PANEL TOP GARNISH	SERVICEABLE	284.00	-
2	TAILGATE HINGE @\$135.00	TO REPAIR SEE LABOUR	270.00	-
2	TAILGATE ABSORBER @\$177.00	SERVICEABLE	354.00	-
2	TAILGATE STOPPER @\$16.00	SERVICEABLE	32.00	-

Report Ref No. CS/AGI20007347/Kqf3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR FENDER INNER TRIM @\$476.00	SERVICEABLE	952.00	-
1	EXHAUST ASSY	TO REPAIR SEE LABOUR	797.00	-
1	EXHAUST ASSY GASKET	SERVICEABLE	34.00	-
2	EXHAUST ASSY MOUNTING @\$45.00	SERVICEABLE	90.00	-
1	EXHAUST ASSY HEATSHIELD	TO REPAIR SEE LABOUR	210.60	-
1	SPARE WHEEL PANEL	TO REPAIR SEE LABOUR	854.00	-
1	SPARE WHEEL TOOLS HOLDER	SERVICEABLE	385.00	-
1	SPARE WHEEL TOP BOARD	SERVICEABLE	303.00	-
2	SPARE WHEEL SIDE BOARD @\$196.00	SERVICEABLE	392.00	-
1	TAILGATE INNER HANDLE	SERVICEABLE	87.00	-
1	TAILGATE INNER TRIM	SERVICEABLE	645.00	-
	LESS 20% DISCOUNT		-3,346.64	-582.90
			13,386.56	2,331.60
	<u>SPECIAL NETT ITEMS</u>			
8	TAILGATE INNER TRIM CLIPS @\$4.50 (SN)	NOT NECESSARY	36.00	-
10	REAR BUMPER CLIPS @\$4.50 (SN)	NECESSARY	45.00	45.00
1	REVERSE CAMERA (SN)	SERVICEABLE	450.00	-
1	REAR LICENCE PLATE & FRAME (SN)	SERVICEABLE	55.00	-
1	END PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	TAILLAMP PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
6	END PANEL TOP GARNISH CLIPS @\$4.50 (SN)	NOT NECESSARY	27.00	-
16	REAR FENDER INNER TRIM CLIPS @\$4.50 (SN)	NOT NECESSARY	72.00	-
1	REAR BOOT CARPET (SN)	SERVICEABLE	250.00	-
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			1,505.00	285.00

Report Ref No. CS/AGI20007347/Kqf3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISMANTLE /RENEW ACCIDENT DAMAGED PORTION.TO PANEL BEAT ,RESHAPE,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER BRACKET,REAR BUMPER REFLECTOR INNER BRACKET,TAILLAMP PANEL,END PANEL,TAILGATE HINGE,EXHAUST ASSY,EXHAUST ASSY HEATSHIELD AND SPARE TYRE PANEL.		1,400.00	500.00
	TO DISCONNECT REAR WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS ,RECONNECT AND CHECK FUNCTIONS INCLUDING TAILLAMP LIGHTINGS.		50.00	15.00
	TO REMOVE ,REFIT TAILGATE COMPONENTS TO REPLACE TAILGATE,CHECK AND RE-ADJUST CLOSE GAP ,ALIGNMENT AND WATER SEEPAGE.		100.00	60.00
	TO REMOVE AND REFIT,STRAIGHTEN ,READJUST AND REPLACE EXHAUST SILENCER .	NOT NECESSARY	150.00	-
	TO REMOVE AND REFIT REAR WINDSCREEN TO FACILITATE REPAIR WORK.		150.00	120.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY TAILGATE,REAR BUMPER ,END PANEL AND OTHER AFFECTED AREA /PANEL.		1,400.00	600.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.	NOT NECESSARY	100.00	-
			3,350.00	1,295.00
GRAND TOTAL			18,241.56	3,911.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,100.00

Report Ref No. CS/AGI20007347/Kqf3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 6474J

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

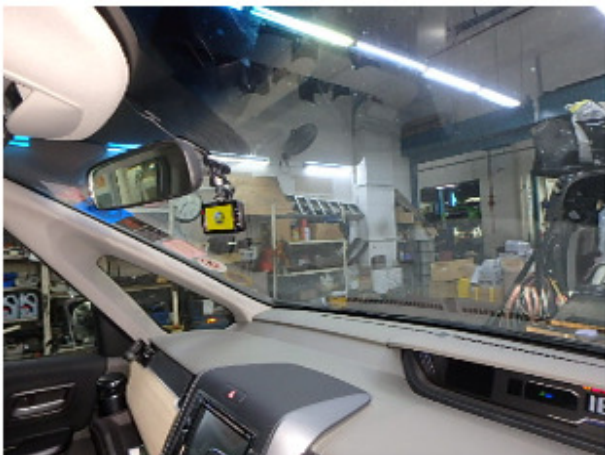



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 6474J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

