



VIDA & Partners Pte. Ltd.
209 New Upper Changi Road
#03-651 Singapore 460209
Email:
vidapartners.sg@gmail.com

INVOICE
VM - 1911220A

Hirer

MJE AUTO

Vehicle

Plate No SML4938B (Mercedes Benz C180)
Rental Fee (per day) \$180.00

Rental Period

Start 22-Nov-19
End 10-Dec-19
No. of Days 18 days

Misc.

Rental Fee	\$3,240.00
Misc.	
Total	<u>\$3,240.00</u>

This is a computer-generated document. No signature is required.




Vida Partners Pte Ltd
209 New Upper Changli Road
#03-651 Singapore 460209
Email: vidapartners.sg@gmail.com

RA No:
DATE:

VEHICLE RENTAL AGREEMENT

HIRER'S PARTICULARS	
Name: (as in I/C)	CHENG WEI XIAN JACKSON
NRIC/ Passport No:	S94101804
Address(Res):	BLK 26 MARSHING DRIVE #06-229 SINGAPORE 730026
Name & Address of Employer:	
Occupation:	Driving Exp: 3 YEARS
	Date of Birth: 26/03/1994
Tel No(O):	HP/PG: 8753 0277

ADDITIONAL DRIVER'S PARTICULARS	
Name: (as in I/C):	
NRIC/ Passport No:	
Address(Res):	
Occupation:	Driving Exp:
	Date of Birth:
Tel No(O):	HP/PG:

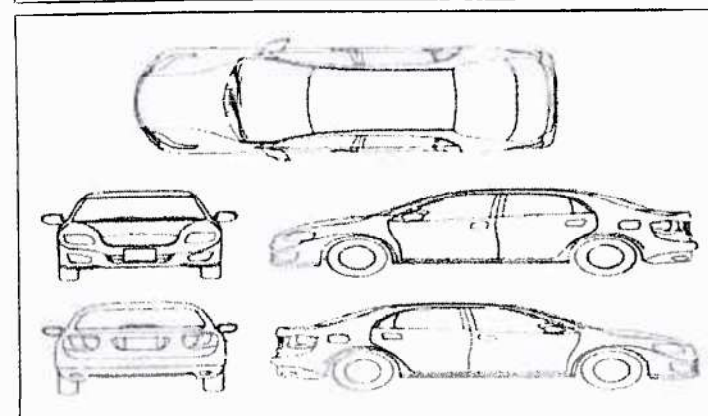

Following accessories included in the Car

S- Scratches
D- Dents
A- Accidents



VEHICLE'S PARTICULARS	
Vehicle No: SML 4938B	Replace Veh No: SKJ 2933L
Mileage Out: 173441	Mileage Out:
Make/Model: MERCEDES-BENZ C180	Auto Group: PREMIUM
Out Date: 22/11/2019	Time: 1800hr
Contract Period: 18 days	

RENTAL CHARGES			
Daily	@\$	per day	180
Weekly	@\$	per week	
Monthly	@\$	per month	
Hours	@\$	per hour	
Delivery Service			
Deposit			
TOTAL S\$			3240
PETROL/DIESEL LEVEL			
OUT	E	1/8 2/8 3/8 4/8 5/8 6/8 7/8 F	
IN	E	1/8 2/8 3/8 4/8 5/8 6/8 7/8 F	
Extension of Rental			
Collection Service			
MISC:			
TOTAL CHARGES S\$			3240
Rented out by: Darren Ouyang			

Hirer's Signature

Additional Driver's Signature

I have read and agree to the terms and conditions on both sides of this agreement. If I have presented a cheque/credit card for payment, I agree that all amounts payable under this agreement and for parking and traffic infringements may be billed to that account and my signature above will be considered to have been made on the cheque/credit card voucher. All information I have given Vida Partners Pte Ltd in connection with this agreement is true.

*** IMPORTANT**

- ONLY PERSONS ABOVE 22 YEARS OF AGE WITH MORE THAN 2 YEARS DRIVING EXPERIENCE, AUTHORISED, LICENSED AND SIGNING THIS AGREEMENT MAY DRIVE THE VEHICLE.
- ALL PARKING AND TRAFFIC VIOLATIONS ARE THE RESPONSIBILITY OF THE HIRER, AN ADMINISTRATIVE CHARGE WILL BE LEVIED ON ANY TRAFFIC VIOLATIONS REDIRECTED.
- THE HIRER SHALL BE LIABLE FOR EXCESS CHARGES FOR ANY LATE RETURN AT THE RATE SHOWN PER HOUR OR PER DAY, INCLUSIVE OF CDW AND/OR PAI WHERE APPLICABLE.
- IN CASE OF ACCIDENT, THE HIRER SHALL REPORT TO RENTAL OFFICE IMMEDIATELY, IF THERE IS BODILY INJURIES, A POLICE REPORT MUST BE MADE WITHIN 24 HOURS.
- VEHICLE IS STRICTLY FOR SINGAPORE USE ONLY AND MAY NOT BE DRIVEN OUT OF SINGAPORE WITHOUT PRIOR CONSENT OF THE COMPANY

RETURN OF VEHICLE - THE HIRER / DRIVER IS REQUIRED TO SIGN IN THE COLUMN "SIGNATURE OF HIRER / DRIVER" FAILING WHICH THE DAY AND TIME INSERTED BELOW SHALL BE THE DAY AND TIME THE VEHICLE IS RETURNED TO Vida Partners Pte Ltd AND THE SAME SHALL BE ACCEPTED AS CONCLUSIVE EVIDENCE OF THE SAME AND SHALL NOT CHALLENGED OR QUESTIONED ON ANY ACCOUNT WHATSOEVER.

Date In	Time In	Mileage In	Checked By	Remarks	Signature of HIRER / DRIVER
10/12/19	1802hr				



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
 Mobile: 9688-0418 Fax: 6266-7396
 Email: absolute.app.svcs@gmail.com

Invoice

Customer: Vida & Partners Pte Ltd
 C/o: 7 Sin Ming Industrial Estate Sector C #01-94
 Singapore 575642

Date: 03.01.2020

Invoice No: NS-2019-576

Description		Amount
Vehicle No:	SKJ2933L	
Make & Model:	Mercedes C180 CGI (A)	
Our reference:	AAS/2019/576	
Services rendered for appraiser / inspection report		
Survey Fee		
Photographs		
Transport Fees		
Re-inspection Fees		
SGD Dollar : One thousand six hundred and twenty five dollar only	Total:	SGD \$ 1,625.00

Notes:

All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd"

Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.



Absolute Appraisal Services Pte Ltd



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Vida & Partners Pte Ltd
C/o: 7 Sin Ming Industrial Estate Sector C #01-94
Singapore 575642

Date of report: 03.01.2020
Date of request: 25.11.2019
Date of inspection: 25.11.2019
Date of accident: 15.11.2019
Claim type: Third Party Claim

Report No: AAS/2019/576

Particulars of affected vehicle:

Registration no:	SKJ2933L	Odometer:	217589 km
Make/Model:	Mercedes C180 CGI (A)	Engine Capacity:	1796 cc
Year of registration:	2010	Engine no:	27182030082598
Colour:	Metallic Blue	Chassis no:	WDD2040492A405495

Condition of tires:

Front Left:	6mm	Front Right:	6mm
Make:	Michelin	Make:	Michelin
Rear Left:	6mm	Rear Right:	6mm
Make:	Michelin	Make:	Michelin

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

The Assignment

The inspection was conducted at M/s. MJE Motor
7 Sin Ming Industrial Estate Sector C #01-94
Singapore 575642

(Subsequent inspection was conducted)

Assessment

Repairer's estimate:	\$ 45,635.86
Revised estimate:	\$ 41,048.86
Recommended reserve:	\$ 32,850.00 (Lump sum)

Estimated normal duration of repairs : 21 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SKJ2933L

Report No: AAS/2019/576

W/O PREJUDICE

Point of impact

At the front and rear portion.

General description of damages

The bonnet, front grille, headlamps, front bumper, LHF fender, front glass pillars, aircon condenser, radiator, oil cooler, cooling fan, front safety belts, rear safety belts, truck lid, tail lamps, rear bumper, rear end panel, spare tyre well, spare tyre panel, exhaust pipe, rear chassis member, LHR fender, etc.
Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s MJE Motor as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$41,048.86

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$32,850.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 21 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 205 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD

LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SKJ2933L

Report No: AAS/2019/576

Appraisement Schedule

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Bonnet	1	Dented		\$ 2,740.00	\$ 2,740.00
2	Bonnet emblem	1	Missing		\$ 78.00	\$ 78.00
3	Bonnet catch LH/RH	2	Serviceable	\$ 40.00	\$ 80.00	-
4	Bonnet lock LH/RH	2	Distorted	\$ 233.00	\$ 466.00	\$ 466.00
5	Bonnet seal	1	Necessary		\$ 27.00	\$ 27.00
6	Bonnet hook	1	Distorted		\$ 90.00	\$ 90.00
7	Bonnet spring	2	1pc Cracked	\$ 46.00	\$ 92.00	\$ 46.00
8	Bonnet hinge LH/RH	2	Distorted/Repair	\$ 94.00	\$ 188.00	-
9	Bonnet stay LH/RH	2	Serviceable	\$ 155.00	\$ 310.00	-
10	Bonnet insulator	1	Deformed/Torn		\$ 181.00	\$ 181.00
11	Front grille	1	Broken		\$ 978.00	\$ 978.00
12	Front grille emblem	1	Cracked		\$ 110.00	\$ 110.00
13	Front grille support	1	Broken		\$ 21.00	\$ 21.00
14	Front bumper	1	Dented		\$ 1,470.00	\$ 1,470.00
15	Front bumper license plate base	1	Dented		\$ 159.00	\$ 159.00
16	Front bumper tow hook cover	1	Missing		\$ 30.00	\$ 30.00
17	Front bumper chrome LH/RH	2	Necessary	\$ 122.00	\$ 244.00	\$ 244.00
18	Front bumper lower grille	1	Serviceable		\$ 392.00	-
19	Front bumper side grille LH/RH	2	LH Deformed	\$ 97.00	\$ 194.00	\$ 97.00
20	Front bumper day light LH/RH	2	LH Broken	\$ 245.00	\$ 490.00	\$ 245.00
21	Front bumper support LH/RH	2	Dented	\$ 126.00	\$ 252.00	\$ 252.00
22	Front bumper retainer LH/RH	2	Necessary	\$ 12.00	\$ 24.00	\$ 24.00
23	Front bumper absorber	1	Dented/Cracked		\$ 262.00	\$ 262.00
24	Front bumper reinforcement	1	Dented		\$ 780.00	\$ 780.00
25	Front bumper reinforcement bracket LH/RH	2	Dented/Repair	\$ 116.00	\$ 232.00	-
26	Headlamp LH/RH	2	Broken	\$ 1,123.00	\$ 2,246.00	\$ 2,246.00
27	LHF fender	1	Dented/Distorted		\$ 881.00	\$ 881.00
28	Front fender nameplate 'Blue Efficiency'	2	Necessary	\$ 36.00	\$ 72.00	\$ 72.00
29	Front fender chrome LH/RH	2	Necessary	\$ 55.00	\$ 110.00	\$ 110.00
30	Front panel	1	Dented		\$ 227.00	\$ 227.00
31	Front panel top garnish	1	Cracked		\$ 95.00	\$ 95.00
32	Brace support	1	Dented		\$ 29.00	\$ 29.00
33	Side frame LH/RH	2	Dented	\$ 260.00	\$ 520.00	\$ 520.00
34	Side frame top garnish LH/RH	2	Deformed	\$ 63.00	\$ 126.00	\$ 126.00
35	Air deflector LH/RH	2	Dented/Cracked	\$ 40.00	\$ 80.00	\$ 80.00
36	Aircon condenser	1	Dented		\$ 1,550.00	\$ 1,550.00
37	Radiator	1	Dented		\$ 985.00	\$ 985.00
38	Cooling fan assy	1	Cracked		\$ 1,100.00	\$ 1,100.00
39	Air inlet hose	1	Dented/Cut		\$ 96.00	\$ 96.00
40	Oil cooler	1	Dented/Punctured		\$ 1,220.00	\$ 1,220.00
41	Oil cooler air shroud	1	Cracked		\$ 93.00	\$ 93.00



ABSOLUTE APPRAISAL SERVICES PTE LTD

LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SKJ2933L

Report No: AAS/2019/576

42	Oil cooler pipe	1	Dented		\$ 550.00	\$ 550.00
43	Truck lid	1	Dented		\$ 1,655.00	\$ 1,655.00
44	Truck lid emblem	1	Necessary		\$ 57.00	\$ 57.00
45	Truck lid nameplate 'C180'	1	Necessary		\$ 80.00	\$ 80.00
46	Truck lid badge 'C&C'	1	Necessary		\$ 70.00	\$ 70.00
47	Truck lid nameplate 'CGI'	1	Necessary		\$ 63.00	\$ 63.00
48	Truck lid latch	1	Distorted		\$ 292.00	\$ 292.00
49	Truck lid striker	1	Distorted		\$ 80.00	\$ 80.00
50	Truck lid hinge LH/RH	2	Bent/Repair	\$ 240.00	\$ 480.00	-
51	Truck lid weather-seal	1	Necessary		\$ 170.00	\$ 170.00
52	Tail lamp LH/RH	2	Broken	\$ 654.00	\$ 1,308.00	\$ 1,308.00
53	Rear bumper	1	Dented		\$ 1,274.86	\$ 1,274.86
54	Rear bumper centre chrome	1	Broken		\$ 190.00	\$ 190.00
55	Rear bumper side chrome	2	Necessary	\$ 160.00	\$ 320.00	\$ 320.00
56	Rear bumper tow hook cover	1	Serviceable		\$ 66.00	-
57	Rear bumper retainer LH/RH	2	Necessary	\$ 34.00	\$ 68.00	\$ 68.00
58	Rear bumper under bracket	2	Broken	\$ 21.00	\$ 42.00	\$ 42.00
59	Rear bumper reinforcement	1	Dented		\$ 720.00	\$ 720.00
60	Rear bumper support LH/RH	2	Cracked/Necessary	\$ 46.00	\$ 92.00	\$ 92.00
61	Rear panel	1	Dented		\$ 1,160.00	\$ 1,160.00
62	Rear panel finisher	1	Cracked		\$ 110.00	\$ 110.00
63	Spare well	1	Cracked		\$ 430.00	\$ 430.00
64	Spare well under cover	1	Broken		\$ 247.00	\$ 247.00
65	Spare tyre cover	1	Serviceable		\$ 321.00	-
66	Exhaust pipe	1	Dented/Bent		\$ 1,770.00	\$ 1,770.00
67	Front safety belt LH/RH	2	Activated/Jammed	\$ 1,440.00	\$ 2,880.00	\$ 2,880.00
68	Rear safety belt LH/RH	2	Activated/Jammed	\$ 1,310.00	\$ 2,620.00	\$ 2,620.00
69	Front glass pillar LH/RH		Grazed/Repair		-	-
70	LHR fender		Distorted/Repair		-	-
71	Spare tyre panel		Distorted/Repair		-	-

List total: \$ 36,435.86 \$ 33,978.86

1	Bonnet insulator clips	1set	Necessary		\$ 50.00	\$ 50.00
2	Front number plate	1set	Dented		\$ 70.00	\$ 70.00
3	Radiator coolant	1	Necessary		\$ 80.00	\$ 80.00
4	Reverse sensor	2set	Malfunctioned	\$ 250.00	\$ 500.00	\$ 400.00
5	Spare well sealant	1	Necessary		\$ 60.00	\$ 40.00
6	Joint sealant	1	Necessary		\$ 60.00	\$ 40.00

Special nett total: \$ 820.00 \$ 680.00

Parts Total: \$ 37,255.86 \$ 34,658.86



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SKJ2933L

Report No: AAS/2019/576

S/N	Labour Description	Repairer's Est	Revised Est
1	Check front section lightings & wirings.	\$ 40.00	\$ 30.00
2	Replace aircon condenser. Refill aircon gas.	\$ 150.00	\$ 120.00
3	Replace radiator & cooling fan. Conduct engine cooling test.	\$ 100.00	\$ 80.00
4	Anti rust treatment on front affected panels.	\$ 100.00	\$ 60.00
5	To conduct panel beating, welding, straightening of damaged panels, renew front damaged parts, realign affected area.	\$ 1,500.00	\$ 1,000.00
6	Spray painting on front replacement & affected parts.	\$ 1,500.00	\$ 1,200.00
7	Renew front & rear safety belts.	\$ 400.00	\$ 300.00
8	Conduct electrical diagnosis, reset fault code, configuration & programme all related.	\$ 300.00	\$ 250.00
9	Check rear section lightings & wirings.	\$ 40.00	\$ 30.00
10	Dismantle & transfer truck lid components.	\$ 100.00	\$ 100.00
11	Removal & refitting of rear trims, rear seats to assist replacement/repairs.	\$ 200.00	\$ 150.00
12	Replace exhaust pipe.	\$ 100.00	\$ 80.00
13	Replace reverse sensor.	\$ 80.00	\$ 50.00
14	Anti rust treatment on rear affected panels.	\$ 120.00	\$ 90.00
15	To conduct panel beating, welding, straightening of damaged panels, renew rear damaged parts, realign affected area.	\$ 2,000.00	\$ 1,500.00
16	Spray painting on rear replacement & affected parts.	\$ 1,500.00	\$ 1,200.00
17	Towing charge.	\$ 150.00	\$ 150.00
Labour Total:		\$ 8,380.00	\$ 6,390.00

Grand Total: \$ 45,635.86 \$ 41,048.86

The final adjusted lump sum amount is \$32,850.00

Under normal circumstances, the repair should be completed within a reasonable period of 21 working days.

205 Photographs were taken at the time of inspection.



