

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 140M0420.EAS  
Vehicle no : SCZ37Y

### **1 REFERENCE**

Date of inspection : 13 April 2020  
Requested by : Teo Chee Kang  
Blk 647 Hougang Ave 8  
#01-205  
Singapore 530647  
Type of survey : Independent  
Repairer : Evergum Auto Services  
Blk 3022A Ubi Road 1, #01-51, Singapore 408716  
Date of accident : 7 April 2020

### **2 VEHICLE DATA**

Make/Model : **VOLKSWAGEN SCIROCCO 1.4L AT TSI 1372Q5**  
Chassis no : WVWZZZ13ZCV027567  
Engine no : CAV388661  
Date of registration : 16 April 2012  
Engine capacity : 1390 cc  
Odometer reading : 107594 km  
Colour : White

### **3 STATIC CONDITION CHECK**

Steering : Serviceable  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

### **4 TIRE CONDITION CHECK**

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	5 mm/Yokohama	5 mm/Yokohama	235/35R19
Rear tread	5 mm/Yokohama	5 mm/Yokohama	235/35R19

### **5 BRIEF DESCRIPTION OF DAMAGE**

Front bumper scrfaped/torn/deformed, RH headlamp – casing cut, front RH fender dented/scraped, front bonnet dented/scraped, front bonnet hinges bent, Rh side mirror grazed, dashboard warning lights – lighted, etc. Please see para. 8 of this report for more details.

### **6 REMARKS**

This inspection is carried out on a “WITHOUT PREJUDICE” basis and I have not authorized any repairs.

### **7 RECOMMENDATION**

Cost of repairs : **\$6,300.00** (lump sum)  
Estimated no of days : **Five (5)**

## 8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 140M0420.EAS

Vehicle no: SCZ37Y

### A SPARE PARTS

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount
Front bumper	1	scraped/torn/deformed	1275 ✓ 1,780.00	1,780.00
Front bumper side retainer	2	necessary	96.00	96.00 ✓
Front bumper retaining clip	10	necessary	80.00	30 ✓ 80.00
RH fog lamp assy	1	serviceable	275.00	0.00
RH fog lamp trim garnish	1	bent/distorted	230.00	230.00 ✓
RH headlamp assy	1	casing cut	980.00	980.00 ✓
RH headlamp top panel	1	to repair	160.00	0.00
Front bonnet	1	dented/scraped	1199 ✓ 1,480.00	1,480.00
Front bonnet hinge	2	to repair	250.00	0.00
Front bonnet "Volkswagen" logo	1	necessary	76.00	76.00 ✓
RH front fender	1	dented/scraped/distorted	780.00	780.00 ✓
RH side mirror assy	1	to repair	780.00	0.00
Subtotal of the above			6,967.00	5,502.00
Discount			10% / 10%	696.70
(Special nett)			Subtotal 1:	6,270.30
Fog lamp bulb	1	shorted	4666	15.00
RH front sport rim	1	dented/scraped	-10% CUT	900.00
Subtotal 2:			915.00	915.00
Total cost of parts:			7,185.30	5,866.80

### B LABOUR

Labour charges to remove and replace damaged parts, to cut and weld damaged body panels, to knock and reshape affected areas, to adjust and align misaligned parts.	900.00	600.00 ✓
Spray painting charges to putty and spray paint the front bumper, front bonnet, front fender, side mirror and necessary areas.	1,250.00	1,000.00 750 ✓
To diagnose fault on dashboard warning lights with diagnostic scanner and rectify.	150.00	150.00 100 ✓
To check wiring and repair where needed.	60.00	30 ✓ 45.00
To apply anti-rust undercoat for the affected areas.	120.00	30 ✓ 60.00
To align headlamps and refocus headlamp beams.	90.00	20 ✓ 60.00
	1530	
Total cost of labour:	2,570.00	1,915.00

Total cost of repair:

9,755.30	7,781.80
----------	----------

P - 4199.40

L - 1530

= 5729.40

L/S - 4583.52

= 4600

Report no: 140M0420.EAS  
Vehicle no: SCZ37Y

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is

\$7,781.80

(a) The final cost of repair based on lump sum repairs would be

**\$6,300.00**

(b) Estimated number of days taken by the repairs would be

**Five (5)**

(1<sup>st</sup> Re-inspection conducted on 14 April 2020)


(Post Repair Inspection conducted on 17 April 2020)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

**Note: Lump Sum Repair Basis**

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Prepared by:

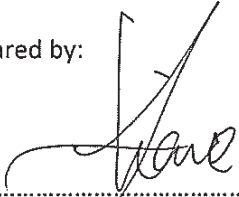

.....  
Liaw Leong San  
Licensed Automotive Appraiser

Dated: 11 June 2020

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189  
Mobile: 9061 0543 Email: [mirage1195@gmail.com](mailto:mirage1195@gmail.com)

Teo Chee Kang  
Blk 647 Hougang Ave 8  
#01-205  
Singapore 530647

Invoice no:	POS0140/20
Date:	11 June 2020
Report no:	140M0420.EAS
Vehicle :	SCZ37Y

## INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			647.00
SGD(\$): Six Hundred and Forty-seven only			<b>Payable Amount:</b>	<b>647.00</b>

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



.....  
Authorised Signature