

# ASSIGNMENT

From \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

N/S	O/S

(Policy Condition)  
 Remark: The veh had commenced its  
 repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SGP4001D Yr Regn: 2006 Dec  
 Type: M/Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or  
 Make: Toyota Picnic C.C. 1998  
 Colour: Silver A/C: Insured / Std / NI / NA  
 Sp Reading: 421376 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: JTEGH23B3000 22652  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: Inorder / Jammed / Leaked / Burnt or  
 Brake: Inorder / Jammed / Leaked / Burnt or  
 Modi: Nil / Rim / STD A/Rim or  
 Tyre Size: F: 205/60 R16  
 R: 205/60 R16  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or  
 Front Rear  
 R/Bal. 06 mm R/Bal. 06 mm  
 L/Bal. 06 mm L/Bal. 06 mm  
 D.O.A. \_\_\_\_\_ D.O.I. 28/07/20  
 Survey held at Irony East.  
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or  
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	TP Reinspection.
	COE Expiry 13/12/2026
	Date of Accident: 15/06/16.
	MV :
	PV :
	Nett :

Date/Time, File Pass to? ☐ : Preli. Report  
☐ : Final Report  
 I) \_\_\_\_\_  
 Date/Time, File Return to? \_\_\_\_\_  
 2) \_\_\_\_\_  
 Report Format: \_\_\_\_\_  
 Lump Sum / Fee: \_\_\_\_\_

Days Of Repair: \_\_\_\_\_  
 Resurvey No. of Trip: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)  
☐ : Interview (\$ \_\_\_\_\_)  
☐ : Tech. Insp (\$ \_\_\_\_\_)  
☐ : Wash and (\$ \_\_\_\_\_)

Survey Fee: \_\_\_\_\_  
 Transportation: \_\_\_\_\_  
 Photos: \_\_\_\_\_  
 Other: \_\_\_\_\_  
 TOTAL: \_\_\_\_\_



# PROMINENT APPRAISER SERVICES PTE LTD

**Qualified Loss Adjusters And Motor Appraisers**

Correspondence Address: 1 Simei St 3 #02-24 S(529890)  
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434D

## VEHICLE INSPECTION REPORT

Report No: PAS/TP/0220616

Date of Report: 16/07/2016

To: Mr Khairudin Bin Jantan  
C/o: 1 Kaki Bukit Ave 6  
#01-72/73 Autobay  
Singapore 417883

Date of Assignment: 17/06/2016  
Report requested by: Mr Khairudin Bin Jantan  
Date of Accident: 15/06/2016  
Date of Inspection: 17/06/2016  
Claim No.: Third Party Claim  
Policy No.: -

### PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No.: SGP4001D  
Make & Model: Toyota Picnic (A)  
Year of Registration: 2006  
Colour: Met. Silver

Engine Capacity (cc): 1998cc  
Mileage (km): 283883km  
Chassis / Frame No.: JTEGH23B300022652  
Engine No.: 1AZ5498687

### TYRE CONDITION

Front LH: 4 mm	Front RH: 4 mm
Make: Yokohama	Make: Yokohama
Rear LH: 4 mm	Rear RH: 4 mm
Make: Yokohama	Make: Yokohama

Road wheels Type: Alloy

(The above represents the approximate remaining life of tyre treads)

### PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork: Good  
Paintwork: Good  
Handbrake: Serviceable  
Footbrake: Serviceable  
Steering: Serviceable  
Apparent Engine Modification: Nil

### PLACE OF INSPECTION

Location: M/s. Hanip Automobiles Pte Ltd  
1, Kaki Bukit Ave 6, #01-72/73, Autobay @ Kaki Bukit, Singapore 417883

### ASSESSMENT

Repairer's Estimate: \$ 15,082.70  
Revised Amount: \$ 11,392.45  
Less Excess: \$ -  
Recommended Reserve: \$ 9,650.00 (Lump Sum)

Estimated Normal Period of Repairs: 12 Working Days

*Disclaimer: This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party.*



# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S(529890)  
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434D

Vehicle No : SGP4001D

Report No. : PAS/TP/0220616

## GENERAL REMARKS

WITHOUT PREJUDICE

### THE ASSIGNMENT

The survey was conducted at M/s Hanip Automobiles Pte Ltd, 1, Kaki Bukit Ave 6, #01-72/73, Autobay @ Kaki Bukit, Singapore 417883.

(Subsequent inspections have been conducted)

### POINT OF IMPACT

At the rear portion.

### DAMAGES

The tailgate, rear bumper, rear end panel, rear floor panel, rear chassis members, rear fenders, LH taillamp, LH reflectors, etc.

*Other parts were also found damaged. (See schedule for details)*

### ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$11,392.45.

### CONCLUSION

The repairer has agreed to undertake the repairs at a lump sum of SGD \$9,650.00.

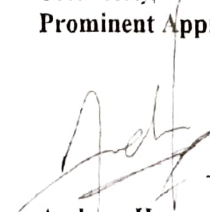
This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,

Prominent Appraiser Services Pte Ltd

  
Andrew How  
Automobile Appraiser  
MSAAA  
Licensed Appraiser



# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S1529890

Mobile: 9295 2204 Fax: 6722 9508 Email: pasvcs@hotmail.com

Business Reg: 2014044340

Vehicle No.: SGP4001D

Report No.: PAS/TP/0220616

## APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition		Repairer's Estimate (\$\$)	Our Assessment (\$\$)
1	1 pc	Tailgate	Dented		\$ 1,506.40	\$ 1,506.40
2	1 pc	Tailgate emblem (Logo)	Necessary		\$ 79.30	\$ 79.30
3	1 pc	Tailgate emblem (Picnic)	Necessary		\$ 64.80	\$ 64.80
4	1 pc	Tailgate emblem (Toyota)	Necessary		\$ 48.30	\$ 48.30
5	1 pc	Tailgate emblem (Deluxe)	Necessary		\$ 46.10	\$ 46.10
6	1 pc	Tailgate no plate garnish	Refit		\$ 265.70	\$ -
7	2 pcs	Tailgate no plate lamp R/L	Refit	\$ 54.70	\$ 109.40	\$ -
8	2 pcs	Tailgate lift support R/L	Refit	\$ 214.60	\$ 429.20	\$ -
9	2 pcs	Tailgate reflector lamp R/L	LH Cracked	\$ 230.50	\$ 461.00	\$ 230.50
10	1 pc	Tailgate inner trim	Dented/Deformed		\$ 384.10	\$ 384.10
11	1 pc	Rr windscreen moulding	Necessary		\$ 133.60	\$ 133.60
12	1 pc	Rr windscreen moulding dam kit	Necessary		\$ 87.50	\$ 87.50
13	1 pc	Rr windscreen wiper motor	Refit		\$ 765.40	\$ -
14	1 pc	Rr windscreen wiper arm	Refit		\$ 65.70	\$ -
15	1 pc	Tailgate lock	Dented/Jammed		\$ 286.20	\$ 286.20
16	1 pc	Tailgate lock striker	Bent		\$ 41.20	\$ 41.20
17	1 pc	Tailgate weatherstrip	Torn/Necessary		\$ 354.40	\$ 354.40
18	2 pcs	Taillamp R/L	LH Cracked	\$ 357.30	\$ 714.60	\$ 357.30
19	2 pcs	Taillamp panel R/L	Dented/Repair	\$ 142.50	\$ 285.00	\$ -
20	1 pc	Rr bumper	Dented		\$ 564.10	\$ 564.10
21	2 pcs	Rr bumper tow cover R/L	LH Missing	\$ 30.20	\$ 60.40	\$ 30.20
22	6 pcs	Rr bumper clip	Necessary	\$ 4.20	\$ 25.20	\$ 25.20
23	2 pcs	Rr bumper retainer R/L	Necessary	\$ 51.20	\$ 102.40	\$ 102.40
24	2 pcs	Rr bumper side support R/L	Necessary	\$ 38.40	\$ 76.80	\$ 76.80
25	2 pcs	Rr bumper seal R/L	Refit	\$ 76.80	\$ 153.60	\$ -
26	2 pcs	Rr bumper reflector R/L	LH Cracked	\$ 63.90	\$ 127.80	\$ 63.90
27	1 pc	Rr end panel	Dented		\$ 440.50	\$ 440.50
28	1 pc	Rr end panel garnish	Dented/Deformed		\$ 401.80	\$ 401.80
29	2 pcs	Rr fender inner trim R/L	Dented/Deformed	\$ 833.80	\$ 1,667.60	\$ 1,667.60
30	1 pc	Rr compartment cover	Dented/Deformed		\$ 800.40	\$ 800.40
31	1 pc	Rr floor panel	Dented		\$ 804.30	\$ 804.30
32	1 pc	Rr floor panel lining	not replaced		\$ 437.10	\$ 437.10
33	1 pc	Rr floor panel reinforcement	Repair Bent/Necessary		\$ 110.50	\$ 110.50
34	1 pc	Rr floor panel bracket	Necessary		\$ 72.10	\$ 72.10
35	1 pc	Exhaust silencer	Refit		\$ 1,031.10	\$ -
					\$ 13,003.60	\$ 9,216.60
				Less Discount: 25%	\$ 3,250.90	\$ 2,304.15
				List Parts Sub-Total:	\$ 9,752.70	\$ 6,912.45
1	1 pc	Rr windscreen sealant	Necessary	S/N	\$ 50.00	\$ 40.00
2	1 set	Rr no plate (w/bracket)	Dented/Cracked	S/N	\$ 50.00	\$ 50.00
3	1 set	Rr reverse sensor (4pcs type)	Dented/Damaged	S/N	\$ 400.00	\$ 350.00
4	1 pc	Rr end panel sealant	Necessary	S/N	\$ 50.00	\$ 40.00
5	1 pc	Rr floor panel sealant	Necessary	S/N	\$ 50.00	\$ 40.00
				Special Nett Sub-Total:	\$ 600.00	\$ 520.00
				Parts Total:	\$ 10,352.70	\$ 7,432.45





# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Address: 1 Simei St 3 #02-24 S1529690

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg: 201404434D

Vehicle No.: SGP4001D

Report No.: PAS/TP/0220616

S/No. Labour Descriptions

Repairer's Estimate (\$\$) Our Assessment (\$\$)

1	To check rear electrical wiring system.	\$ 80.00	\$ <del>50.00</del> 30
2	To transfer rear windscreen to new tailgate.	\$ 150.00	\$ 120.00 ✓
3	To transfer tailgate component parts to new tailgate.	\$ 120.00	\$ <del>100.00</del> 80
4	To remove and reinstall rear interior trims, garnishes, seats, etc. for necessary repairs	\$ 250.00	\$ <del>220.00</del> 80
5	To remove and reinstall exhaust silencer for necessary.	\$ 150.00	\$ 120.00 X
6	To remove, replace and reinstall rear reverse sensors & control unit.	\$ 80.00	\$ 60.00 ✓
7	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,800.00	\$ <del>1,540.00</del> 1000
8	To conduct chassis alignments.	\$ 400.00	\$ 300.00 X
9	To spray painting on affected area.	\$ 1,500.00	\$ <del>1,300.00</del> 1000
10	To spray anti-rust coating on new and affected panels.	\$ 200.00	\$ <del>150.00</del> 100
Labour Total :		\$ 4,730.00	\$ 3,960.00

Total (Parts & Labour) :

\$ 15,082.70

\$ 11,392.45

## For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 9,650.00

Under normal circumstances, the repairs should be completed within a reasonable period of **12 Working Days**.

82 Photographs were taken at the time of inspection.

Total: 8493.75  
L/S: 6.8K  
07 Days.

**N.B:** By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/after spray painting
  - To display damaged part(s) during resurvey
  - Parts prices are subject to confirmation
  - Third party survey is on a "Without Prejudice" basis
  - No illegal modification(s) is allowed
  - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Note: The revised estimate has been adjusted from a visual inspection. Any discrepancies or unseen damages should be notified to the company within 7 days from the date hereof. Otherwise this revised amount shall be deemed as valid.