



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2006878
INV Date 07/10/2020
Reference CC6/CTI20007773/Aea3q2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. GBH 9742S
Insured Veh. GBG 1395T
Claim No. SNM20D202636
Policy No. DMCVSNW00033412001
Accident Date 26/07/2020
Inspection Date 28/07/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI20007773/Aea3q2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Date : 07-10-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBG 1395T	Veh. Inspected	GBH 9742S
Policy No.	DMCVSNW00033412001	Coverage (\$)	0.00
Claim No.	SNM20D202636	Excess (\$)	0.00
Assign From		Assign Date	28/07/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA HIACE	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JTFHT02PX00245500	Colour	SILVER
Odometer	60934	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195 R15C	BRIDGESTONE	6 mm
L/H Front Tyre	195 R15C	BRIDGESTONE	6 mm
R/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm
L/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	26/07/2020	Inspection Date	28/07/2020
Survey held at	NEW HOCK TECK MOTOR PTE LTD 1 KAKI BUKIT AVENUE 6 #01-43 AUTOBAY @ KAKI BUKIT SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBH 9742S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT LID	DISTORTED	1,712.45	1,712.45
2	REAR BOOT LID HINGE @\$171.70	NOT NECESSARY	343.40	-
1	REAR BOOT LID TOYOTA HIACE STICKER	NECESSARY	57.60	57.60
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	41.10	41.10
1	REAR BOOT LID CENTRE MOULDING	CRACKED	281.90	281.90
1	REAR BOOT LID INNER LOCK	JAMMED	374.25	374.25
1	REAR BOOT LID INNER RUBBER	CUT	381.90	381.90
1	REAR BOOT LID INNER TRIM BOARD	TORN	581.10	165.30
10	REAR BOOT LID INNER TRIM BOARD CLIP @\$6.50	NECESSARY	65.00	30.00
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	105.00	105.00
2	REAR TAIL LAMP @\$374.45	CRACKED	748.90	748.90
2	REAR TAIL LAMP PANEL @\$371.85	TO REPAIR SEE LABOUR	743.70	-
2	REAR TAIL LAMP LOWER COVER @\$182.10	TO REPAIR SEE LABOUR	364.20	-
2	REAR TAIL LAMP LOWER COVER RETAINER @\$171.45	NOT NECESSARY	342.90	-
1	REAR BUMPER	DEFORMED	374.45	374.45
8	REAR BUMPER CLIP @\$6.50	NECESSARY	52.00	30.00
2	REAR BUMPER SIDE RETAINER @\$131.35	NECESSARY	262.70	262.70
1	REAR END PANEL OUTER	DENTED	581.10	581.10
1	REAR END PANEL INNER	DENTED	591.25	591.25
8	REAR END PANEL TOP CLIP @\$6.50	NOT NECESSARY	52.00	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,972.45	-
1	REAR FLOOR PANEL TOP MOULDING	BENT	274.45	274.45
8	REAR FLOOR PANEL TOP MOULDING CLIP @\$6.50	NECESSARY	52.00	20.00
1	REAR SPARE TYRE BRACKET	BENT	172.10	172.10
1	REAR EXHAUST	BENT	1,712.85	725.00
1	REAR CENTRE EXHAUST	NOT NECESSARY	1,829.10	-
1	REAR BOOT LID WINDSCREEN	CUT	974.50	974.50
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	105.00	105.00

Report Ref No. CC6/CTI20007773/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-	-2,002.24
			15,149.35	6,006.71
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BOOT LID 70KM/H STICKER (SN)	NECESSARY	20.00	10.00
1	REAR BOOT LID NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	REAR BOOT LID CAMERA (SN)	NOT NECESSARY	680.00	-
1	REAR BUMPER REVERSE SENSOR (SN)	DAMAGED	350.00	200.00
1	REAR FLOOR PANEL PLYWOOD (SN)	NOT NECESSARY	650.00	-
1	REAR FLOOR PANEL CARPET (SN)	NOT NECESSARY	850.00	-
1	GUM (SN)	NECESSARY	50.00	50.00
			2,650.00	260.00
	<u>LABOUR</u>			
	TO REMOVE & REFIT CUSHION,PLYWOOD & CARPET.		380.00	60.00
	TO REMOVE & REFIT REVERSE SENSOR AND REAR CAMERA.		100.00	80.00
	TO REMOVE & REFIT REAR WINDSCREEN.		120.00	120.00
	TO REMOVE & REFIT REAR & CENTRE EXHAUST.		380.00	80.00
	TO CHECK WIRING.		100.00	30.00
	TUFF KOTE.		150.00	80.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR TAIL LAMP PANEL,REAR TAIL LAMP LOWER COVER AND REAR FLOOR PANEL.		1,800.00	900.00
	SPRAY PAINTING.		1,600.00	900.00
			4,630.00	2,250.00
	GRAND TOTAL		22,429.35	8,516.71
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,800.00

Report Ref No. CC6/CTI20007773/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBH 9742S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

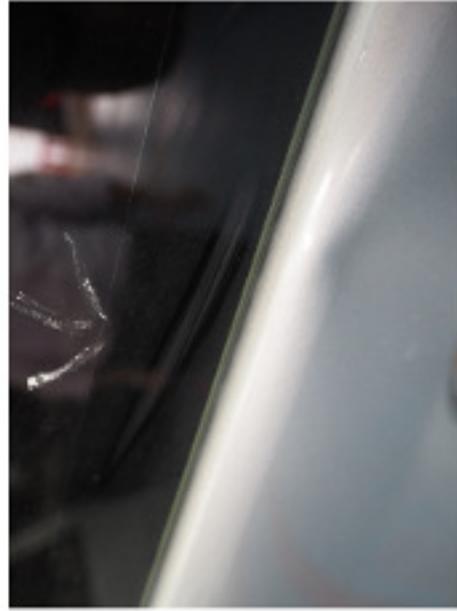



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

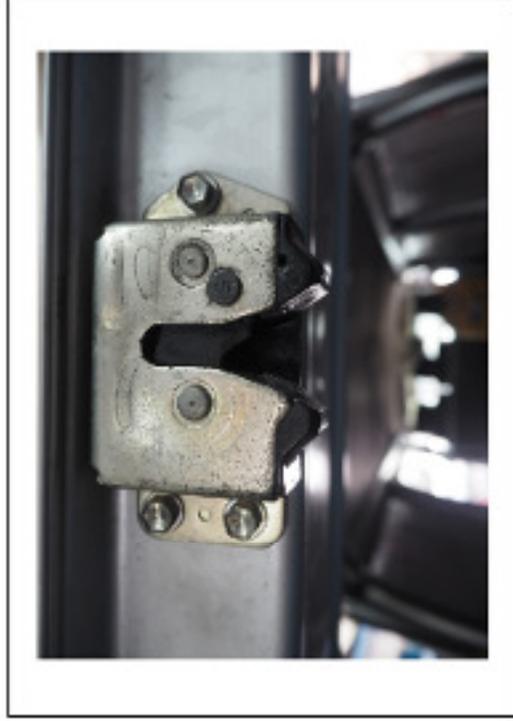



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBH 9742S

RE-INSPECTION

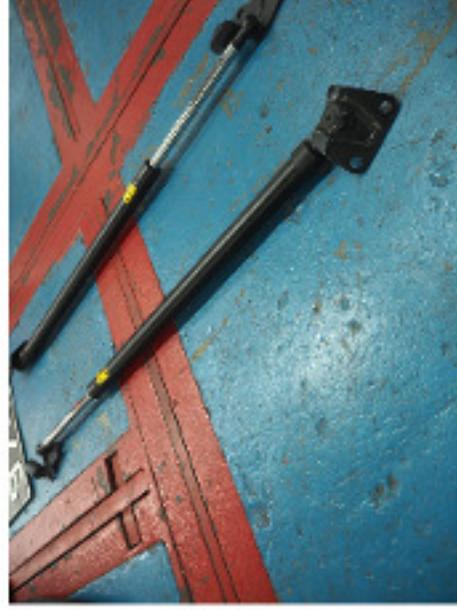





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

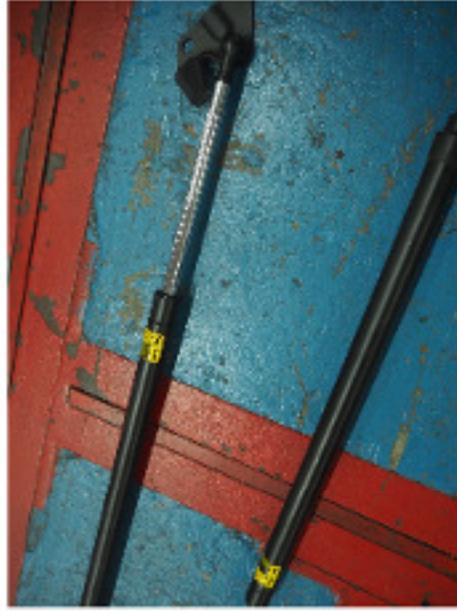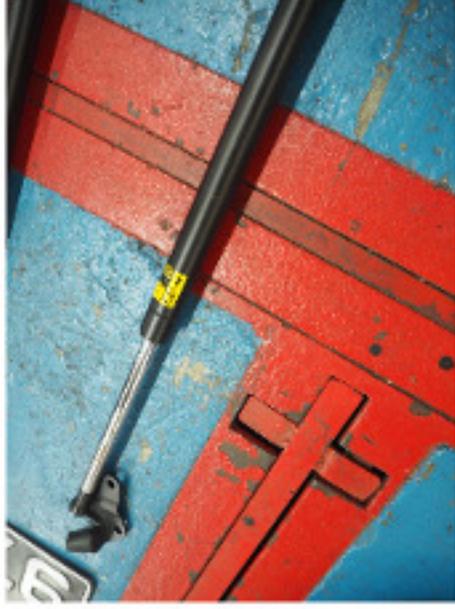



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

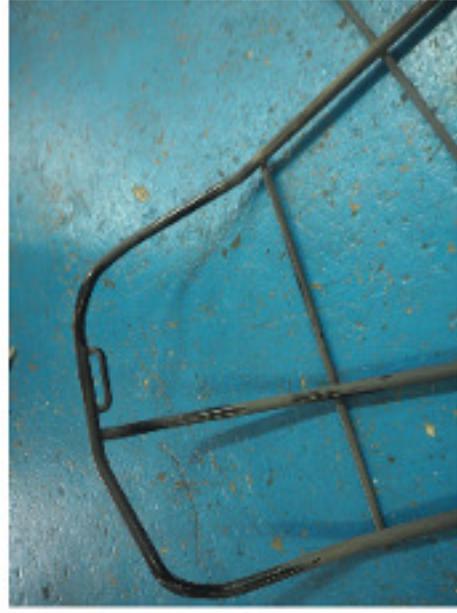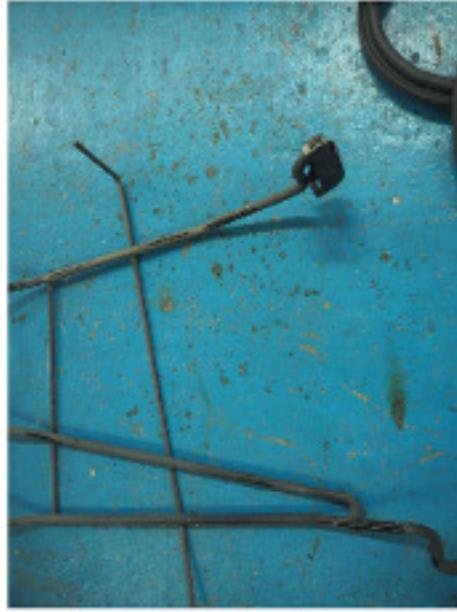




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

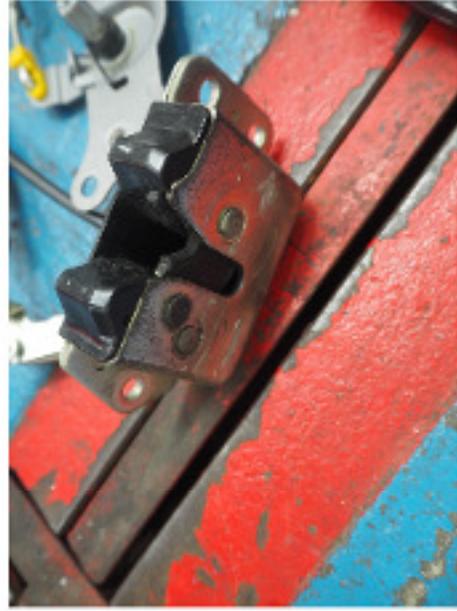




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

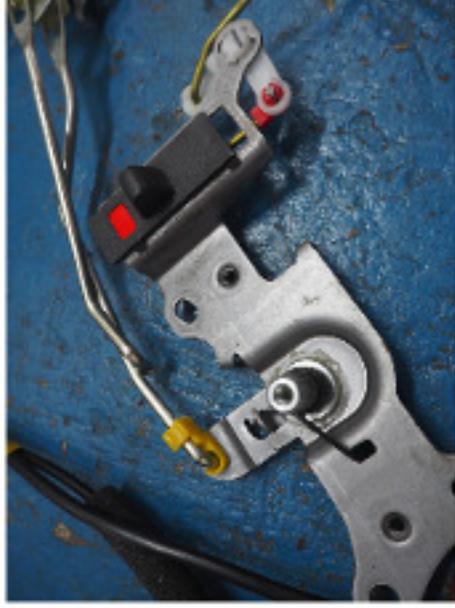




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

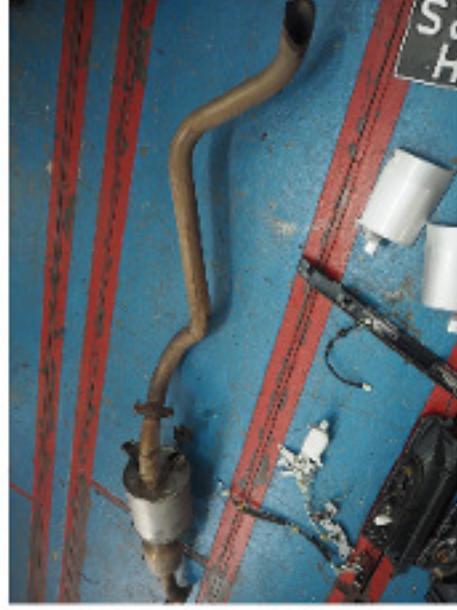




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

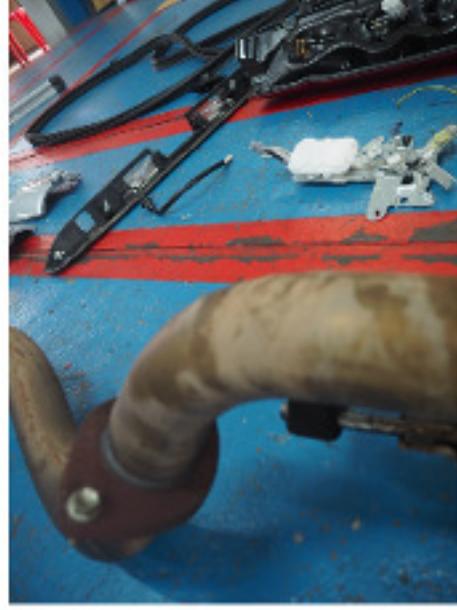



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Payo Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

