



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102716

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 16/04/2021
Reference CC4/FCI20007841/Ugs3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMG 4227X
Insured Veh. SH 9180L
Claim No. D20002975MFSH
Policy No. D-20094922MFSH
Accident Date 25/07/2020
Inspection Date 13/08/2020

Description	Total
Survey Inspection	376.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	376.00
GST (7%)	26.32
Grand Total	402.32

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20007841/Ugs3q2	
			Date: 16/04/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SH 9180L	Veh. Inspected	SMG 4227X	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20002975MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	29/07/2020	
2. Vehicle Particulars & Condition				
Make & Model	KIA CARENS (A)	c.c	1685	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	KNAHU815VJ7211460	Colour	RED	
Odometer	134946 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	ACHILLES	6 mm	
L/H Front Tyre	205/55 R16	ACHILLES	6 mm	
R/H Rear Tyre	205/55 R16	ACHILLES	6 mm	
L/H Rear Tyre	205/55 R16	ACHILLES	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/07/2020	Inspection Date	13/08/2020	
Survey held at	TAN LIM MOTOR PTE LTD NO.1 DEFU LANE 6 SINGAPORE 539365			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMG 4227X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DISTORTED	695.00	695.00
1	FRONT BUMPER SIDE RETAINER N/S	BENT	23.00	23.00
1	FRONT BUMPER CENTRE GRILLE	NOT NECESSARY	428.00	-
1	FRONT BUMPER LOWER GRILLE	TO REPAIR SEE LABOUR	159.00	-
1	FRONT BUMPER PARKING SENSOR -INNER	NOT FITTED	162.00	-
1	FRONT BUMPER PARKING SENSOR HOLDER	NOT FITTED	23.00	-
1	FRONT BUMPER TOP RUBBER SEAL	NOT NECESSARY	28.00	-
1	RADIATOR GRILLE	NOT NECESSARY	428.00	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	389.00	-
1	FRONT BUMPER FOAM	NOT NECESSARY	68.00	-
2	AIRCON CONDENSER AIR GUIDE @\$24.00	NOT NECESSARY	48.00	-
1	N/S HEADLAMP	CRACKED	1,558.00	1,558.00
1	N/S HEADLAMP BRACKET	CRACKED	23.00	23.00
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	58.00	-
1	N/S FRONT FENDER	TO REPAIR SEE LABOUR	425.00	-
1	N/S FRONT FENDER INNER COWLING	TORN	75.00	75.00
6	N/S FRONT FENDER INNER COWLING CLIPS @\$4.50	NECESSARY	27.00	27.00
1	FRONT BUMPER FOG LAMP O/S	CRACKED	206.00	206.00
1	FRONT BUMPER FOG LAMP COVER N/S	CUT	115.00	115.00
1	FRONT SUPPORT PANEL (ADDITIONAL)	CRACKED	628.00	628.00
	LESS 10% DISCOUNT		-556.60	-335.00
			5,009.40	3,015.00
<u>SPECIAL NETT ITEMS</u>				
1	N/S FRONT WHEEL RIM (SN)	TO REPAIR SEE LABOUR	750.00	-
1	N/S FRONT WHEEL TYRE (SN)	NOT NECESSARY	250.00	-
			1,000.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO TRANSFER OF TYRE ,RIM AND ON WHEEL BALANCING . }		50.00	60.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT . }		80.00	-
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	150.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED .		80.00	20.00
	TO REINSTALL OF FRONT BUMPER PARKING SENSOR .	NOT NECESSARY	80.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTIO ,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FRONT BUMPER LOWER GRILLE ,N/S FRONT FENDER AND N/S FRONT WHEEL RIM .		550.00	550.00
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		750.00	460.00
			1,740.00	1,090.00
	GRAND TOTAL		7,749.40	4,105.00
RECOMMENDED COST OF REPAIRS				4,105.00

Report Ref No. CC4/FCI20007841/Ugs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 4227X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

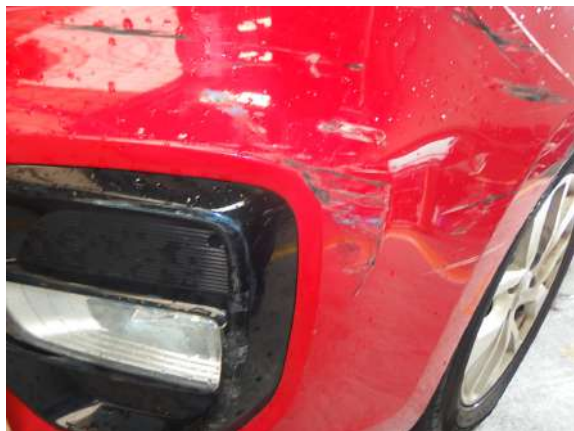




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

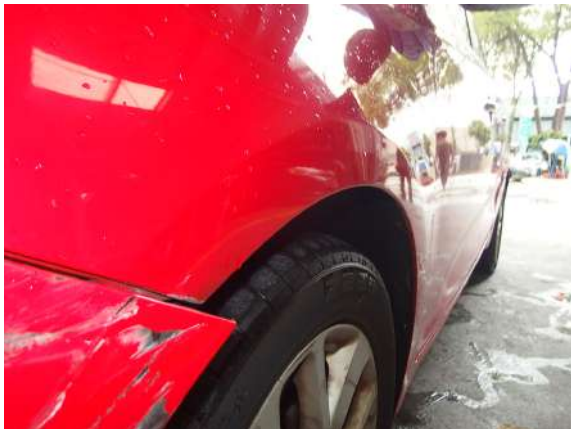



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

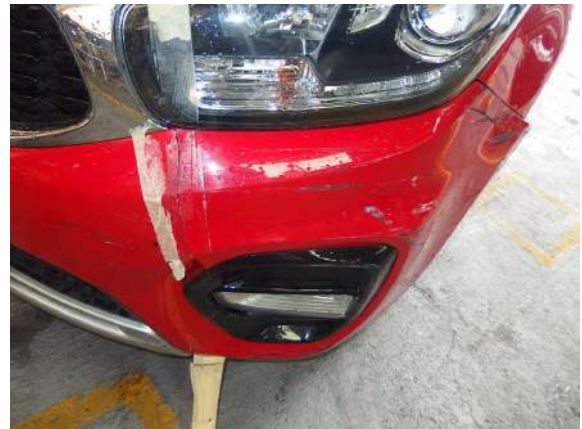



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 4227X

RE-INSPECTION

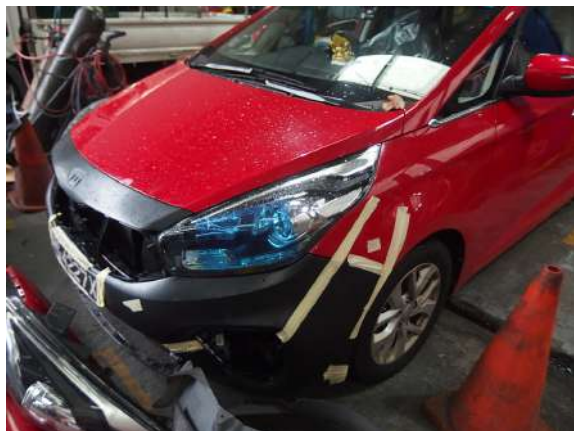



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 4227X

RE-INSPECTION

