

ASSIGNMENT

COB Dec 2025

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____


Insured: SMD 3015MPolicy No. MT104996Claims No. M2003728

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

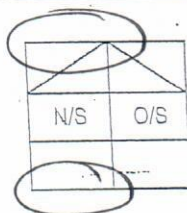Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 119 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHB6202P Yr Regn: Dec / 2017Type: M.Car / M.Cycle / Bus / Van / Lorry (Taxi) Prime Mover /

Truck / Trailer or _____

Make: Hyundai I40 C.C. 1685Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 333234 T/Radio: Insured / Std / NI / NAEng/No: D4FDHU730242C/No: KMHLB41UMHU100017Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/60 R16R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Front _____ Rear _____

R/Bal. S mm R/Bal. S mmL/Bal. S mm L/Bal. S mmD.O.A. 30/07/2020 D.O.A. 04/08/2020Survey held at Bijoy Sin Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear 4 1/3 Front

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Tokio SMD 3015M05/8/20 @ 10.17am revised to Ong Chin Keat via Maxman.28/10/2020 Juma 2/3 16700/- with 11 days of rev
(Lum & 20862.32, 56%)

Date/Time, File Pass to?

☐ : Prel. Report29/10 11/17☐ : Final Report

Date/Time, File Return to?

2)

Report Format :

MEB-TP

Lump Sum / I.B.H. (\$

16700)Days Of Repair: 11Resurvey No. of Trip: 2

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS \$ _____

Photos

Others

TOTAL

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 3-Aug-20

INSURANCE: Tokio Marine

MODEL: HYUNDAI I40

VEHICLE NO.: SHB6020P

DESCRIPTION	QTY	LIST PRICE	AMOUNT
BOOTLID <i>dent</i>	1	\$2,174.90	\$2,174.90
BOOTLID RUBBER <i>deformed</i>	1	\$96.50	\$96.50
BOOTLID HINGE (LH/RH) <i>SLC</i>	2	\$284.60	\$569.20
BOOTLID LOCK UPPER <i>Down</i>	1	\$114.90	\$114.90
BOOTLID LOCK LOWER <i>1st</i>	1	\$23.20	\$23.20
BOOTLID I40 EMBLEM (I40) <i>Hec</i> <i>27-90</i>	1	\$67.90	\$67.90
BOOTLID 'H' EMBLEM <i>Hec</i> <i>28-70</i>	1	\$63.10	\$63.10
BOOTLID CRDI PLATE <i>Hec</i> <i>27-90</i>	1	\$52.40	\$52.40
BOOTLID LAMP (LH/RH) <i>crack / broken</i> <i>565-60 X 2</i>	2	\$1,131.20	\$2,262.40
LICENSE LAMP (LH/RH) <i>HH</i>	2	\$56.10	\$112.20
BOOTLID TRIMBOARD <i>turn</i>	1	\$343.90	\$343.90
BOOTLID TRIMBOARD CLIPS (11 PCS) <i>Hec</i>	1	\$11.00	\$11.00
BOOTLID MOULDING (I40) <i>regr</i>	1	\$385.30	\$385.30
BOOTLID LOWER GARNISH CHROME(I40) <i>SLC</i>	1	\$227.90	\$227.90
REAR BUMPER <i>Dent</i> <i>1 turn</i> <i>553.00</i>	1	\$1,106.00	\$1,106.00
REAR BUMPER REINFORCEMENT BRACKET <i>Dent</i>	2	\$160.60	\$321.20
REAR BUMPER REINFORCEMENT <i>broken</i>	1	\$428.40	\$428.40
REAR BUMPER CLIP <i>Hec</i>	1	\$19.00	\$19.00
REAR BUMPER SPONGE <i>turn</i>	1	\$119.50	\$119.50
REAR BUMPER UNDER COVER <i>1st / deformed</i>	1	\$228.00	\$228.00
REAR BUMPER RUBBER MAT / I40 PLATE <i>deformed</i>	1 <i>SL</i>	\$50.00	\$50.00
REAR BUMPER REFLECTOR LAMP (I40) <i>o/s rim n/s broken</i>	2	\$32.00	\$64.00
TAIL LAMP (LH) <i>broken</i>	1	\$697.80	\$697.80
TAIL LAMP QUARTER PANEL (LH) <i>Dent</i>	2 <i>26501</i>	\$453.00	\$453.00
REAR PANEL <i>Dent</i>	1	\$526.70	\$526.70
REAR PANEL LOWER <i>Dent</i>	1	\$367.20	\$367.20
REAR PANEL GARNISH <i>mounting deformed</i>	1	\$57.70	\$57.70
PANEL ASSY-REAR FLOOR SIDE (LH) <i>HH</i>	1	\$177.00	\$177.00
SPARE TYRE HOLDER <i>broken</i>	1	\$223.10	\$223.10
SPARE WHEEL LOCK NUT <i>broken</i>	1	\$41.80	\$41.80
SPARE TYRE PANEL <i>Dent</i> <i>photo</i>	1	\$852.80	\$852.80
SPARE TYRE PANEL CUSHION <i>HH</i>	1	\$223.10	\$223.10
MEMBER-ASSY-REAR FLOOR CENTRE <i>HH</i>	1	\$570.40	\$570.40
REAR TOWING HOOK <i>HH</i>	1	\$194.60	\$194.60
EXHAUST PIPE INSULATOR (LH) <i>HH</i>	1	\$117.10	\$117.10
EXHAUST SILENCER (LH) <i>SL</i> <i>967.70</i>	1	\$1,935.40	\$1,935.40
EXHAUST PIPE HANGER <i>HH</i>	1	\$117.10	\$117.10
REAR FENDER <i>n/s Dent</i>	1	\$2,171.40	\$2,171.40
REAR FENDER UNDER SHIELD(LH) <i>HH</i>	1	\$338.60	\$338.60
FUEL LID COVER LH <i>HH</i>	1	\$82.10	\$82.10
REAR FENDER AIR-DUCT (LH) <i>HH</i>	1	\$51.60	\$51.60
REAR FENDER TRIM BOARD (LH) <i>deformed / turn</i>	1 <i>188.75</i>	\$688.75	\$688.75
REAR WINDSCREEN MOULDING <i>Hec</i>	1	\$51.80	\$51.80

BONNET <i>Dented</i>	1	\$2,265.90	\$2,265.90	✓
BONNET RUBBER (LH) <i>HN</i>	1	\$35.70	\$35.70	X
BONNET RUBBER (RH) <i>HN</i>	1	\$35.70	\$35.70	X
BONNET HINGE (LH/RH) <i>ist</i> 41.00 X 2	82.002	\$126.70	\$253.40	✓
BONNET LOCK <i>HN</i>	1	\$142.40	\$142.40	X
BONNET ABSORBER (LH ONLY) <i>HN</i>	1	\$61.60	\$61.60	X
BONNET INSULATOR <i>HN</i>	1	\$202.50	\$202.50	X
BONNET SEAL <i>HN</i>	1	\$31.90	\$31.90	X
BONNET INSULATOR CLIPS <i>HN</i>	1	\$15.00	\$15.00	X
BONNET CABLE <i>HN</i>	1	\$69.60	\$69.60	X
FRONT BUMPER COVER <i>Dented</i>	1	\$1,052.20	\$1,052.20	✓
FRONT BUMPER SPONGE <i>tom</i> 99.20	1	\$379.20	\$379.20	✓
FRONT BUMPER REINFORCEMENT <i>ist</i> 402.10	1	\$588.40	\$588.40	✓
FRONT BUMPER GRILLE (LH) <i>distorted</i> 93.60	1	\$149.20	\$149.20	✓
FRONT BUMPER BRACKET TOP (LH/RH) <i>HN</i>	2	\$44.80	\$89.60	X
FRONT BUMPER BRACKET (LH/RH) <i>N/S broken o/s HN</i>	2 24.60	\$49.20	\$98.40	✓
FRONT BUMPER RETAINER MOUNTING <i>HN</i>	1	\$76.20	\$76.20	X
FRONT BUMPER GRILLE AIR DUCT (LH) <i>HN</i>	1	\$126.20	\$126.20	X
HEADLAMP SUPPORT PANEL ASSY <i>broken photo</i>	1	\$907.40	\$907.40	✓
HEADLAMP (LH) <i>broken</i> 1388.00	1	\$2,776.00	\$2,776.00	✓
HEADLAMP SUPPORT TOP COVER <i>HN</i>	1	\$222.60	\$222.60	X
RADIATOR <i>HN</i>	1	\$1,637.20	\$1,637.20	X
RADIATOR GUARD (LH/RH) <i>HN</i>	2	\$76.50	\$153.00	X
COOLANT <i>HN</i>	1	\$ 45.00	\$ 45.00	X
RADIATOR FAN BLADE, COWLING, MOTOR ASSY <i>HN</i>	1	\$1,194.20	\$1,194.20	X
RADIATOR EXPANSION TANK <i>HN</i>	1	\$163.80	\$163.80	X
FRONT FENDER (LH) <i>Brc</i>	1	\$566.30	\$566.30	✓
FRONT FENDER APRON PANEL (LH) <i>Brc photo</i>	1	\$637.00	\$637.00	✓
FRONT FENDER SHIELD (LH) <i>svc</i>	1	\$174.90	\$174.90	X
AIRCON CONDENSER <i>HN</i>	1	\$947.80	\$947.80	X
FRONT WINDSCREEN MOULDING <i>HN</i>	1	\$133.70	\$133.70	X
INTER COOLER <i>ist</i>	1	\$1,032.50	\$1,032.50	✓
20605.25				
SUB TOTAL			\$35,044.45	
LESS 20%	16484.20		\$7,008.89	
DISCOUNTED TOTAL			\$28,035.56	
BOOTLID COMFORT LOGO & TEL NO. STICKER <i>Hec</i> SN	1	\$16.60	\$16.60	✓
REAR NO. PLATE <i>HN</i> SN	1	\$25.00	\$25.00	X
REAR BUMPER RESERVE SENSOR <i>Dem</i> SN	1	\$118.00	\$118.00	✓
REAR WINDSCREEN SEALANT <i>Hec</i> SN	1	\$46.00	\$46.00	✓
FRONT WINDSCREEN SEALANT <i>Hec</i> SN	1	\$45.00	\$45.00	✓
275.60				
SUB TOTAL			\$250.60	
Labour Charge				
Panel Beating	1	\$1,600.00	\$1,600.00	1200/-
Spray Painting Charge	1	\$1,400.00	\$1,400.00	1000/-
Wiring Charge	1	\$160.00	\$160.00	30/-
Tuff Kote	1	\$160.00	\$160.00	40/-
Towing Charge	1	\$80.00	\$80.00	HN
Remove/Refix Cushion & Upholstery Rear	1	\$150.00	\$150.00	80/-
Remove/Refix Reverse Sensor	1	\$120.00	\$120.00	40/-
Remove/Refix Exhaust Pipe	1	\$80.00	\$80.00	60/-
Remove/Refix Fuse Box	1	\$120.00	\$120.00	HN

Rear

Remove/Refix Front Windscreen Glass	1	\$120.00	\$120.00
Remove/Refix Radiator	1	\$90.00	\$90.00
Remove/Refix Aircon & Refill Gas	1	\$130.00	\$130.00
Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$550.00
TOTAL LABOUR		2530.00	\$4,760.00
ESTIMATE TOTAL			\$ 33,046.16

80/-
122
122

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.


04/08/2020 @ 0915hrs

NA Antenna

L/Sun & 11 days.

Ryan

LKK Auto

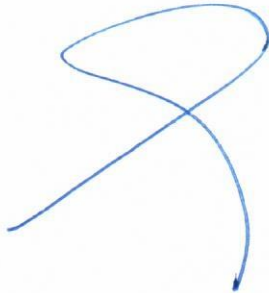

19289.80

Supp 1668.64

20958.44

L/S 16700/-

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

3756232

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 4-Aug-20

INSURANCE: Tokio

MODEL: HYUNDAI I40

VEHICLE NO.: SHB 6202P (S)

DESCRIPTION	QTY	LIST PRICE	AMOUNT
TAIL LAMP (RH) <i>crack</i>	1	\$697.80	\$697.80
REAR FENDER <i>ofs repn</i>	1	\$2,171.40	\$2,171.40
HEADLAMP (RH) <i>monity crack</i> <i>1388.00</i>	1	\$2,776.00	\$2,776.00
<i>RH</i>			
SUB TOTAL			\$5,645.20
LESS 20%			\$1,129.04
DISCOUNTED TOTAL			\$4,516.16

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

Ting
04/08/2020
LKK Auto
8

2085.80
202 1668.64
==