



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (SINGAPORE) PTE LTD

INV No. AC2100940

1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV Date 10/02/2021
Reference CC6/QBE20008118/Apa3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. GBC 1329G
Insured Veh. GBB 5751Z
Claim No. VC013855
Policy No. 8-V0008490-MVA-R006
Accident Date 04/08/2020
Inspection Date 05/08/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (SINGAPORE) PTE LTD 1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583			Ref: CC6/QBE20008118/Apa3q2	
			Date: 10/02/2021	
			Code: QBE	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBB 5751Z	Veh. Inspected	GBC 1329G	
Policy No.	8-V0008490-MVA-R006	Coverage (\$)	0.00	
Claim No.	VC013855	Excess (\$)	0.00	
Assign From		Assign Date	05/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN URVAN	c.c	2953	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	JN1MG4E25Z0795317	Colour	WHITE	
Odometer	353942 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15C	DUNLOP	6 mm	
L/H Front Tyre	195 R15C	DUNLOP	6 mm	
R/H Rear Tyre	195 R15C	DUNLOP	6 mm	
L/H Rear Tyre	195 R15C	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S AND REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/08/2020	Inspection Date	05/08/2020	
Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBC 1329G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	NOT NECESSARY	514.70	-
8	FRONT BUMPER CLIP @\$6.50	NOT NECESSARY	52.00	-
1	FRONT R/H BUMPER SIDE RETAINER	NOT NECESSARY	147.00	-
1	FRONT R/H BUMPER FOG LAMP COVER	NOT NECESSARY	130.10	-
1	FRONT R/H HEAD LAMP	NOT NECESSARY	403.00	-
1	FRONT R/H HEAD LAMP LOWER BRACKET	NOT NECESSARY	315.00	-
1	FRONT R/H SIGNAL LAMP	NOT NECESSARY	219.00	-
1	FRONT R/H SIDE CORNER PANEL	NOT NECESSARY	477.70	-
1	REAR BOOT LID	DENTED	1,916.20	1,916.20
2	REAR BOOT LID HINGE @\$71.80	NOT NECESSARY	143.60	-
2	REAR BOOT LID SHOCK ABSORBER @\$277.10	NOT NECESSARY	554.20	-
1	REAR BOOT LID EMBLEM LOGO	NECESSARY	64.80	64.80
1	REAR BOOT LID WIPER COVER	NOT NECESSARY	28.50	-
1	REAR BOOT LID INNER LOCK	NOT NECESSARY	323.10	-
1	REAR BOOT LID INNER RUBBER	NOT NECESSARY	180.80	-
1	REAR BOOT LID WINDSCREEN SEAL	NECESSARY	205.00	205.00
1	REAR L/H TAIL LAMP	CRACKED	230.80	230.80
1	REAR L/H TAIL LAMP PANEL	DENTED	297.00	297.00
1	REAR L/H TAIL LAMP INNER PANEL	TO REPAIR SEE LABOUR	264.00	-
1	REAR BUMPER	TORN	660.60	660.60
8	REAR BUMPER CLIP @\$6.50	NECESSARY	52.00	30.00
2	REAR BUMPER SIDE RETAINER @\$22.10	NECESSARY	44.20	44.20
1	REAR BUMPER CENTRE STEP PANEL	NOT NECESSARY	162.60	-
4	REAR BUMPER CENTRE STEP PANEL CLIP @\$6.50	NOT NECESSARY	26.00	-
1	REAR L/H FENDER	DISTORTED	1,972.70	1,972.70
1	REAR L/H FENDER INNER PANEL	TO REPAIR SEE LABOUR	1,110.10	-
1	REAR L/H FENDER HOUSING	TO REPAIR SEE LABOUR	550.50	-
1	REAR L/H FENDER SLIDING DOOR MOULDING	NOT NECESSARY	101.50	-
1	REAR L/H FENDER INNER TRIM BOARD	NOT NECESSARY	550.00	-

Report Ref No. CC6/QBE20008118/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	REAR L/H FENDER INNER TRIM BOARD CLIP @\$6.50	NOT NECESSARY	65.00	-
1	REAR END PANEL OUTER	TO REPAIR SEE LABOUR	388.50	-
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	611.80	-
8	REAR END PANEL CLIP @\$6.50	NOT NECESSARY	52.00	-
1	REAR END PANEL TOP MOULDING	NOT NECESSARY	95.90	-
	LESS 10% DISCOUNT		-	-542.13
			12,909.90	4,879.17
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT R/H BUMPER FOG LAMP (SN)	NOT NECESSARY	323.70	-
1	REAR BUMPER REVERSE SENSOR (SN)	NOT NECESSARY	380.00	-
1	REAR BOOT LID WINDSCREEN SEAL (SN)	NECESSARY	105.00	60.00
1	REAR BOOT LID INNER TRM BOARD (SN)	NOT NECESSARY	220.00	-
1	REAR BOOT LID 70KM/H STICKER (SN)	NECESSARY	20.00	10.00
10	REAR BOOT LID INNER TRIM BOARD CLIP @\$6.50 (SN)	NOT NECESSARY	65.00	-
1	REAR BOOT LID NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	REAR BOOT LID WINDSCREEN SEAL (SN)	REPEATED	205.00	-
1	REAR L/H FENDER ADVERTISEMENT STICKER (SN)	NECESSARY	650.00	250.00
			2,018.70	320.00
	<u>LABOUR</u>			
	TO REMOVE & REFIT REAR WINDSCREEN .		120.00	120.00
	GUM .		50.00	50.00
	TO REMOVE & REFIT REVERSE SENSOR .		100.00	50.00
	TO CHECK WIRING .		100.00	30.00
	TOWING FEE.		150.00	60.00
	TUFF KOTE.		150.00	80.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR L/H TAIL LAMP INNER PANEL,REAR L/H FENDER INNER PANEL,REAR L/H FENDER HOUSING,REAR END PANEL OUTER AND REAR END PANEL INNER.		2,200.00	800.00
	SPRAY PAINTING .		2,000.00	1,000.00
	TO REMOVE AND REFIT UPHOLSTERY .		150.00	80.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER BOOT LID FITTINGS .		150.00	80.00
			5,170.00	2,350.00
GRAND TOTAL			20,098.60	7,549.17
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC6/QBE20008118/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 1329G

INSPECTION

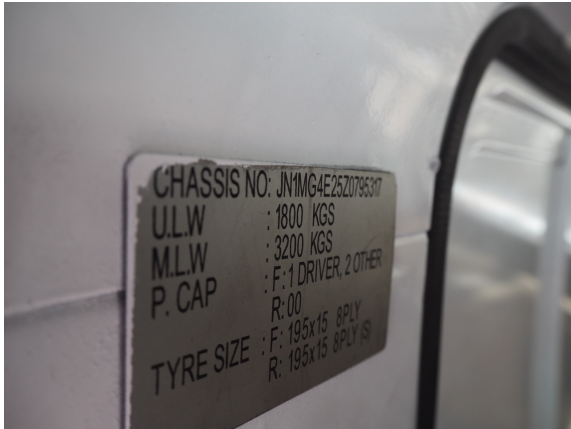



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 1329G

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

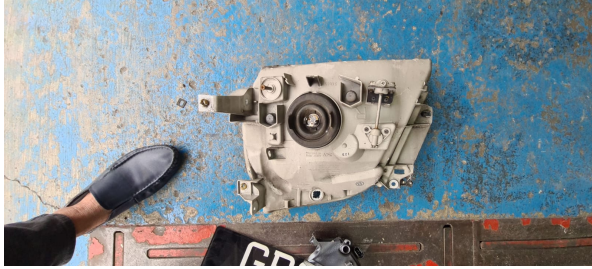



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 1329G

RE-INSPECTION

