

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SM A8060P Yr Regn: 2009 / Oct
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Chevrolet Cruze C.C. 1598
 Colour: Grey A/C: Insured / Std / NI / NA
 Sp Reading: 1 / 52613 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: KLJTA696IAKS49 258
 Gen. Cond: Good Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Mod: Nil (S/Rim) / STD A/Rim or
 Tyre Size: F: 225/45R17
 R: 225/45R17
 BS: DUN EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or
 Front Rear
 R/Bal. 26 mm R/Bal. 26 mm
 L/Bal. 26 mm L/Bal. 26 mm
 D.O.A. _____ D.O.I. 19/08/20
 Survey held at Precise
 Des. of Damages: Frt / Rear / 03 / N/S U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	TP INC Reinspection.

MV :
 PV :
 Nett,

Date/Time, File Pass to? ☐ : Preli. Report
☐ : Final Report

1) Date/Time, File Return to?

2)

Report Form: _____

Emp. Sign / L.B. : _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Insp. (\$)
☐ : Wash and

Survey Fee:
 Transportation:

3 + PS. \$

Fuel:

Other:

TOTAL

CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X
Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Shawgi Bin Abu Bakar Abdat
Block 328 Sembawang Crescent #09-10
Singapore 750328

Your Ref : SMA 8060 P
Our Ref : 201809217/CA
Date : 30 October, 2018
Survey : Third Party

SURVEY REPORT

PARTICULARS OF VEHICLE

Vehicle No.	: SMA 8060 P	Propellant	: Petrol, Auto
Make	: Chevrolet	Capacity	: 1600 cc
Type of Body	: 4 Doors Saloon	Mileage	: 83090
Year & Model	: 2009, Cruze 1.6L	Engine No	: F16D34774101
Colour	: Grey	Chassis No	: KL1JA6961AK549258
Passenger-cap	: 4	Road Tax	: October, 2018

TYRES CONDITIONS

Front Left	: Michelin	Worn	: 10%	Size	: 215/50 R17
Front Right	: Michelin	Worn	: 10%	Size	: 215/50 R17
Rear Left	: Falken	Worn	: 10%	Size	: 215/50 R17
Rear Right	: Falken	Worn	: 10%	Size	: 215/50 R17

PRE-ACCIDENT CONDITION (Static Test Only)

Handbrake	: Serviceable	Steering	: Serviceable
Footbrake	: Serviceable	Paintwork	: Good

QUANTUM

Repair Estimate : \$ 11,045.00
Revised Amount : \$ 8,200.00 (Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be: ten (10) days.
We have not authorised repairs.

Survey Done At : Precise Auto Service
1 Kaki Bukit Avenue 6, #02-34/36
Autobay @ Kaki Bukit
Singapore, 417883

Assignment Date : 11 September, 2018
Survey Date : 11 September, 2018
Accident Date : 10 September, 2018
Assignment Given By : Shawgi Bin Abu Bakar Abdat

Our Ref: 201809217/CA

Vehicle No. SMA 8060 P

Description	Qty	Repair Estimate	Revised Amount	Remarks
Rear bumper fascia	1	1,151.00	1,151.00	Torn/Deformed
Rear bumper side retainer o/s	1	18.00	18.00	To Replace
Rear bumper side attachment o/s	1	15.00	15.00	To Replace
Rear bumper clip	10	35.00	35.00	To Replace
Rear bumper side retainer rivert o/s	6	15.00	15.00	To Replace
Rear fender o/s	1	1,757.00	1,757.00	Badly Bent/Dented
Rear fender air louver o/s	1	40.00	40.00	Torn/Deformed
Rear fender splash shield o/s	1	78.00	78.00	Torn/Deformed
Rear fender splash shield clip o/s	8	28.00	28.00	To Replace
Rear axle beam	1	2,622.00	2,622.00	Bent
Rear shock absorber o/s	1	190.00	190.00	Bent
Rear wheel bearing hub o/s	1	372.00	372.00	To Replace
Rear shock absorber mounting o/s	1	88.00	88.00	To Replace
Rear windsrceen glass moulding	1	55.00	55.00	To Replace
Rear windsrceen glass inner seal	1	42.00	42.00	To Replace
Rear windsrceen glass clip	14	49.00	49.00	To Replace

6,555.00	6,555.00
-	655.50 Less 10%
6,555.00	5,899.50

SPECIAL NETT

Rear alloy sport rim o/s	1	680.00	680.00	Grazed/Bent
Rear tyre o/s	1	300.00	300.00	Damaged
Rear windscreen glass sealant	1	60.00	60.00	To Replace

Total Materials Cost :	7,595.00	6,939.50
-------------------------------	-----------------	-----------------

Our Ref: 201809217/CA

Vehicle No. SMA 8060 P

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		7,595.00	6,939.50	
<u>Labour & Miscellaneous Charges</u>				
To provide towing service.		80.00	70.00	
To remove/refit wire harness, all related connectors. Check proper function.		120.00	90.00	
To conduct wheel alignment (Before & After).		240.00	240.00	
To apply underseal and rust-proofing on the affected areas.		180.00	150.00	
To remove/refit rear windscreen glass.		180.00	140.00	
To remove/refit boot garnishes, speakers, interior garnishes, carpets where necessary. To remove/refit roof lining. To remove/refit seats, carpets and interior garnishes to enable repairs.		320.00	280.00	
To remove/refit rear undercarriage/suspension assembly with all attachments/components.		480.00	450.00	
To renew o/s rear wheel rim/tyre and conduct wheel balancing.		150.00	120.00	
To spray paint replaced/repaired body parts inclusive of preparatory works and painting materials.		800.00	700.00	
To remove all damaged parts with all necessary components/attachments. To apply hot-works where necessary, straighten chassis members, repair/reshape dented body panels, in accordance with factory specifications. Replace damaged parts, refit and align into position. Refit all necessary components/attachments.		900.00	850.00	
Grand Total:		11,045.00	10,029.50	

Summary

Total Material	7,595.00	6,939.50
Total Labour/Painting	3,450.00	3,090.00
Grand Total	11,045.00	10,029.50
Lump-sum Amount		8,200.00

Our Ref: 201809217/CA

Vehicle No. SMA 8060 P

CAUSE OF DAMAGE

The vehicle sustained impact along the offside rear.


REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.

We checked the damage carefully and were of the opinion that the vehicle could be repaired.
We would therefore recommend repairs to be carried out at: \$ 8,200.00 on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS

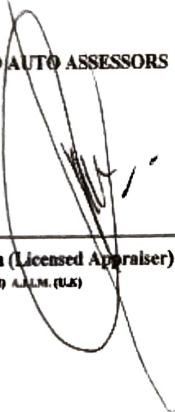

Tan Chin Suan (Licensed Appraiser)
A.M.A.M.L., T Eng (CER) A.A.M.M. (U.K.)