



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2108375

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 06/12/2021
Reference CC4/FCI20008311/Ars3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLQ 5017M
Insured Veh. SHB 3063T
Claim No. D20003135MFSH
Policy No. D-20094921MFSH
Accident Date 06/08/2020
Inspection Date 12/08/2020

Description	Total
Third Party Express Settlement	500.00
Subtotal	500.00
GST (7%)	35.00
Grand Total	535.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20008311/Ars3q2	
			Date: 06/12/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHB 3063T	Veh. Inspected	SLQ 5017M	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20003135MFSH	Excess (\$)	0.00	
Assign From	ERIC	Assign Date	12/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA C-HR HYBRID	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	ZYX102010004	Colour	BLACK	
Odometer	74822 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/55 R18	YOKOHAMA	6 mm	
L/H Front Tyre	225/55 R18	YOKOHAMA	6 mm	
R/H Rear Tyre	225/55 R18	YOKOHAMA	6 mm	
L/H Rear Tyre	225/55 R18	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/08/2020	Inspection Date	12/08/2020	
Survey held at	TWINCAR AUTOMOTIVE PTE LTD 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLQ 5017M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR RH CONTROL ARM	BENT	370.40	370.40
1	REAR RH DOOR	DISTORTED	1,254.20	1,254.20
1	REAR RH DOOR CHECKER	DAMAGED	183.80	183.80
1	REAR RH DOOR GLASS REGULATOR	DAMAGED	275.00	275.00
1	REAR RH DOOR GLASS REGULATOR MOTOR	NOT NECESSARY	926.00	-
1	REAR RH DOOR HINGE (LOWER)	NOT NECESSARY	98.90	-
1	REAR RH DOOR HINGE (TOP)	NOT NECESSARY	98.90	-
1	REAR RH DOOR INNER RUBBER GUIDE STOPPER	NOT NECESSARY	18.20	-
1	REAR RH DOOR INNER TRIM BOARD	CRACKED	686.80	455.70
1	REAR RH DOOR LOCK STRIKER	NOT NECESSARY	37.00	-
1	REAR RH DOOR MECHANISM LOCK	DAMAGED	561.90	478.40
1	REAR RH DOOR PROTECTOR	CUT	209.60	209.60
1	REAR RH DOOR WEATHERSTRIP	CUT	152.70	152.70
1	REAR RH FENDER	TO REPAIR SEE LABOUR	943.60	-
1	REAR RH FENDER ARCH GARNISH	CUT	147.50	147.50
1	REAR RH FENDER INNER SHIELD	TORN	138.30	138.30
1	REAR RH KNUCKLE ARM	DAMAGED	822.30	622.00
1	REAR RH KNUCKLE ARM BEARING	NECESSARY	801.50	358.00
8	REAR RH DOOR RIVET @\$8.00	NECESSARY	64.00	40.00
1	REAR RH LOWER ARM	BENT	497.50	497.50
1	REAR RH SHOCK ABSORBER	BENT	117.20	117.20
1	REAR RH SHOCK ABSORBER TOP MOUNTING	NECESSARY	142.40	142.40
1	REAR RH STABILIZER LINK	NOT NECESSARY	179.10	-
1	REAR RH UPPER ARM	BENT	420.80	420.80
1	ROCKER GARNISH RH	DEFORMED	563.80	563.80
1	ROCKER PANEL RH	DENTED	548.70	548.70
	LESS 25% DISCOUNT		-2,565.03	-1,744.00
			7,695.07	5,232.00
1	REAR RH SPORT RIM (SN)	CUT	2,120.20	600.00

Report Ref No. CC4/FCI20008311/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-530.05	-
			1,590.15	600.00
	<u>SPECIAL NETT ITEMS</u>			
1	REAR RH 225/55R18 TYRE (SN)	NOT NECESSARY	400.00	-
1	REAR RH DOOR INNER SPEAKER (SN)	CRACKED	300.00	80.00
1	SET REAR RH DOOR INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	30.00
1	SET REAR RH DOOR PROTECTOR CLIPS (SN)	NECESSARY	40.00	20.00
1	SET REAR RH FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	40.00	30.00
1	SET REAR RH FENDER INNER SHIELD CLIPS (SN)	NECESSARY	40.00	20.00
1	SET ROCKER GARNISH RH CLIPS (SN)	NECESSARY	50.00	30.00
			920.00	210.00
	<u>LABOUR</u>			
	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND REWIRE FOR PARKING SENSOR .		80.00	30.00
	TO REMOVE ,CHARGE REAR SUSPENSION PARTS ,AXLE CARRIAGE ,ABSORBER ,LOWER ARM ,TOP ARM ,TRAILING ARM KNUCKLE ARM ,WHEEL BEARING ,BEARING HUB AND ETC.		240.00	220.00
	TO ROAD TEST DRIVING ,CHECK AND RESETTNG WHEEL ALIGNMENTS SYSTEM.		120.00	80.00
	TO REMOVE ,REINSTALL ROOF TOP TRIM UPHOLSTERY ,CUSHION SEAT ,TRIM GARNISH ,TRIM LINER CARPET (TO FR).		100.00	60.00
	TO TRANSFER DOOR GLASS ,REGULATOR GEAT ,MOTOR ,RAILING ,CHANNEL ,TRIM BOARD ,MECHANISM LOCK AND HANDLE.		80.00	80.00
	TO RE-SPRAY PAINTING ON THE CHARGE BODYPARTS ,REPAIR PORTION ,AND WHERE CONSISTENT TO THE ACCIDENT .		1,100.00	800.00
	TO PROVIDE LABOUR ,WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RECONSTRUCT AND REALIGN BODY STRUCTURE BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT .INCLUSIVE OF THE REPAIR OF REAR RH FENDER .		1,300.00	800.00

Report Ref No. CC4/FCI20008311/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		80.00	60.00
			3,100.00	2,130.00
GRAND TOTAL			13,305.22	8,172.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,500.00

Report Ref No. CC4/FCI20008311/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. SLQ 5017M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 5017M

RE-INSPECTION

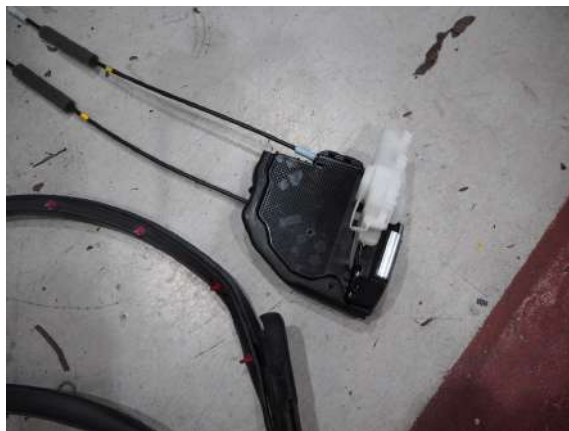



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

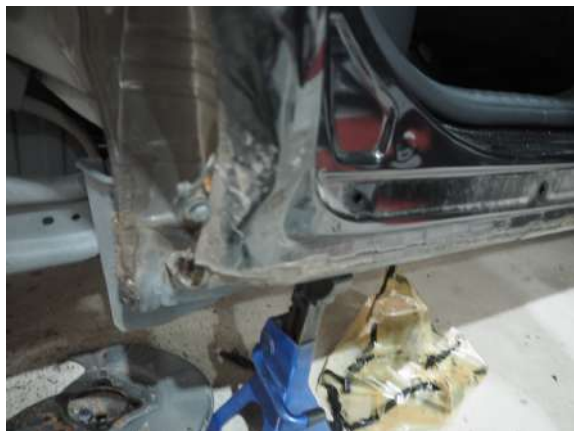



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

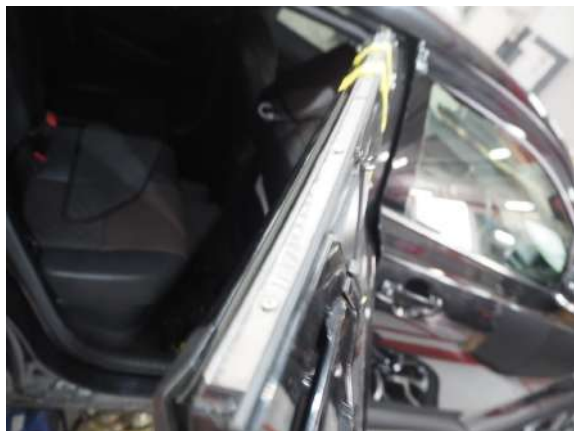



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLQ 5017M

RE-INSPECTION

