



VICOM LTD

385 Sin Ming Drive Singapore 575718

Mainline (65) 6458 4555
Facsimile (65) 6458 1040

www.vicom.com.sg
Company Registration No: 198100320K

TAX INVOICE

PROVIDENCE AUTOMOBILE PTE LTD
Block 7 Kaki Bukit Road 1
#02-08 Eunos Technolink
Singapore 415939

ATTN : MOTOR CLAIMS DEPT.

VEHICLE No. : SJY6433U
ACCIDENT DATE : 10/03/2020
CLAIM No. : NOT AVAILABLE
INSURED VEH.No: GBE269S

GST REG No. : M9-0000652-A

CUSTOMER ID : VACP0003

INVOICE No. : CL023298

INVOICE DATE : 17/04/2020

PAYMENT TERM : 30 Days Credit

DESCRIPTION	QTY	UNIT PRICE (SG\$)	AMOUNT (SG\$)
Photographs	225	1.00	\$ 225.00
Transportation	1	60.00	\$ 60.00
VAC Assessment Fee	1	686.00	\$ 686.00

GROSS AMOUNT \$ 971.00

GST @ 7% \$ 67.97

INVOICE AMOUNT \$ 1,038.97

This is a computer generated TAX INVOICE

No signature required

Cheque should be made payable to 'VICOM LTD'.

Sin Ming
385 Sin Ming Drive Singapore 575718
Tel: (65) 6455 5358 Fax: (65) 6455 8638

Bukit Batok
511 Bukit Batok St 23 Singapore 659545
Tel: (65) 6560 3312 Fax: (65) 6569 0722

Kaki Bukit
23 Kaki Bukit Ave 4 Singapore 415933
Tel: (65) 6741 6697 Fax: (65) 6749 2305

PROVIDENCE AUTOMOBILE PTE LTD
Block 7 Kaki Bukit Road 1
#02-08 Eunos Technolink
Singapore 415939



VICOM LTD
385 Sin Ming Drive Singapore 575718

Mainline (65) 6458 4555
Facsimile (65) 6458 1040

www.vicom.com.sg
Company Registration No: 198100320K

SURVEY REPORT

GENERAL INFORMATION			
VAC Ref. No.	: 557522	Claim No.	: NOT AVAILABLE
Accident Date	: 10/03/2020	Claim Type	: THIRD PARTY
Assignment Date	: 19/03/2020	Policy No.	:
Survey Date	: 19/03/2020	Finalised Dt.:	17/04/2020
Survey Report Date	: 17/04/2020		
VEHICLE PARTICULARS			
Vehicle No.	: SJY6433U	Chassis No.	: JTDGJ20W805003243
Registration Date	: 20/09/2010	Engine No.	: 3ZRA518126
Make	: TOYOTA	Engine Cap.	: 1987CC
Model	: WISH	Transmission	: AUTOMATIC
		Colour	: GREY
CONDITION OF VEHICLE DURING SURVEY (VISUAL and STATIC TEST ONLY)			
Foot Brake	: SERVICEABLE	Steering	: SERVICEABLE
Hand Brake	: SERVICEABLE	Modification	: NONE
Mileage	: 140675KM		
TYRES	SIZE	MAKE	BALANCE (mm)
FRONT RH	215/60R17	WESTLAKE	6
FRONT LH	215/60R17	WESTLAKE	6
REAR RH	215/60R17	WESTLAKE	7
REAR LH	215/60R17	WESTLAKE	7
SURVEY CONDUCTED AT			
PROVIDENCE AUTOMOBILE PTE LTD Block 7 Kaki Bukit Road 1 #02-08 Eunos Technolink Singapore 415939			
REMARKS			
[1] Workshop Estimate : S\$ 32,292.42 [2] Our Adjustment : S\$ 19,500.00 [3] Repair Period : 20 days [4] We have not authorised repairs. This survey was carried out on without prejudice basis.			

SURVEY REPORT

Annex A: Adjustment on Spare Parts

#	Qty	Vehicle Parts Description	Condition	Workshop Estimate (S\$)	VAC Adjustment (S\$)
1	1	Tailgate / CR4	Buckled	877.40	877.40 /
2	1	Tailgate Lock / Jam	Jammed	265.36	265.36 /
3	1	Tailgate Latch / BT	Bent	128.40	128.40 80
4	1	Tailgate Lock Handle X SVC	Cracked	117.70	117.70 X
5	1	Tailgate Outer Handle / CRA	Cracked	101.65	101.65 /
6	1	Tailgate Emblem Logo / NEC	Necessary	235.40	235.40 60
7	2	Tailgate Reflector / CR4	Cracked	256.80	256.80 /
8	1	Tailgate Inner Handle / Def	Deformed	192.60	192.60 30
9	1	Tailgate Inner Trim / CR4	Cracked	235.40	235.40 /
10	10	Tailgate Inner Trim Clip / NEC	Cracked	53.50	20.00 /
11	2	Tailgate Inner Trim Side Cover X SVC	Deformed	256.80	256.80 X
12	2	Tailgate Side Trim / Def	Cracked	224.70	224.70 /
13	12	Tailgate Side Trim Clip / NEC	Cracked	64.20	14.00 /
14	1	Tailgate Top Trim / Def	Cracked	235.40	235.40 /
15	20	Tailgate Top Trim Clip / NEC	Cracked	107.00	7.00 /
16	1	Tailgate Spoiler / CR4	Cracked	299.60	299.60 /
17	2	Tailgate Hinges / BT	Bent	203.30	203.30 /
18	2	Tailgate Absorber X SVC	Serviceable	642.00	0.00 X
19	2	Rear Number Plate Lamp / CRA	Cracked	117.70	117.70 /
20	1	Wiper Motor X SVC	Jammed	299.60	299.60 X
21	1	Wiper Motor Arm / CR4	Cracked	192.60	192.60 100
22	1	Wiper Motor Blade / Mis.	Missing	353.10	353.10 80
23	1	Rear Wind Screen Glass / BR	Cracked	770.40	770.40 /
24	1	Rear Wind Screen Glass Moulding / NEC	Necessary	171.20	171.20 /
25	1	Rear Bumper / CR4	Cracked	513.60	513.60 /
26	2	Rear Bumper Side Retainer / BR	Cracked	256.80	256.80 180
27	2	Rear Bumper Bracket / DD	Dented	181.90	181.90 /
28	2	Rear Bumper Reflector / CRA	Cracked	209.72	209.72 /
29	1	Rear Exhaust / BT	Buckled	535.00	535.00 480
30	2	Rear Exhaust Mounting X SVC	Deformed	256.80	256.80 X
31	1	Rear Exhaust Centre Pipe X R	Repair	235.40	0.00 X
32	2	Rear Exhaust Centre Pipe Mounting X SVC	Serviceable	246.10	0.00 X
33	1	Rear Exhaust Heat Shield / CR4	Buckled	321.00	321.00 220
34	1	Rear Exhaust Heat Shield Centre X SVC	Serviceable	299.60	0.00 X
35	2	Rear Tailamp / CRA	Cracked	813.20	813.20 638
36	2	Rear Tailamp Inner Panel / DD	Buckled	556.40	556.40 /
37	2	Roof Top Panel X R	Repair	374.50	0.00 X
38	2	Roof Top Moulding / DD	Deformed	428.00	428.00 220
39	2	Roof Top Inner Trim / Def	Deformed	197.95	197.95 /
40	1	Rear Seat Lh X SVC	Buckled	535.00	535.00 X
41	1	Rear Seat Rh X SVC	Buckled	535.00	535.00 X
42	2	Rear Chassis / BT	O/S Buckled	385.20	192.60 /
43	2	Rear Fender / DD	Buckled	834.60	834.60 /
44	2	Rear Fender Air Grille / Def	Cracked / Deformed	353.10	353.10 150
45	2	Rear Fender 1/4 Glass / CR4	Cracked	470.80	470.80 /

SURVEY REPORT

Annex A: Adjustment on Spare Parts

#	Qty	Vehicle Parts Description	Condition	Workshop Estimate (S\$)	VAC Adjustment (S\$)
46	2	Rear Fender 1/4 Glass Moulding / NEC	Necessary	267.50	267.50 ✓
47	2	Rear Fender Bottom Trim / CR4	Deformed	545.70	545.70 ✓
48	2	Rear Fender Bottom Trim Clip - NEC	Cracked	53.50	28.00 ✓
49	10	Front Top Trim X Svc	Serviceable	53.50	0.00 X
50	1	Front Top Trim Clips X Svc	Serviceable	224.70	0.00 X
51	2	Rear Fender Rear Top Trim / Def	Deformed	470.80	470.80 ✓
52	2	Rear Fender Rear Top Trim Clips / NEC	Cracked	64.20	28.00 ✓
53	2	Rear Fender Side Shield - Def	Deformed	321.00	321.00 200
54	2	Rear Fender Side Shield Clip / Nec	Cracked	53.50	14.00 ✓
55	1	Rear End Panel / DP	Buckled	454.75	454.75 462
56	1	Rear End Panel Top Garnish / CR4	Cracked	235.40	235.40 ✓
57	1	Rear End Panel Top Garnish Clip / NEC	Cracked	53.50	7.00 ✓
58	2	Weather Strip / BR	Deformed	224.70	224.70 112
59	2	Rear Floor Panel - bb	Buckled	283.55	283.55 ✓
60	2	Rear Floor Panel Carpet / Def	Torn	197.95	197.95 ✓
61	2	Rear Floor Panel Top Board Centre / CR4	Deformed	267.50	267.50 ✓
62	2	Rear Floor Panel Top Board Lh / CR4	Deformed	160.50	160.50 126
63	1	Rear Floor Panel Top Board Rh / CR4	Deformed	160.50	160.50 20
64	12	Rear Door Front Garnish Clip X Svc	Serviceable	64.20	0.00 X
65	2	Rear Door Rear Garnish X Svc	N/S Cracked	353.10	176.55 X
66	10	Rear Door Rear Garnish Clips X Svc	Cracked	53.50	7.00 X
67	2	Rear Door Weather Strip X Svc	Deformed	385.20	385.20 X
68	2	Rear Door Inner Trim X Svc	Serviceable	417.30	0.00 X
69	10	Rear Door Inner Trim Clips X Svc	Serviceable	53.50	0.00 X
70	2	Rear Door Inner Glass Moulding X Svc	Bent / Grazed	395.90	395.90 X
71	2	Rear Front Door Lh & Rh X R	Buckled	1626.40	1626.40 X
72	1	Rear Front Lh Door Glass Moulding / BR	Grazed	208.65	208.65 ✓
73	1	Rear Front Door Lock X Svc	Jammed	374.50	374.50 X
74	1	Rear Front Lh Weather Strip X Svc	Serviceable	192.60	0.00 X
75	1	Rear Front Lh Inner Trim X Svc	Serviceable	197.95	0.00 X
76	10	Rear Front Lh Inner Trim Clip X Svc	Serviceable	53.50	0.00 X
77	2	Rear Fender Inner Panel - DP	Buckled	353.10	353.10 ✓
78	1	Spare Tyre Screw X Svc	Bent	90.95	90.95 X
79	1	Spare Tyre Lock X Svc	Jammed	101.65	101.65 X
Subtotal				23956.23	20154.33
TOTAL				17967.17	15115.75

13,156.63
 - 259
 9,867.47

#	Qty	Vehicle Parts Description	Condition	Workshop Estimate (S\$)	VAC Adjustment (S\$)
SPECIAL NETT ITEM					
1	1	Rear Number Plate / CRA	Cracked	64.20	20.00 /
2	1	Rear Number Plate Holder / CRA	Cracked	85.60	30.00 /
3	1	Rear Wind Screen Glass Sealant / Nec	Necessary	321.00	60.00 40
4	1	Break Down Sign / CRA	Cracked	128.40	80.00 60
5	1	Rear Bumper Reverse Sensor / Short	Cracked	321.00	250.00 200
6	1	Reverse Camera X SVC	Malfunction	374.50	350.00 X
7	1	Rear Exhaust Chrome / PP	Dented	165.85	80.00 /
8	1	Roof Top Black Sticker / Nec	Necessary	321.00	200.00 /
9	2	Rear Tyre X SVC	Cut	470.80	400.00 X
10	2	Rear Fender Glass Sealant / Nec	Necessary	200.00	120.00 60
11	1	Spare Tyre X SVC	Serviceable	235.40	0.00 X
12	1	Spare Tyre Rim X SVC	Dented	267.50	250.00 X
TOTAL				2955.25	1840.00
TOTAL FOR SPARE PARTS				20922.42	16955.75

640

VICOM LTD
SURVEY REPORT

SJY6433U @ 10/03/2020

Annex B: Adjustment on Labour and Spray Painting

#	Job Description	Workshop Estimate (\$)	VAC Adjustment (\$)
1	Labour	5000.00	2400 3200.00
2	Spray painting	3500.00	2400.00 1800
3	Anti rust	250.00	180.00 100
4	Rewire	50.00	40.00 /
5	Upholstery	300.00	200.00 100
6	Remove, renew, refit sensor	50.00	20.00 /
7	Remove, renew, refit, rear wind screen glass	150.00	120.00 /
8	Remove, renew, refit, rear lh fender 1/4 glass	120.00	80.00 /
9	Remove, renew, refit rear rh fender 1/4 glass	120.00	80.00 /
10	Transfer old part to new rear door lh	120.00	80.00 X
11	Transfer old part to new rear door rh	120.00	80.00 X
12	Transfer old part to new front door lh	120.00	0.00 X
13	Remove, renew, refit rear panel trim	200.00	180.00 120
14	Remove, renew, refit rear seat	200.00	180.00 60
15	Remove, renew, refit rear exhaust, centre pipe	200.00	60.00 /
16	Remove, renew, refit fuel tank	100.00	60.00 /
	Remove, renew, refit reverse camera	50.00	20.00 X
18	Conduct wheel alignment	100.00	60.00 /
19	Remove & refit rear under carriage	500.00	300.00 150
20	Transfer old part to new tailgate	120.00	80.00 60

$$\begin{array}{r}
 P = 9,867.47 \\
 N = 690 \\
 L = 5,310 \\
 \hline
 15,867.47 \\
 - 20\% \\
 \hline
 12,693.98
 \end{array}$$

45
\$12,700

5,310
Repair day - 12 days

TOTAL FOR LABOUR AND SPRAY PAINTING	:	<u>11370.00</u>	<u>7420.00</u>
--	---	-----------------	----------------

Summary

Description		Workshop Estimate (S\$)	VAC Adjustment (S\$)
TOTAL FOR SPARE PARTS	:	20922.42	16955.75
TOTAL FOR LABOUR AND SPRAY PAINTING	:	11370.00	7420.00
TOTAL REPAIR COST	:	<u>32292.42</u>	<u>24375.75</u>

VICOM LTD
SURVEY REPORT
Annex C: Conclusion

SJY6433U @ 10/03/2020

ASSESSOR'S REPORT

At the place of inspection, we saw this vehicle sustained front and rear portion damage.


The damages seen during our survey were both front doors, roof top panel, both rear door assy, both rear fender assy, tail gate assy, both tail lamps assy, rear bumper assy, rear end panel assy, rear floor panel, both rear chassis, rear exhaust pipe assy and surrounding areas. A fuller detailed description of the damages is in Annex A of this survey report.

ASSESSOR'S RECOMMENDATION

Providence Automobile Pte Ltd estimated a repair cost of S\$32,292.42. We adjusted it to S\$24,375.75.

Accordingly, we recommend repairs to this vehicle be carried out on a lumpsum basis at S\$19,500.00.

The repairs would require a period of 20 working days.

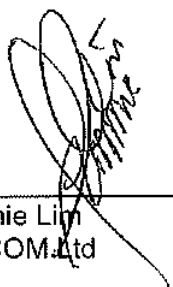

Tommie Lim
for VICOM Ltd