



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE
#05-01/06
SINGAPORE LAND TOWER
SINGAPORE 048623

INV No. AC2006031
INV Date 03/09/2020
Reference CS/SMO20008436/Uqf3n2
Code SMO



PROFESSIONAL SERVICE FEE

Vehicle No. SKF 8892C
Insured Veh. FBQ 1216A
Claim No. CMTD2002368/SYH
Policy No.
Accident Date 13/08/2020
Inspection Date 14/08/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
SOMPO INSURANCE SINGAPORE PL		Ref : CS/SMO20008436/Uqf3n2		
50 RAFFLES PLACE #05-01/06 SINGAPORE LAND TOWERSINGAPORE 048623		Date : 03-09-2020		
		Code : SMO		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	FBQ 1216A	Veh. Inspected	SKF 8892C	
Policy No.		Coverage (\$)	0.00	
Claim No.	CMTD2002368/SYH	Excess (\$)	0.00	
Assign From	GRACE TEO	Assign Date	13/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	HONDA ODYSSEY (A)	c.c	2356	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JHMRC1880JC202638	Colour	PURPLE	
Odometer	57042	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	DUNLOP	6 mm	
L/H Front Tyre	215/55 R17	DUNLOP	6 mm	
R/H Rear Tyre	215/55 R17	DUNLOP	6 mm	
L/H Rear Tyre	215/55 R17	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	13/08/2020	Inspection Date	14/08/2020	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKF 8892C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN	NOT NECESSARY	1,105.10	-
1	REAR WINDSCREEN MOULDING	NECESSARY	122.80	106.10
1	TAILGATE	BADLY DENTED	1,485.30	1,215.30
1	TAILGATE "H" LOGO	NECESSARY	45.80	35.80
1	TAILGATE "ODYSSEY" EMBLEM	NECESSARY	45.20	45.20
2	TAILGATE REFLECTORS @\$680.00	O/S CRACKED	1,360.00	386.20
1	TAILGATE INNER LOCK	NOT NECESSARY	299.20	-
1	TAILGATE INNER LOCK STRIKER	NOT NECESSARY	68.20	-
1	TAILGATE INNER TRIM BOARD	DEFORMED / CRACKED	745.30	566.10
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	35.00	35.00
1	TAILGATE WEATHERSTRIP	SERVICEABLE	166.20	-
1	TAILGATE OUTER HANDLE	NOT NECESSARY	299.30	-
1	TAILGATE OUTER CHROME MOULDING	CRACKED	295.40	212.50
1	TAILGATE LOCK OPENER	NOT NECESSARY	210.00	-
2	TAILGATE LICENCE LAMPS @\$65.00	NOT NECESSARY	130.00	-
1	REAR BUMPER	DENTED / DEFORMED	915.30	568.30
2	REAR BUMPER SIDE HOLDERS @\$66.50	NOT NECESSARY	133.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	39.00	39.00
2	REAR BUMPER REFLECTORS @\$105.00	NOT NECESSARY	210.00	-
2	REAR BUMPER CHROMES @\$165.00	NOT NECESSARY	330.00	-
1	REAR END PANEL	DENTED / BENT	691.20	460.80
1	REAR END PANEL TOP GARNISH	TWISTED	315.40	285.40
1	TAILLAMP HOUSING PANEL N/S	NOT NECESSARY	458.20	-
2	TAILLAMPS @\$750.00	NOT NECESSARY	1,500.00	-
2	REAR FENDERS @\$971.00	NOT NECESSARY	1,942.00	-
2	REAR FENDER INNER TRIM BOARDS @\$820.00	NOT NECESSARY	1,640.00	-
1	TAILLAMP LOWER GARNISH N/S	NOT NECESSARY	318.20	-
1	REAR FLOOR PANEL	NOT NECESSARY	866.40	-
1	REAR REVERSE CAMERA	NOT NECESSARY	650.00	-

Report Ref No. CS/SMO20008436/Uqf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR END PANEL SEALANT	NOT NECESSARY	50.00	-
1	REAR WINDSCREEN SEALANT	NECESSARY	50.00	50.00
	LESS 20% DISCOUNT		-	-801.14
			16,521.50	3,204.56
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER SENSOR (SN)	SHORTED	380.00	200.00
			380.00	200.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		80.00	20.00
	TO DISMANTLE & REPLACING REAR REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX TAILGATE MECHANISM.		100.00	60.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX REAR EXHAUST.	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX SEAT,CUSHION UPHOLSTERY.		120.00	80.00
	TO MOUNT VEHICLE ON CAR-LINER.	NOT NECESSARY	380.00	-
	TO SPRAY RUST PROOFING.		100.00	50.00
	LABOUR FOR PANEL BEATING,CUT,WELD,STRAIGHTENED & REPLACING PARTS.		1,500.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	880.00
			4,110.00	1,860.00
GRAND TOTAL			21,011.50	5,264.56
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,200.00

Report Ref No. CS/SMO20008436/Uqf3n2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No. 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKF 8892C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

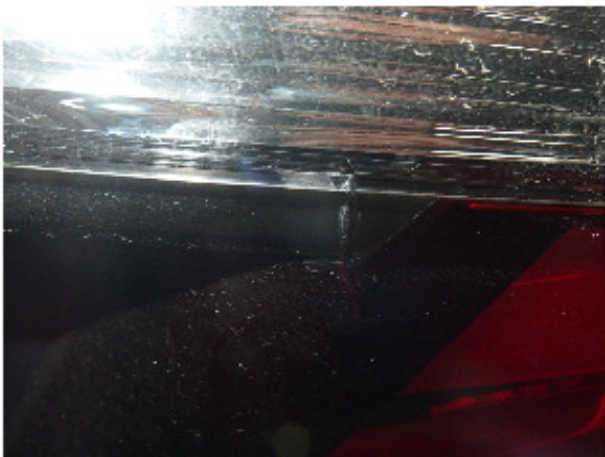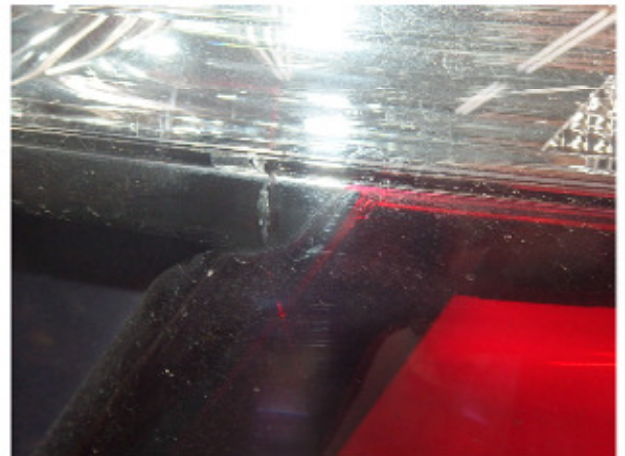



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKF 8892C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

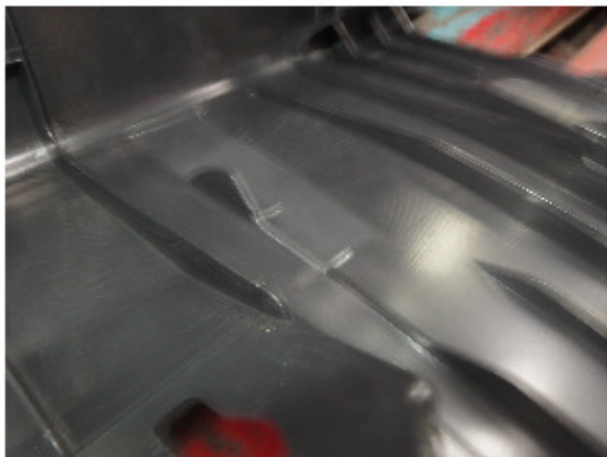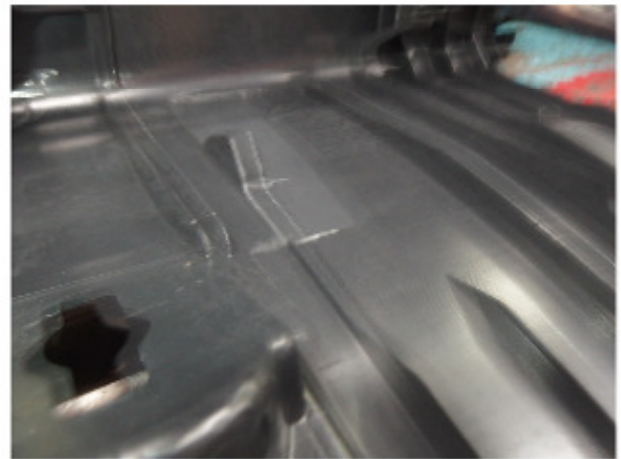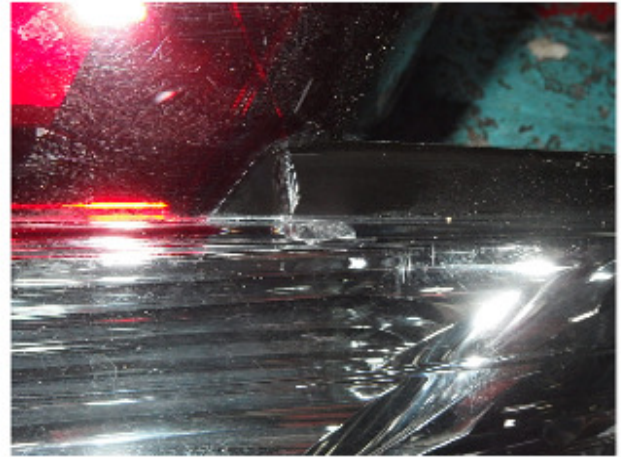



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKF 8892C

RE-INSPECTION

