



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2105068

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 19/07/2021
Reference CC4/FCI20008474/R1ra3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLD 48A
Insured Veh. SHC 1088E
Claim No. D20003195MFSH
Policy No. D-20094922MFSH
Accident Date 11/08/2020
Inspection Date 14/08/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20008474/R1ra3q2	
			Date: 19/07/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 1088E	Veh. Inspected	SLD 48A	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20003195MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	14/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	INFINITI Q50 2.0T	c.c	1991	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JN1BCAV37Z0480381	Colour	GREY	
Odometer	65723 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/55 R17	PIRELLI	6 mm	
L/H Front Tyre	225/55 R17	PIRELLI	6 mm	
R/H Rear Tyre	225/55 R17	PIRELLI	6 mm	
L/H Rear Tyre	225/55 R17	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/08/2020	Inspection Date	14/08/2020	
Survey held at	15 FAN YONG ROAD			
Repairer	MOVA AUTOMOTIVE PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			20 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 48A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	MISSING	1,600.00	1,600.00
2	FRONT BUMPER SIDE RETAINER @\$70.00	NECESSARY	140.00	140.00
1	FRONT BUMPER LOWER GRILLE	MISSING	320.00	320.00
1	FRONT BUMPER SPONGE	MISSING	220.00	220.00
1	FRONT BUMPER REINFORCEMENT	BROKEN	670.00	670.00
2	FRONT DAY LAMP @\$340.00	MISSING	680.00	680.00
2	FRONT FOG LAMP @\$330.00	MISSING	660.00	660.00
2	FRONT FOG LAMP COVER @\$170.00	MISSING	340.00	340.00
2	FRONT FOG LAMP CHROME GARNISH @\$160.00	MISSING	320.00	320.00
1	FRONT GRILLE ASSY	MISSING	780.00	780.00
1	FRONT GRILLE LOGO	MISSING	190.00	190.00
1	FRONT BUMPER BOTTOM SEAL	NECESSARY	160.00	160.00
1	FRONT BUMPER UNDER COVER	SERVICEABLE	340.00	-
2	HEADLAMP (HID) @\$2430.00	BROKEN	4,860.00	4,860.00
2	HEADLAMP (HID) CONTROL UNITS @\$750.00	MISSING	1,500.00	1,500.00
2	HEADLAMP BRACKET @\$117.00	CRACKED	234.00	234.00
1	BONNET	BENT	2,130.00	2,130.00
2	BONNET HINGE @\$160.00	BENT	320.00	320.00
2	BONNET DAMPER @\$230.00	CRACKED	460.00	460.00
1	BONNET INSULATOR	DEFORMED	290.00	290.00
1	BONNET LOCK	BENT	343.00	343.00
1	BONNET SAFETY CATCH	BENT	210.00	210.00
2	BONNET AIRBAG ACTUATOR @\$530.00	ACTIVATED	1,060.00	1,060.00
2	FRONT FENDER @\$970.00	BENT	1,940.00	1,940.00
2	FRONT FENDER INNER SHIELD @\$260.00	DEFORMED	520.00	520.00
2	FRONT FENDER (2.0T) EMBLEM @\$80.00	NECESSARY	160.00	160.00
1	FRONT SUPPORT TOP COVER	CRACKED	230.00	230.00
1	FRONT SUPPORT PANEL ASSY	BENT	1,740.00	1,740.00
1	OIL COOLER	BENT	990.00	990.00
1	CONDENSER	BENT	1,380.00	1,380.00
1	AIR INTERCOOLER	BENT	2,300.00	2,300.00

Report Ref No. CC4/FCI20008474/R1ra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
3	AIR CON PIPE @\$260.00	BENT	780.00	780.00
2	RADIATOR AIR GUIDE @\$110.00	MISSING	220.00	220.00
2	AIR INTERCOOLER HOSE @\$430.00	CRACKED	860.00	860.00
1	FRONT WIRE HARNESS	CUT	990.00	990.00
1	FRONT CROSSMEMBER	BENT	2,430.00	2,430.00
1	RADIATOR	BENT	1,980.00	1,980.00
1	FRONT RADIATOR SUPPORT BOTTOM	MISSING	350.00	350.00
1	BONNET CABLE ASSY	CUT	290.00	290.00
1	POWER STEERING PUMP ASSY	BENT	4,380.00	4,380.00
1	HEADLAMP WIRE HARNESS	CUT	970.00	970.00
2	HORN @\$160.00	SCRATCHED	320.00	320.00
1	FAN COWLING W/MOTOR ASSY	SERVICEABLE	1,340.00	-
1	FRONT STABILIZER BAR	BENT	690.00	690.00
1	FRONT STABILIZER LINK LH	BROKEN	180.00	180.00
1	FRONT LOWER ARM LH	SERVICEABLE	799.00	-
1	FRONT KNUCKLE LH	SERVICEABLE	980.00	-
1	FRONT WHEEL BEARING LH	SERVICEABLE	210.00	-
1	WASHER TANK	MISSING	230.00	230.00
1	WASHER TANK NECK	MISSING	110.00	110.00
1	WASHER TANK MOTOR	CRACKED	190.00	190.00
1	RADIATOR SPARE TANK	SERVICEABLE	210.00	-
1	FRONT WINDSCREEN GLASS	CRACKED	2,330.00	2,330.00
1	FRONT WINDSCREEN MOULDING	NECESSARY	310.00	310.00
1	DASHBOARD	TORN	4,875.00	4,875.00
1	DRIVE AIR BAG	ACTIVATED	2,900.00	2,900.00
1	PASSENGER AIR BAG	ACTIVATED	3,100.00	3,100.00
2	FRONT SEAT BELT @\$990.00	ACTIVATED	1,980.00	1,980.00
1	STEERING CLOCK SPRING	NECESSARY	450.00	450.00
1	AIRBAG CONTROL UNITS	ACTIVATED	1,340.00	1,340.00
1	ENGINE UNDER COVER	SERVICEABLE	495.00	-
2	ENGINE MOUNTING @\$280.00	SERVICEABLE	560.00	-
1	GEARBOX MOUNTING	SERVICEABLE	280.00	-
1	AIR CLEANER BOX ASSY	SERVICEABLE	677.00	-

Report Ref No. CC4/FCI20008474/R1ra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR INTAKE MANIFOLD	SERVICEABLE	1,980.00	-
1	FRONT FENDER INNER COVER LH	MISSING	240.00	240.00
1	WASHER PUMP	SERVICEABLE	630.00	-
1	V-BELT	SERVICEABLE	210.00	-
1	RADIATOR HOSE ASSY	DISTORTED	430.00	430.00
1	FRONT CROSSMEMBER LH	BENT	975.00	975.00
1	LH FRONT SPORT RIM	SCRATCHED	635.00	635.00
1	LH FRONT SIDE MIRROR ASSY	MISSING	976.00	976.00
1	RH FRONT DOOR	TO REPAIR SEE LABOUR	1,450.00	-
2	FRONT AIRBAG IMPACT SENSOR @\$230.00	ACTIVATED	460.00	460.00
	LESS 10% DISCOUNT		-7,287.90	-6,271.80
			65,591.10	56,446.20
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	BENT	50.00	35.00
1	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	FRONT IU BRACKET (SN)	NECESSARY	25.00	25.00
1	RADIATOR COOLANT (SN)	NECESSARY	30.00	30.00
1	LH FRONT TYRE (SN)	SERVICEABLE	230.00	-
			375.00	130.00
	<u>LABOUR</u>			
	TO INSPECT FRONT LIGHTING WATER & LEAKAGE TEST.		40.00	40.00
	TO REMOVE & INSTALL FRONT WINDSCREEN .		120.00	120.00
	TO REMOVE & INSTALL AIR CON CONDENSER,RADIATOR IN ORDER TO CUT OFF SUPPORT PANEL .		160.00	100.00
	TO REMOVE & INSTALL ENGINE IN ORDER TO STRAIGHTEN FRONT CHASSIS MEMBER & CUT OFF DAMAGED PARTS.	NOT NECESSARY	300.00	-
	TO REMOVE & REPLACE FRONT UNDERCARRIAGE DAMAGED PARTS.	NOT NECESSARY	300.00	-
	TO CHECK ALL WHEEL ALIGNMENT .		80.00	60.00
	TO REMOVE & REPLACE FRONT DASHBOARD ,AND ALL AIRBAG SYSTEM & REPROGRAMMING AIRBAG SYSTEMS AFTER REPLACE.		400.00	300.00

Report Ref No. CC4/FCI20008474/R1ra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SET VEHICLE ON CHASSIS BENCH IN ORDER TO STRAIGHTEN AND CUT OFF DAMAGED PARTS.	NOT NECESSARY	280.00	-
	TO CUT OFF DAMAGED PARTS ,STRAIGHTEN FRONT CHASSIS MEMBER ,LH FRONT WHEELS HOUSE PANEL,AFFECTED AREAS AND RENEW DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF RH FRONT DOOR .		2,000.00	1,600.00
	TO APPLY BODY JOINT SEALANT ON CUTTING AREAS.		60.00	60.00
	TO APPLY RUST PROOF ON AFFECTED AREAS .		100.00	100.00
	TO SPRAY PAINT ON REPLACED ,REPAIRED AREAS .		1,600.00	1,400.00
	TO REMOVE & TRANSFER ITEMS TO RH FRONT NEW DOOR .	NOT NECESSARY	80.00	-
			5,520.00	3,780.00
GRAND TOTAL			71,486.10	60,356.20
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				24,000.00

Report Ref No. CC4/FCI20008474/R1ra3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 48A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

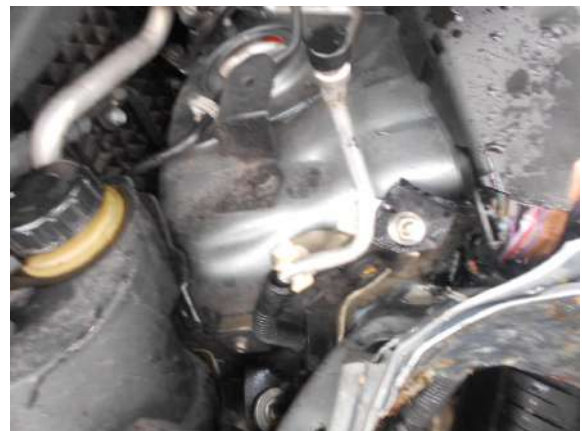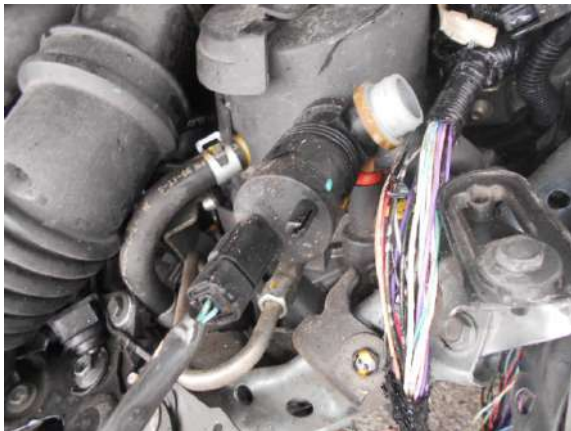



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

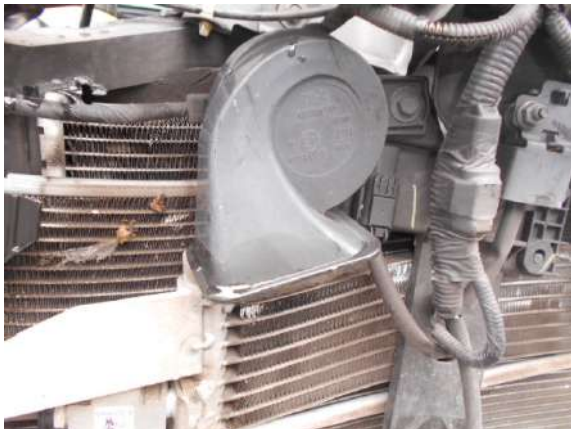



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 48A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

