



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2007025
INV Date 16/10/2020
Reference CS/AGI20008552/Asf3q2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SLX 1063T
Insured Veh. SMA 1546B
Claim No. C10007025
Policy No.
Accident Date 14/08/2020
Inspection Date 18/08/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20008552/Asf3q2

(BUDGET DIRECT INSURANCE)

190 CLEMENCEAU AVENUE #03-01

SINGAPORE SHOPPING CENTRESINGAPORE

239924

Date : 16-10-2020



Code : AGI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMA 1546B	Veh. Inspected	SLX 1063T
Policy No.		Coverage (\$)	0.00
Claim No.	C10007025	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	17/08/2020

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI I30	c.c	1353
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	TMAH3513VJJ062073	Colour	RED
Odometer	12588	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	HANKOOK	6 mm
L/H Front Tyre	205/55 R16	HANKOOK	6 mm
R/H Rear Tyre	205/55 R16	HANKOOK	6 mm
L/H Rear Tyre	205/55 R16	HANKOOK	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	14/08/2020	Inspection Date	18/08/2020
Survey held at	VISION AUTOWORK PTE LTD 8 KAKI BUKIT AVE 4, #08-09 PREMIER @ KAKI BUKIT SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLX 1063T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT DOOR RH	TO REPAIR SEE LABOUR	1,723.60	-
1	FRONT DOOR INNER LOCK RH	NOT NECESSARY	201.20	-
1	FRONT DOOR INNER TRIM RH	NOT NECESSARY	1,794.80	-
1	FRONT DOOR LOCK CATCHER RH	NOT NECESSARY	10.10	-
1	FRONT DOOR WEATHERSTRIP RH	NOT NECESSARY	149.63	-
1	FRONT DOOR OUTER STRIP RH	NOT NECESSARY	108.00	-
1	FRONT DOOR BLACK STICKER RH	NOT NECESSARY	18.00	-
1	FRONT DOOR FRAME WEATHERSTRIP RH	NOT NECESSARY	235.01	-
1	CENTER PILLAR RH (OUTER)	TO REPAIR SEE LABOUR	2,317.72	-
1	ROCKER PANEL RH (OUTER)	TO REPAIR SEE LABOUR	2,348.88	-
1	REAR DOOR RH	DENTED	1,819.71	1,819.71
1	REAR DOOR BLACK STICKER RH	NECESSARY	18.00	18.00
1	REAR DOOR FRAME STEP GARNISH RH	NOT NECESSARY	69.30	-
2	REAR DOOR HINGE RH	NOT NECESSARY	92.00	-
1	REAR DOOR CHECKER RH	NOT NECESSARY	55.00	-
1	REAR DOOR INNER LOCK RH	DAMAGED	201.50	201.50
1	REAR DOOR INNER TRIM RH	CRACKED	1,511.66	1,511.66
1	REAR DOOR WEATHERSTRIP RH	NOT NECESSARY	271.10	-
1	REAR DOOR POWER WINDOW MOTOR RH	NOT NECESSARY	223.80	-
1	REAR DOOR REGULATOR RH	NOT NECESSARY	502.90	-
1	REAR DOOR OUTER STRIP RH	NOT NECESSARY	89.10	-
1	REAR DOOR LOCK CATCHER RH	NOT NECESSARY	20.00	-
1	REAR DOOR FRAME WEATHERSTRIP RH	NOT NECESSARY	228.12	-
1	REAR DOOR SPEAKER RH	NOT NECESSARY	260.40	-
1	REAR FENDER RH	DENTED	1,890.10	1,890.10
2	REAR FENDER COWLING @\$321.19	NOT NECESSARY	642.38	-
1	REAR MUDFLAP RH	NOT NECESSARY	48.94	-
1	REAR FENDER QUARTER GLASS C/W MOULDING RH	NECESSARY	365.90	105.00
1	REAR LOWER ARM RH	BENT	625.96	625.96

Report Ref No. CS/AGI20008552/Asf3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR UPPER ARM RH	BENT	409.71	409.71
1	REAR SWING ARM RH	BENT	496.47	496.47
1	REAR SHOCK ABSORBER RH	NOT NECESSARY	496.92	-
1	REAR LINKAGE RH	NOT NECESSARY	92.10	-
1	REAR WHEEL HUP WITH BEARING RH	DAMAGED	454.00	454.00
1	REAR ABS SENSOR RH	NOT NECESSARY	287.40	-
1	REAR BUMPER	TORN	801.59	801.59
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	248.40	-
2	REAR BUMPER SIDE BRACKET @\$213.09	NOT NECESSARY	426.18	-
	LESS 20% DISCOUNT		-4,311.12	-1,666.74
			17,244.46	6,666.96
1	REAR WHEEL SPORT RIM RH (SN)	CUT	1,337.76	500.00
	LESS 20% DISCOUNT		-267.55	-
			1,070.21	500.00
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT DOOR INNER TRIM CLIP RH (SN)	NOT NECESSARY	80.00	-
1	SET CENTER PILLAR INNER TRIM CLIP RH (SN)	NOT NECESSARY	80.00	-
1	ROCKER PANEL SEALANT RH (OUTER) (SN)	NOT NECESSARY	150.00	-
1	SET REAR DOOR INNER TRIM CLIP RH (SN)	NECESSARY	80.00	30.00
1	REAR FENDER SEALANT RH (SN)	NOT NECESSARY	150.00	-
1	SET REAR FENDER COWLING CLIP RH (SN)	NECESSARY	80.00	30.00
1	SET REAR MUDFLAP CLIP RH (SN)	NOT NECESSARY	40.00	-
1	REAR FENDER QUARTER GLASS SEALANT RH (SN)	NECESSARY	80.00	40.00
1	REAR FENDER QUARTER GLASS INNER SHIELD RH (SN)	NOT NECESSARY	60.00	-
1	REAR FENDER QUARTER GLASS SOLAR FILM RH (SN)	NOT NECESSARY	250.00	-
1	REAR WHEEL TYRE RH (SN)	NOT NECESSARY	380.00	-
1	SET WHEEL CAP (SN)	NOT NECESSARY	120.00	-
1	SET ROOF MOULDING CLIP (SN)	NOT NECESSARY	120.00	-
1	REAR NUMBER PLATE (OFF PEAK) (SN)	NECESSARY	180.00	50.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	50.00	-

Report Ref No. CS/AGI20008552/Asf3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BRAKE OIL (SN)	NOT NECESSARY	30.00	-
			2,010.00	180.00
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT DOOR RH,CENTER PILLAR RH (OUTER) AND ROCKER PANEL RH (OUTER).		2,400.00	900.00
	TO SPRAY PAINT AFFECTED AREA.		2,400.00	800.00
	TUFF COAT.		250.00	80.00
	WIRING CHECK .		250.00	30.00
	REMOVE & REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR .		550.00	80.00
	TRANSFER FRONT DOOR MECHANISM .	NOT NECESSARY	80.00	-
	REMOVE & REINSTALL FRONT DOOR WINDOW GLASS .	NOT NECESSARY	80.00	-
	REMOVE & REFIX AUDIO SPEAKER.	NOT NECESSARY	120.00	-
	RESET RADIO SYSTEM.	NOT NECESSARY	200.00	-
	REMOVE AND REFIX REAR UNDERCARRIAGE.		350.00	220.00
	TO PRESS REAR WHEEL BEARING.	NOT NECESSARY	80.00	-
	FOUR WHEEL ALIGNMENT.		120.00	80.00
	TRANSFER REAR DOOR MECHANISM.		80.00	40.00
	REMOVE & REINSTALL REAR DOOR WINDOW GLASS.		80.00	40.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REMOVE AND REFIX REAR FENDER GLASS RH .		100.00	50.00
	REMOVE AND RESEAL OFF PEAK PLATE.		250.00	80.00
	RESET ABS LIGHT .	NOT NECESSARY	350.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
			8,120.00	2,450.00
GRAND TOTAL			28,444.67	9,796.96
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,800.00

Report Ref No. CS/AGI20008552/Asf3q2



Report Ref No. CS/AGI20008552/Asf3q2

A handwritten signature in black ink, appearing to read 'A. Ling'.

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 1063T

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

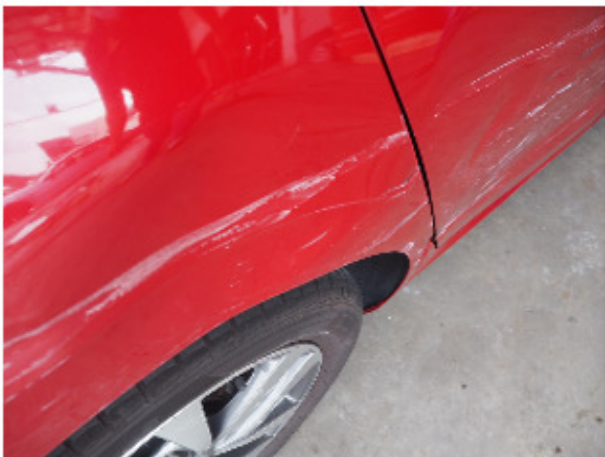



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 1063T

RE-INSPECTION

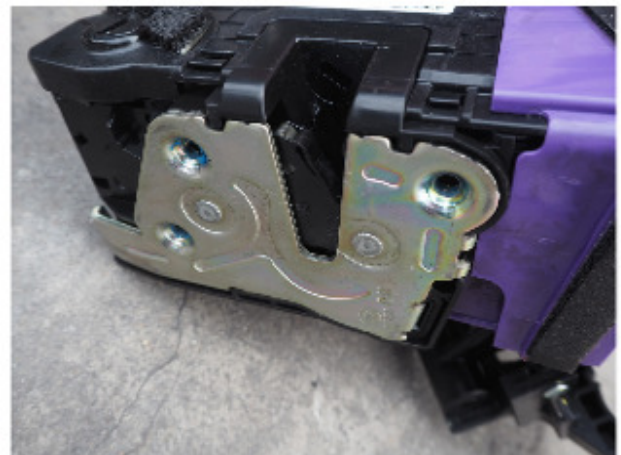



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

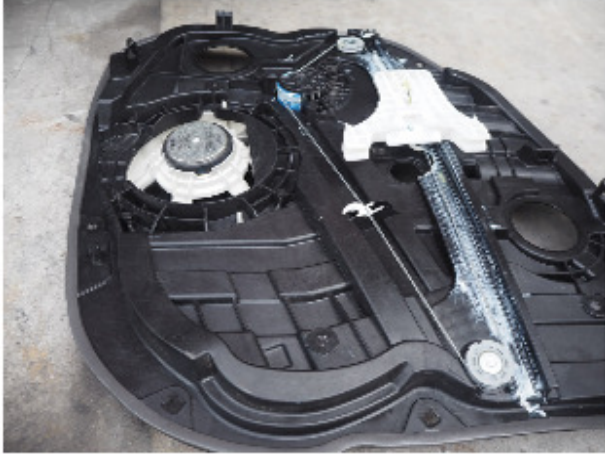



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLX 1063T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

