



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2102203

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/04/2021
Reference CC3/CTI20008752/Kes3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 5344P
Insured Veh. SCM 1234G
Claim No. SNM20D202917C02
Policy No. DMPCSNA00056512007
Accident Date 17/08/2020
Inspection Date 18/08/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI20008752/Kes3q2 Date: 05/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SCM 1234G	Veh. Inspected	SHC 5344P	
Policy No.	DMPCSNA00056512007	Coverage (\$)	0.00	
Claim No.	SNM20D202917C02	Excess (\$)	0.00	
Assign From		Assign Date	18/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	VF1ABL15AUC279353	Colour	METALLIC WHITE / RED	
Odometer	625567 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	SAILUN	8 mm	
L/H Front Tyre	215/60 R16	SAILUN	8 mm	
R/H Rear Tyre	215/60 R16	SAILUN	8 mm	
L/H Rear Tyre	215/60 R16	SAILUN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/08/2020	Inspection Date	18/08/2020	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5344P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	MTG CRACKED	747.20	747.20
1	BUMPER SPOILER FRT	SERVICEABLE	344.70	-
1	BUMPER ABSORBER FRT	CRACKED	394.68	394.68
1	BUMPER BRACKET FRT LH (HEADLAMP LOWER)	SERVICEABLE	116.47	-
1	BUMPER RETAINER FRT LH	DISTORTED	101.40	101.40
1	BUMPER BRACKET FRT RH (HEADLAMP LOWER)	SERVICEABLE	116.47	-
1	BUMPER RETAINER FRT RH	SERVICEABLE	101.40	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	292.50	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	147.00	-
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	HEADLAMP LH	MTG CRACKED	743.60	743.60
1	HEADLAMP RH	SERVICEABLE	743.60	-
1	FENDER PANEL FRT LH	BENT	437.10	437.10
1	WHEELARCH FRT LH	TORN	191.40	191.40
1	FENDER INSULATOR LH	SERVICEABLE	66.30	-
1	FENDER PANEL FRT RH	TO REPAIR SEE LABOUR	437.10	-
1	WHEELARCH FRT RH	SERVICEABLE	191.40	-
1	RADIATOR GRILLE	MTG CRACKED	969.90	969.90
1	RADIATOR GRILLE BADGE "RENAULT"	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	SERVICEABLE	686.00	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-
1	BONNET	TO REPAIR SEE LABOUR	1,312.70	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	1,483.40	-

Report Ref No. CC3/CTI20008752/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRT LH	SERVICEABLE	90.90	-
1	DOOR FINISHER FRT LH	SERVICEABLE	258.90	-
1	DOOR WAIST SEAL OUTER FRT LH	SERVICEABLE	92.20	-
1	DOOR FINISHER CLIP KIT	NOT NECESSARY	94.00	-
1	DOOR GLASS FRT LH	SERVICEABLE	394.00	-
1	DOOR MOULDING BLACK FRT LH	SERVICEABLE	100.50	-
1	DOOR REGULATOR FRT LH	TO REPAIR SEE LABOUR	501.40	-
1	DOOR REGULATOR MOTOR FRT LH	SERVICEABLE	758.10	-
1	DOOR PANEL FRT RH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR MIRROR ASSY RH	SERVICEABLE	1,483.40	-
1	WIPER RESERVOIR	SERVICEABLE	179.60	-
	LESS 10% DISCOUNT		-2,198.55	-381.06
			19,786.93	3,429.58
	<u>SPECIAL NETT ITEMS</u>			
1	BUMPER CLIP FRT (SN)	NECESSARY	75.00	75.00
1	BUMPER BRACKET CLIP LH (SN)	NOT NECESSARY	60.00	-
1	BUMPER RETAINER CLIP LH (SN)	NOT NECESSARY	65.00	-
1	BUMPER BRACKET CLIP RH (SN)	NOT NECESSARY	60.00	-
1	BUMPER RETAINER CLIP RH (SN)	NOT NECESSARY	65.00	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	BUMPER SPOILER CLIP (SN)	NOT NECESSARY	60.00	-
1	BUMPER FOG LAMP GRILLE CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	55.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	60.00	-
1	WHEELARCH CLIP LH (SN)	NECESSARY	65.00	65.00
1	WHEELARCH CLIP RH (SN)	NOT NECESSARY	65.00	-
1	FRONT LEFT TYRE (SN)	SERVICEABLE	300.00	-

Report Ref No. CC3/CTI20008752/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LEFT TYRE RIM (SN)	SERVICEABLE	380.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	NOT NECESSARY	100.00	-
1	SET RADIATOR GRILE SCREW (SN)	NOT NECESSARY	50.00	-
1	SET RADIATOR GRILE FRAME CLIP (SN)	NOT NECESSARY	55.00	-
1	FRONT LH DOOR STICKER "TRANS-CAB" (SN)	NECESSARY	80.00	60.00
1	FRONT LH DOOR STICKER "CLASSIC" (SN)	NECESSARY	80.00	15.00
1	FRONT RH DOOR STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	FRONT RH DOOR STICKER "CLASSIC" (SN)	NOT NECESSARY	80.00	-
1	FRONT LEFT TYRE RIM COVER (SN)	SERVICEABLE	65.00	-
1	FRONT RIGHT TYRE RIM COVER (SN)	SERVICEABLE	65.00	-
1	FRONT RIGHT TYRE (SN)	SERVICEABLE	300.00	-
1	FRONT RIGHT TYRE RIM (SN)	SERVICEABLE	380.00	-
			2,844.00	215.00
	<u>LABOUR</u>			
	TO TRANSFER OF FRONT FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	350.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	30.00
	TO TRANSFER OF DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	350.00	-
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF FENDER PANEL FRT RH,BONNET,DOOR PANEL FRT LH,DOOR HINGE UPPER LH,DOOR HINGE LOWER LH,DOOR REGULATOR FRT LH AND DOOR PANEL FRT RH.		1,600.00	400.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF FRONT BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TOWING FEES.		150.00	50.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-

Report Ref No. CC3/CTI20008752/Kes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION. TO CHECK ELECTRICAL LIGHTING CONCERNED.		1,600.00	660.00
			170.00	20.00
			5,410.00	1,160.00
GRAND TOTAL			28,040.93	4,804.58
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,850.00

Report Ref No. CC3/CTI20008752/Kes3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5344P

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

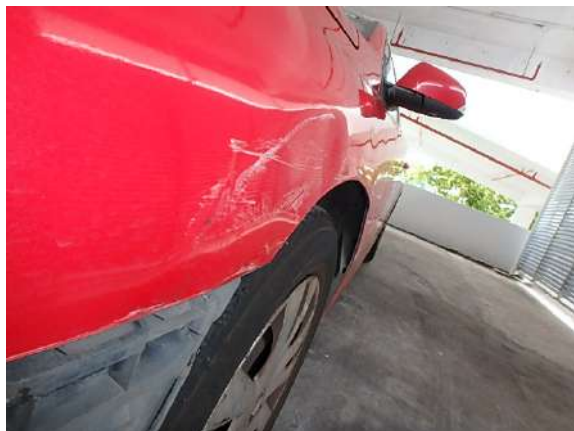



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



