



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2100571

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 27/01/2021
Reference CC4/LPC20009015/R1ps3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMJ 6676D
Insured Veh. GBE 4967J
Claim No. 20/20/20/VC05/023580
Policy No. Z20VC05005634
Accident Date 24/08/2020
Inspection Date 27/08/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC20009015/R1ps3q2 Date: 27/01/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBE 4967J	Veh. Inspected	SMJ 6676D	
Policy No.	Z20VC05005634	Coverage (\$)	0.00	
Claim No.	20/20/20/VC05/023580	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	26/08/2020	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA LEXUS IS300H 4DR SEDAN	c.c	2494	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	JTHBH1D2505077077	Colour	BLUE	
Odometer	10582 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm	
L/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm	
R/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm	
L/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT AND O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	24/08/2020	Inspection Date	27/08/2020	
Survey held at	BORNEO MOTORS (S) PTE LTD 2 PANDAN CRESCENT SINGAPORE 128462			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			20 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMJ 6676D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	100.00	50.00
2	PANEL BONDING AD (SN)	NECESSARY	534.40	534.40
3	SIKA 182010 SIKA TACK GO1(BLA) (SN)	NECESSARY	324.00	324.00
2	SIKA 207.G+P ADHESIVE PRIMER (SN)	NECESSARY	400.00	400.00
1	FENDER ,FR RH (SN)	BENT	1,339.60	1,339.60
1	SEAL ,FR FENDER ,RH (SN)	NECESSARY	57.20	57.20
1	PROTECTOR ,FR FENDER (SN)	NECESSARY	106.70	106.70
1	REINFORCEMENT (SN)	SERVICEABLE	170.80	-
1	SHIELD SUB-ASSY (SN)	DEFORMED	331.90	331.90
1	PANEL ,DOOR FR RH (SN)	BENT	1,348.20	1,348.20
1	CHECK ASSY ,FR DOOR (SN)	SERVICEABLE	275.30	-
1	TAPE ,BLACK OUT FR (SN)	NECESSARY	38.00	38.00
1	TAPE ,BLACK OUT FR, RH (SN)	NECESSARY	69.20	69.20
1	WEATHERSTRIP ,FR (SN)	SERVICEABLE	299.00	-
1	WEATHERSTRIP ,FR (SN)	SERVICEABLE	61.60	-
1	GLASS SUB-ASSY ,FR (SN)	SERVICEABLE	1,230.20	-
1	FRAME SUB-ASSY ,FR (SN)	SERVICEABLE	110.40	-
1	RUN ,FR DOOR GLASS (SN)	SERVICEABLE	162.60	-
1	CUSHION ,FR DOOR (SN)	SERVICEABLE	36.80	-
1	COVER ,FR DOOR (SN)	SERVICEABLE	50.30	-
1	GARNISH ,FR DOOR LWR (SN)	SERVICEABLE	44.80	-
1	WEATHERSTRIP ,FR (SN)	SERVICEABLE	158.90	-
1	R/FRT UPP DOOR HINGE (SN)	SERVICEABLE	97.50	-
1	R/FRT DOOR LOW HINGE (SN)	SERVICEABLE	110.60	-
1	MOTOR ASSY ,POWER (SN)	SERVICEABLE	1,156.00	-
1	REGULATOR SUB-ASSY (SN)	SERVICEABLE	443.60	-
1	PILLAR ,FR BODY (SN)	SERVICEABLE	437.70	-
1	PROTECTOR ,QUARTER RH (SN)	NECESSARY	28.60	28.60
1	PANEL ,QUARTER ,RH (SN)	BUCKLED	1,281.10	1,281.10
1	LINER ,RR WHEEL (SN)	SERVICEABLE	291.60	-
1	MOULDING ,OUTSIDE RH (SN)	SERVICEABLE	91.10	-

Report Ref No. CC4/LPC20009015/R1ps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	CLIP ,WINDSHIELD (SN)	NECESSARY	106.00	106.00
10	ROOF DRIP MLDG CLIP (SN)	NECESSARY	108.00	108.00
1	GLASS SUB-ASSY ,BACK (SN)	NECESSARY	1,482.90	1,482.90
1	DAM ,WINDOW GLASS (SN)	NECESSARY	28.90	28.90
1	COVER ,RR BUMPER (SN)	DEFORMED	1,069.70	1,069.70
1	PLATE ,RR BUMPER (SN)	NECESSARY	12.30	12.30
1	SUPPORT ,RR BUMPER RH (SN)	NECESSARY	143.20	143.20
1	SUPPORT ,RR BUMPER RH (SN)	NECESSARY	242.40	242.40
1	BRACKET ,RR BUMPER (SN)	NECESSARY	5.90	5.90
1	EXTENSION ,SUB-ASSY (SN)	SERVICEABLE	562.90	-
6	BUMPER CLIPS (SN)	NECESSARY	24.60	24.60
1	DUCT ASSY ,QUARTER (SN)	SERVICEABLE	35.00	-
1	SHIELD ,QUARTER VENT (SN)	SERVICEABLE	89.50	-
1	MOULDING ,DOOR (RH FRT) (SN)	NECESSARY	74.60	74.60
15	RIVET (SN)	NECESSARY	21.00	21.00
1	PROTECTOR ,ROCKER (SN)	NECESSARY	47.40	47.40
1	PROTECTOR ,SIDE (SN)	NECESSARY	20.90	20.90
1	PROTECTOR ,SIDE (SN)	NECESSARY	20.90	20.90
1	PROTECTOR ,ROCKER (SN)	NECESSARY	26.60	26.60
1	MOULDING SUB-ASSY (SN)	SERVICEABLE	184.20	-
1	PROTECTOR ,ROCKER (SN)	NECESSARY	11.60	11.60
1	LENS & BODY ,RR (SN)	SERVICEABLE	1,271.10	-
1	COVER ,RR (SN)	SERVICEABLE	37.20	-
1	RETAINER ,RR BUMPER (SN)	NECESSARY	125.40	125.40
1	PLATE ,FR DOOR (SN)	SERVICEABLE	202.10	-
1	PLATE ,DOOR SCUEE (SN)	SERVICEABLE	100.70	-
1	WEATHERSTRIP ,FR (SN)	SERVICEABLE	357.90	-
1	COVER ,FR DOOR (SN)	SERVICEABLE	76.80	-
1	SENSOR ,ULTRASONIC (SN)	SERVICEABLE	490.80	-
1	RETAINER ,ULTRASONIC (SN)	NECESSARY	16.40	16.40
1	WHEEL ,DISC (SN)	SCRATCHED	2,812.30	2,812.30
1	HUB & BEARING ASSY (SN)	SERVICEABLE	728.20	-
1	SHAFT ASSY ,RR (SN)	SERVICEABLE	2,129.60	-

Report Ref No. CC4/LPC20009015/R1ps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ABSORBER SET ,SHOCK (SN)	SERVICEABLE	369.50	-
1	LINK SUB-ASSY ,TOE (SN)	SERVICEABLE	545.30	-
1	ARM ASSY ,RR (SN)	SERVICEABLE	370.10	-
1	ARMM ASSY ,RR (SN)	SERVICEABLE	653.40	-
1	ARM ASSY ,UPR (SN)	SERVICEABLE	940.40	-
1	LINK ASSY ,RR (SN)	SERVICEABLE	215.80	-
1	ARM ASSY ,UPR (SN)	SERVICEABLE	494.40	-
1	CARRIER SUB-ASSY ,RR (SN)	SERVICEABLE	1,035.20	-
1	SEAT ,RR SPRING ,UPR (SN)	SERVICEABLE	139.00	-
1	L/R EAR DOOR PROTECTOR (SN)	NECESSARY	55.00	55.00
1	MOULDING ,ROCKER RH (SN)(ADDITIONAL)	BENT	709.80	709.80
			29,382.60	13,074.70
	<u>LABOUR</u>			
	TO REMOVE ALL NECESSARY PARTS TO ENABLE REPAIRING AND STRAIGHTEN ON RHS FRONT DOOR ,FRONT FENDER ,A-PILLAR ,ROCKER PANEL, REAR FENDER ,REAR BUMPER AND FIX NEW PARTS.		9,526.00	6,928.00
	TO SPRAY PAINT ON RHS FRONT FENDER ,FRONT DOOR ,A PILLAR,ROCKER PANEL, REAR FENDER ,REAR PANEL AND REAR BUMPER .		5,936.00	5,194.00
	TO REMOVE AND RE-INSTALL RHS HEADLAMP TO ENABLE REPAIR.		216.50	216.50
	TO REMOVE AND REINSTALL FRONT PARKING SENSOR TO ENABLE REPAIR .		216.50	216.50
	TO REMOVE AND TRANSFER RHS FRONT DOOR'S COMPONENT AND MECHANISM TO NEW DOOR .		866.00	866.00
	SUPPLY RHS FRONT DOOR SEALANT .		100.00	100.00
	TO REMOVE AND REINSTALL REAR SEAT ,SIDE TRIM ,GARNISH ETC TO ENABLE REPAIR.		866.00	866.00
	TO REMOVE AND REPLACE RHS REAR 1/4 GLASS SOLAR FILM .	NOT NECESSARY	190.00	-
	TO REMOVE AND REPLACE REAR WINDSCREEN GLASS .		866.00	866.00
	REPLACE REAR WINDSCREEN SOLAR FILM .		420.00	420.00
	TO REMOVE AND REINSTALL REAR LUGGAGE TRIM ,GARNISH ETC TO ENABLE REPAIR .		433.00	433.00
	TO CHECK WIRING AND LIGHTS FUNCTIONING AND CARRY OUT WATER LEAK TEST .		216.50	216.50

Report Ref No. CC4/LPC20009015/R1ps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE ,RENEW AND BALANCE RHS REAR RIM AND TYRE .		108.25	108.25
	TO CARRY OUT WHEEL ALIGNMENT .		216.50	216.50
	TO REMOVE AND REINSTALL RHS REAR SUSPENSION AND FIX NEW PARTS .	NOT NECESSARY	1,299.00	-
	TO RESET ECU & REPROGRAMME .		216.50	216.50
			21,692.75	16,863.75
GRAND TOTAL			51,075.35	29,938.45
RECOMMENDED COST OF REPAIRS				29,938.45

Report Ref No. CC4/LPC20009015/R1ps3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 6676D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

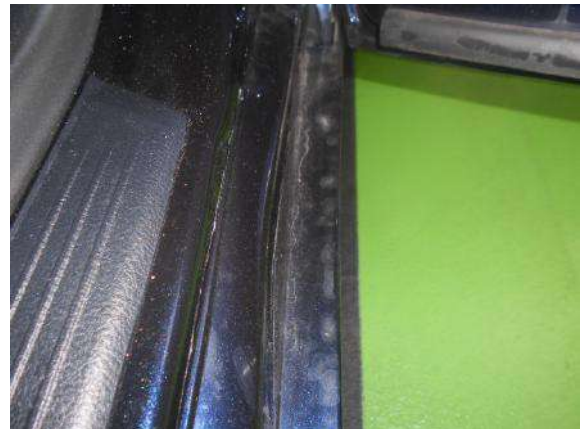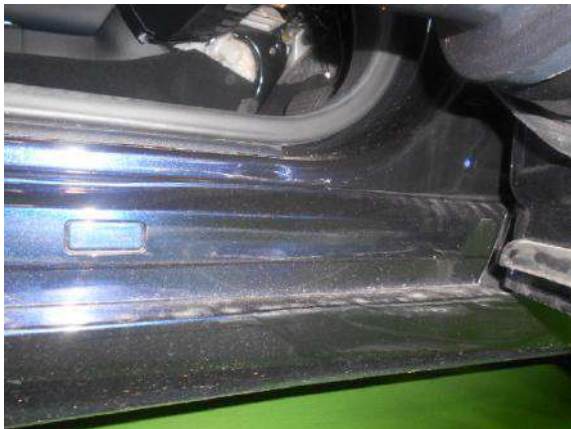



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 6676D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

