



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD  
36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV No. AC2007047  
INV Date 19/10/2020  
Reference CC6/FCI20009019/Uds3q2  
Code FCI2



#### PROFESSIONAL SERVICE FEE

Vehicle No. SMS 8870Z  
Insured Veh. SHC 323H  
Claim No. D20003437MFSH  
Policy No. D-18088937MFSH  
Accident Date 22/08/2020  
Inspection Date 26/08/2020

Description	Total
Survey Inspection	279.00
Digital Photographs	
Transportation	
<b>Subtotal</b>	<b>279.00</b>
<b>GST (7%)</b>	<b>19.53</b>
<b>Grand Total</b>	<b>298.53</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD		Ref : CC6/FCI20009019/Uds3q2		
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 19-10-2020		
		Code : FCI2		
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SHC 323H	Veh. Inspected	SMS 8870Z	
Policy No.	D-18088937MFSH	Coverage (\$)	0.00	
Claim No.	D20003437MFSH	Excess (\$)	0.00	
Assign From	MERINA	Assign Date	26/08/2020	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	TOYOTA RUSH (A)	c.c	1495	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	J200E0022762	Colour	WHITE	
Odometer	95738	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	215/60 R17	BRIDGESTONE	6 mm	
L/H Front Tyre	215/60 R17	BRIDGESTONE	6 mm	
R/H Rear Tyre	215/60 R17	BRIDGESTONE	6 mm	
L/H Rear Tyre	215/60 R17	BRIDGESTONE	6 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	22/08/2020	Inspection Date	26/08/2020	
Survey held at	CAR CITY AUTO CENTRE PTE LTD BLK 9006 TAMPINES ST 93 #01-198 SINGAPORE 528840			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>5 Working Days</b>		



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMS 8870Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR TAILDOOR	BADLY DENTED	893.90	893.90
2	REAR TAILDOOR HINGE @\$198.10	NOT NECESSARY	396.20	-
1	REAR TAILDOOR LOCK	NOT NECESSARY	295.70	-
1	REAR TAILDOOR TRIM	* CHECK	286.80	-
1	REAR TAILDOOR WEATHERSTRIP	* CHECK	386.40	-
1	REAR TAILDOOR SPARE TYRE COVER	CRACKED	1,598.00	1,598.00
1	REAR TAILDOOR SPARE TYRE COVER BASE	CRACKED	590.00	590.00
1	REAR TAILDOOR SPARE TYRE BRACKET	* CHECK	298.10	-
1	REAR BUMPER	DENTED / DEFORMED	1,258.30	1,258.30
2	REAR BUMPER RETAINER @\$58.60	NOT NECESSARY	117.20	-
1	REAR BUMPER TOWING COVER	NOT NECESSARY	28.10	-
2	REAR BUMPER REFLECTOR LH & RH @\$76.70	NOT NECESSARY	153.40	-
8	REAR BUMPER CLIP @\$4.91	NECESSARY	39.28	39.28
1	REAR TAILLAMP RH	NOT NECESSARY	374.90	-
1	REAR END PANEL	* CHECK	317.80	-
1	REAR END PANEL GARNISH	* CHECK	110.87	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,090.90	-
	LESS 25% DISCOUNT		-2,058.96	-1,094.87
			6,176.89	3,284.61
<b><u>SPECIAL NETT ITEMS</u></b>				
2	SEALANT @\$35.00 (SN)	NECESSARY	70.00	40.00
1	REVERSE SENSOR (SN)	SHORTED	250.00	200.00
1	REAR EMBLEM 'RUSH' (SN)	NECESSARY	30.00	30.00
1	REAR NUMBER PLATE & HOLDER (SN)	SERVICEABLE	60.00	-
1	FRONT NUMBER PLATE & HOLDER (SN)	BENT	60.00	40.00
1	REAR TAILDOOR BODY SEALANT (SN)	NOT NECESSARY	60.00	-
			530.00	310.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	LABOUR-REAR .INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL .		1,000.00	800.00
	CHECK WIRING .		70.00	20.00
	TO APPLY ANTI-RUST UNDERCOAT ON REPLACE & REPAIRED PANELS.		80.00	60.00
	SPRAY PAINTING -REAR.		900.00	780.00
	TO REMOVE & REFIT REAR TAILDOOR ,REAR TAILDOOR LOCK INNER & OUTER ,REAR TAILDOOR HANDLE ,WIPER MOTOR,SWITCH ,TRIM BOARD & ALL EMBLEM ....ETC.		90.00	60.00
	TO REMOVE & REFIT REAR WINDSCREEN GLASS FOR ALL NECESSARY REPAIRS.		120.00	120.00
	TO REMOVE & REFIT INNER TRIM FOR NECESSARY BODY WORK FIXING OR PANEL BEATING.		80.00	60.00
	TO REMOVE/REFIT REAR CAMERA.}		80.00	40.00
	REINSTALL REAR BUMPER SENSORS. }		80.00	-
	TO APPLY BODY SEALANT.	NOT NECESSARY	60.00	-
	LABOUR -FRONT .		400.00	200.00
	SPRAY PAINTING -FRONT.		500.00	200.00
			3,460.00	2,340.00
	<b>GRAND TOTAL</b>		<b>10,166.89</b>	<b>5,934.61</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$1,399.97 NETT)</b>			<b>4,750.00</b>

Report Ref No. CC6/FCI20009019/Uds3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd


S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMS 8870Z

INSPECTION

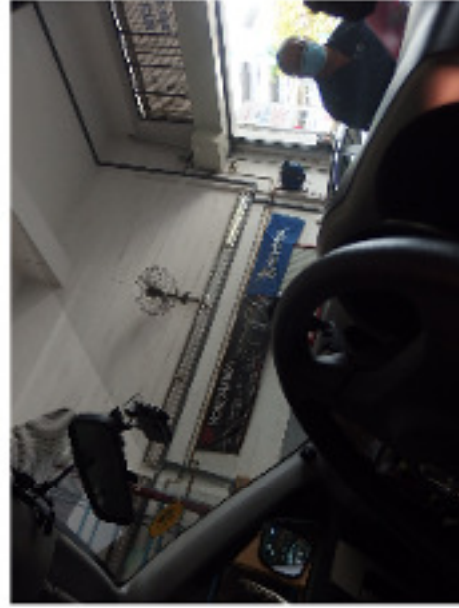





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

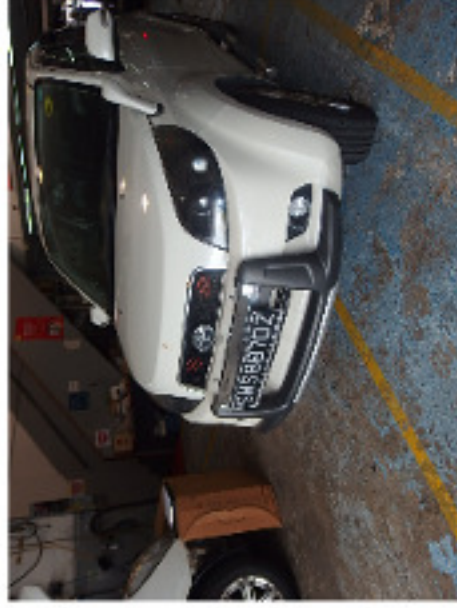




## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

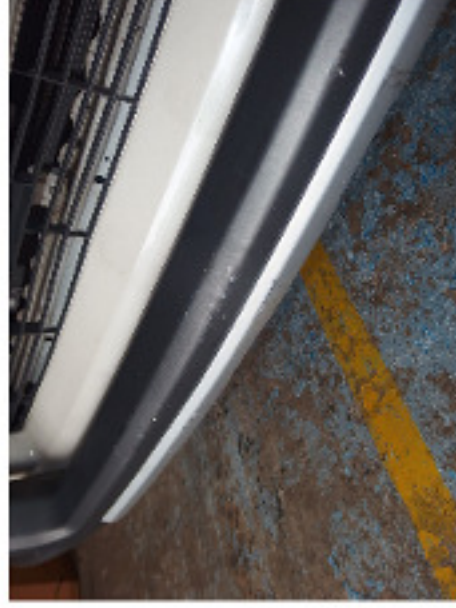





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

S1 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

